

Model Series167: Noises From Area Of Instrument Panel

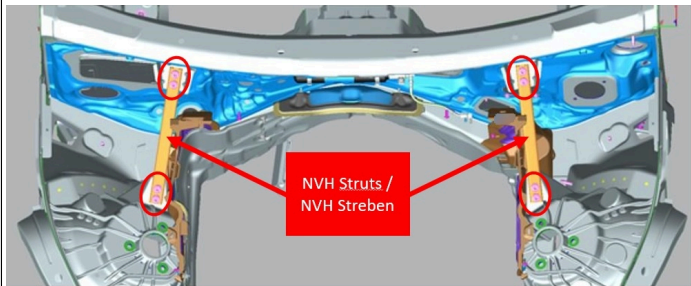
Topic number	LI68.10-P-075301
Version	1
Function group	68.10 - Instrument panel
Date	9/12/22
Validity	SOP to 31.10.2022
Reason for change	

Complaint

Metallic noises from area of instrument panel

Cause

Due to a possible drop in torque at the screw connection of the NVH struts in the engine compartment (see picture in the attachment), noises may be perceived in the area of the instrument panel.

Attachments	
File	Description
NVH Struts - NVH Streben.jpg	NVH Struts - NVH Streben
	

Remedy

Replacement of the 8 screws of the NVH struts in the engine compartment.

Symptoms						
Body > Interior equipment > Instrument panel > Noise						
Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0019903511			THREAD ROLLING SCREW; M10X35	8		X
Operation numbers/damage codes						

XENTRY TIPS

Op. no.	Operation text	Time	Damage code	Note
			62A1V36	
			62N1V36	