

206 295 297 Trunk Lid/Tailgate Unlocks But Does Not Open

Topic number	LI72.20-P-075232
Version	1
Function group	72.20 - Tailgate, rear door
Date	9/14/22
Validity	MODEL 206 with code 881 or 890 up to manufacturing date July 30, 2022 MODEL 295 with code 881 up to manufacturing date July 30, 2022 MODEL 297 up to manufacturing date July 30, 2022
Reason for change	Added information regarding function of interior trunk.

Complaint

When attempting to open the trunk lid or the tailgate, the trunk lock unlocks, but there is no actuation of the trunk control/tailgate control drive unit (M51/3).

Cause


Faulty microswitch signal at trunk lock.

In the event of a problem, the status of the trunk lock (picture 1) does not change during opening/closing of the trunk lid or tailgate.

The function of the interior trunk release is not affected.

XENTRY Diagnosis COM Kit path: XD > HKS/KDS CU (N121/1) > ACTUAL values > Status of trunk lock

Attachments	
File	Description
XENTRY Still.png	

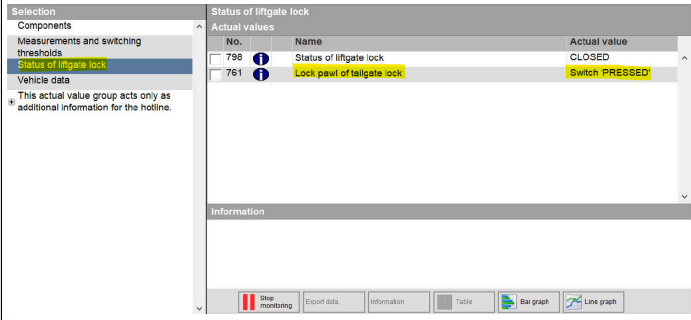

Actual values		
No.	Name	Actual value
798	Status of liftgate lock	CLOSED
781	Lock pawl of tailgate lock	Switch_PRESSED

Remedy

XENTRY TIPS

Replace trunk lock (A85/5).

WIS-References		
Document number	Title	Note
AR72.20-P-1022WT	Remove/install liftgate latch	Model 206.2
AR88.50-P-0003EQE	Remove/install trunk lid lock	Model 295
AR88.50-P-0003WT	Remove/install trunk lid lock	Model 206.0/1
AR72.20-P-1022EQS	Remove/install liftgate latch	Model 297

Symptoms
Body > Door/Flap > Hood/flap > Trunk lid/liftgate > Does not open

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A0997504000			Lock	1	As required	X
A0997401500			Tailgate door lock	1	As required	X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			7501173	Trunk lid trunk lock
			7431173	Tailgate trunk lock