

AJ20-P4 Fuel Pump Driver module

18-22MY Land Rover Defender, Discovery, Discovery Sport, Range Rover, RR Sport, RR Evoque, RR Velar
18-22MY Jaguar XF, XE, E-PACE, F-PACE

Customer Voice:

- Vehicle will have a lack of power, drivability issues, and possible check engine light on.

Technical Description:

- Vehicles will possibly have a stored PCM fault code of P1338-38 - Fuel Pump Driver Module Communication Circuit (Fuel Pump Driver Module) - Signal frequency incorrect and in some cases P008A-84/77-Low Pressure fuel pressure deviation .

Status:

- Do not Flash the PCM as this will not address this concern.
- Please perform the diagnostics in Topix section 303-14 (Engine electric controls).
- Check all wiring using the pinout tests just to make sure the harness/signal side is fault free to the Fuel pump driver module(FPDM)
- If observed voltage value output are outside the tolerances, please replace the FPDM

