


## BODY & CHASSIS

Suspension Warning Displayed On Instrument Cluster	18– 23MY Range Rover (L405), RR Sport, RR Velar, RR Evoque (L551), Discovery, Discovery Sport
<p><b>Customer Voice:</b></p> <ul style="list-style-type: none"><li>– A customer may report that an amber general warning indicator is illuminated and a warning message “Suspension Fault” is displayed on the instrument pack cluster.</li></ul> <p><b>Technical Description:</b></p> <ul style="list-style-type: none"><li>– A check for DTCs may find DTC C105A-01 – (Actuator Circuit Group A - General Electric Failure) or C105B-01 - (Actuator Circuit Group B - General Electric Failure) stored in the Chassis Control Module. This may be caused by a poor connection.</li></ul> <p><b>Status:</b></p> <ul style="list-style-type: none"><li>– SSM 75824 has been published to provide diagnostic guidance for this concern.</li><li>– <b>PLEASE DO NOT REPLACE THE CHCM OR ANY OTHER PARTS.</b></li><li>– Software to address this concern will be released shortly.</li></ul>	 A square icon with a black background and white text. The top part shows a white outline of a car. Below the car, the word "Vehicle" is written in white, sans-serif font.