WNK7 Workshop Campaign - Replace antenna cable plug connections

WNK7 Workshop Campaign - Replace antenna cable plug connections

ID Number WNK7

Models Taycan (Y1A, Y1B, Y1C)

Model Years 2021-2023
VIN List Attached
Number of Affected VINs 5,947

Issue Description There is a possibility that moisture can leak into the

electric plug connections for the antenna cables on the affected vehicles due to a temporary manufactu-

ring defect.

A corroded plug connection can cause increased contact resistances and signal problems over the service

life of the vehicle.

To prevent this from happening, the connector housings for the electric plug connections for antenna cables will be replaced on the affected vehicles and the

plug connections will be repaired if necessary.

What Dealers Should do Please arrange for this measure to be carried out as

soon as possible on affected vehicles. As of the time of this posting, the repair is immediately available. Parts can be ordered via TKR, more information

can be found below and in the Tl.

TI Number No. 149-22

Parts required

Part number	Designation	Quantity/vehicle	Amount
WNK7000001*	Connector housing set for	1 unit	\$31.88

	LTE, front camera and Reversing camera	(for warranty invoicing on- ly)	
WNK70000002*	Connector housing set for LTE and front camera	1 unit (for warranty invoicing on- ly)	\$31.25
WNK70000003*	Connector housing set Reversing camera	1 unit (for warranty invoicing on- ly)	\$30.63
WNK7000004*	Antenna cable repair kit Front camera & plug connection (Blue)	1 unit (for warranty invoicing on- ly)	\$58.13
WNK70000005*	Antenna cable repair kit LTE & plug connection (White)	1 unit (for warranty invoicing on- ly)	\$58.13
WNK70000006*	Antenna cable repair kit Reversing camera & plug connection, (green)	1 unit (for warranty invoicing on- ly)	\$58.13
WNK70000007**	Expendable items	1 unit (for warranty invoicing on- ly)	\$2.50
WNK70000008***	Shipping costs	1 unit (for warranty invoicing on- ly)	As per invoice

^{*}For warranty processing, the Part No. WNK70000001-6 with the designation 'WNK7 Plug connections repair kit' can be invoiced as an additional part in the warranty claim. Amount as per table.

Please document a copy of the invoice for this in the warranty claim.

For all other vehicles on which parts from this collective order will be used, only the repair kit, expendable items and working time must be invoiced.

Ordering connectors for antenna cables:

The parts required for replacing the connector housings for antenna cables must be ordered individually or as a collective order - as required - from the TKR Automotive GmbH online shop.

^{**}For warranty processing, the Part No. WNK70000007 with the "expendable items" designation can be invoiced as an additional part in the warranty claim. Maximum cost: \$2.50.

^{** *}For a collective order, the shipping costs must only be invoiced once for the first vehicle during warranty processing by specifying Part No. WNK70000008 with the designation "Shipping costs" as an additional part and using the amount as per invoice.

The link for the online shop is: http://www.tkr-connector.com

Ordering required parts:

Please initially order only 80% of the repair kits 1-3 you need.

Due to the expected failure rate of corroded plug connections, please order only approx. 8% of repair kits 4-5 and less than 1% of repair kit 6.

Warranty processing

Validity:

This workshop campaign will be carried out up to September 1st, 2027 and will be closed on that date.

Please note that warranty claims can only be processed up to this date.

Scope 1: Replacing connector housing for LTE antenna cable, front and reversing camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 90 TU

Scope 2: Replacing connector housing for antenna cable for LTE and front camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 38 TU

Scope 3: Replacing connector housing for antenna cable for reversing camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 62 TU

Scope 4: Replacing front camera antenna cable and connector housing for LTE antenna

Damage Code WNK7 66 000

Repair Code 2

Labor time 312 TU

Scope 5: Replacing antenna cable for LTE antenna and front camera connector housing

Damage Code WNK7 66 000

Repair Code 2

Labor time 305 TU

Scope 6: Replacing reversing camera connector housing, antenna cable for LTE antenna and front camera

WNK7 Workshop Campaign - Replace antenna cable plug connections

Damage Code WNK7 66 000

Repair Code 2

Labor time 333 TU

Scope 7: Replacing connector housing for LTE antenna, front camera and antenna cable for reversing camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 223 TU

Scope 8: Replacing antenna cable for LTE antenna, front and reversing camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 467 TU

Scope 9: Replacing front camera antenna cable and connector housing for LTE antenna

Damage Code WNK7 66 000

Repair Code 2

Labor time 268 TU

Scope 10: Replacing antenna cable for LTE antenna and front camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 289 TU

Scope 11: Replacing antenna cable for LTE antenna and front camera connector housing

Damage Code WNK7 66 000

Repair Code 2

Labor time 261 TU

Scope 12: Replacing antenna cable for reversing camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 195 TU

Scope 13: Replacing connector housing for LTE antenna and replacing antenna cable for front and reversing

camera

Damage Code WNK7 66 000

Repair Code 2

WNK7 Workshop Campaign - Replace antenna cable plug connections

Labor time 431 TU

Scope 14: Replacing front camera connector housing and replacing antenna cable for LTE antenna and

reversing camera

Damage Code WNK7 66 000

Repair Code 2

Labor time 425 TU

Please enter the campaign carried out in the Warranty and Maintenance booklet for the vehicle.

Customer mobility

If requested, mobility for the affected customer can be guaranteed by offering a suitable replacement vehicle. Please invoice this additional service again via WWS with the campaign scope.