

Reference	SSM75741
Models	New Range Rover / L460 New Range Rover Sport / L461
Title	V8 T/C 4.4 22MY Restricted Performance/Torque Derate, Failed ECO Start Possible MIL.
Category	Engine
Last modified	22-Sep-2022 00:00:00
Symptom	499000 Basic Engine
Content	<p>Issue: Loss of performance/torque derate, slow to accelerate. Failed eco-starts. In the presence of DTC P0191-85 stored on PCM (P01BF-85 on both PCMs).</p> <p>Cause: Under investigation.</p> <p>Action:</p> <ul style="list-style-type: none">• Do NOT replace the sensor unless electrical checks show genuine fault with part. Ensure PCM software is up to date. Clear DTCs and retest. Return to customer. There is the possibility that a key cycle will remove torque derate.• Please raise an EPQR specifying “Customer symptoms of torque derate and/or failed eco-starts with P0191-85 or P01BF-85 stored in PCM” and provide a session file.

anBhdHRicnM7MjAyMj0xMz0wNVQxNz00Mz0wMj0xND0wOzEzNi4yMjYyNzluMTI3Ow==