



BMPRO MOTOR FUNCTION WIRING

Bulletin Type:	TSB	Publication Date:	October 2022
Bulletin #(s):	22-079	Make(s):	Jayco
Job Code(s):	9801573	Model(s):	Eagle HT TT
Flat Rate(s):	9801573 – .25 Repair	Model Year(s):	2023

Incident:	Exterior Travel lockout switch does not disengage motor functions (jacks, awnings, slideouts, etc.)
Affected Units:	2023 Jayco Eagle HT TT
Parts List:	Parts Kit #: N/A
Misc. Tools & Supplies:	Square Driver, Screw gun, wire strippers, 3 way wago, 14 gauge stranded wire (Shop Supplies)
Parts Return Information:	N/A

BMPRO MOTOR FUNCTION WIRING REPAIR INSTRUCTIONS

1. Locate the BMPro access cover located in the Off Door Side pass through storage and remove the two screws using a #2 square bit and a screw gun. Save screws for reinstall.



Fig. 1

2. Remove the white wire in the #80 slot on the BMPro. (Figure 2)
3. Using (2) 6" pieces of 14 gauge stranded wire, depress the white tabs on the BMPro and insert one into slot #62 and then one into slot #80. Using a 3-way wago, connect the original wire to the two jumpers. (Figure 3)
4. To test the fix, plug the pigtail into a testing box or vehicle and activate the 4-way flashers. While flashing, motor functions should not be functional. Turn the 4-way flashers off. Hit the "retract" button on the front landing legs. (Figure 4) All motor functions should be operable once again.
 - a. Note: This only applies to Eagle HT travel trailers that are equipped with the electric jack option. This does not affect trailers with auto leveling.

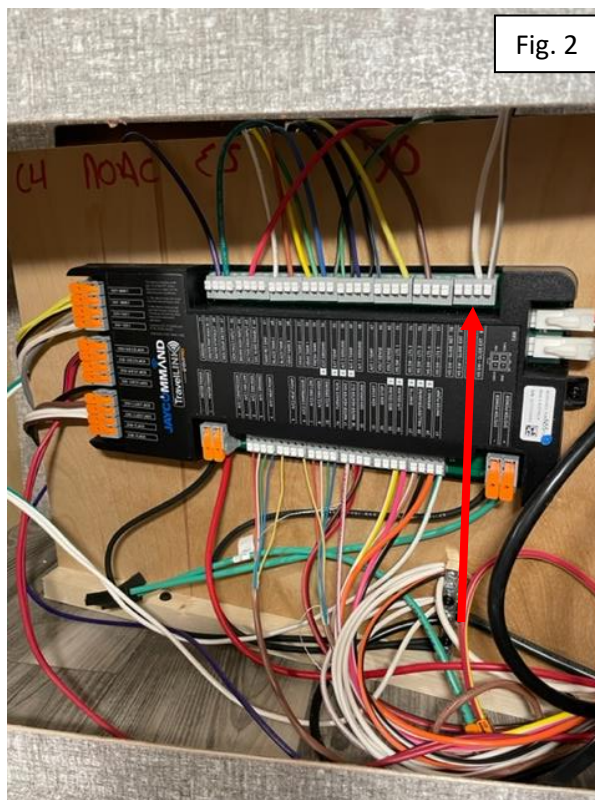


Fig. 2

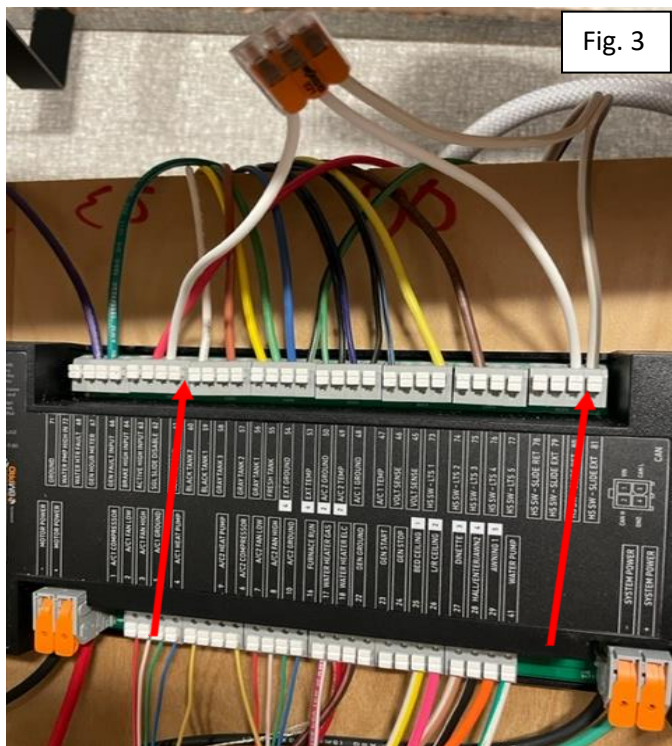


Fig. 3



Fig. 4

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540