TECHNICAL SERVICE BULLETIN

Classification:

NISSAN

Reference:

Date:

EC20-031B

NTB21-001B

October 6, 2022

TCM COMMUNICATION ERROR CAUSING A NO START CONDITION

This bulletin has been amended. See AMENDMENT HISTORY on the last page. Please discard previous versions of this bulletin.

APPLIED VEHICLES: 2020-2021 Titan/Titan XD (A61)

SERVICE INFORMATION

If a customer states the engine will not crank and will not start (may be intermittent) and DTC U0101 (Lost Comm TCM) is stored in the ECU (**ENGINE**), and/or stored in the SCU (**SHIFT**) as PAST or CURRENT,

OR

The TCM shows as "UNKWN" in the **PRESENT** column, or "0" in the **PAST** column, under the **CAN DIAG SUPPORT MNTR** tab in the ECU or SCU in C-III plus.

- Please check Service COMM or Dealer Business Systems (DBS) National Service History to confirm if campaign R22B1 or R22A9 has been applied.
- 1. Has campaign R22B1 or R22A9 already been completed?

No: Complete the related campaign bulletin.

Yes: Proceed to step 2.

2. Refer to the ESM for further diagnostic information not covered by this bulletin.

NOTE: If the Park indicator is not displayed in the Driver Information Center (Figure 1) and C-III plus does not display the current TCM part number after a 2 minute wait with the ignition ON, engine OFF, this TSB **does not apply**. Refer to the ESM for further diagnostic information.





Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
January 6, 2021	NTB21-001	Original bulletin published
March 30, 2021	NTB21-001A	CLAIMS INFORMATION updated
October 6, 2022	NTB21-001B	Changes made throughout