



## STAR ONLINE PUBLICATION




**Case Number:** S2208000010

**Release Date:** January 2022

**Symptom/Vehicle Issue:** CEL Check Engine Lamp On, Start Stop Inoperative

**Customer Complaint/Technician Observation:** Owner complaint Check engine lamp is on. Technician observed the vehicle is setting P1056 Intake Valve Control Solenoid 3 Circuit/Open, P1059 Intake Valve Control Solenoid 4 Circuit/Open, P0023 Bank 2 Camshaft 2 Position Actuator Circuit Open, P0020 Bank 2 Camshaft 1 Position Actuator Circuit Open as stored or active. All associated DTC's have this as a common ground as a possible cause.

**Repair Procedure:** Inspect ground location G914A, clean and secure. No parts required.

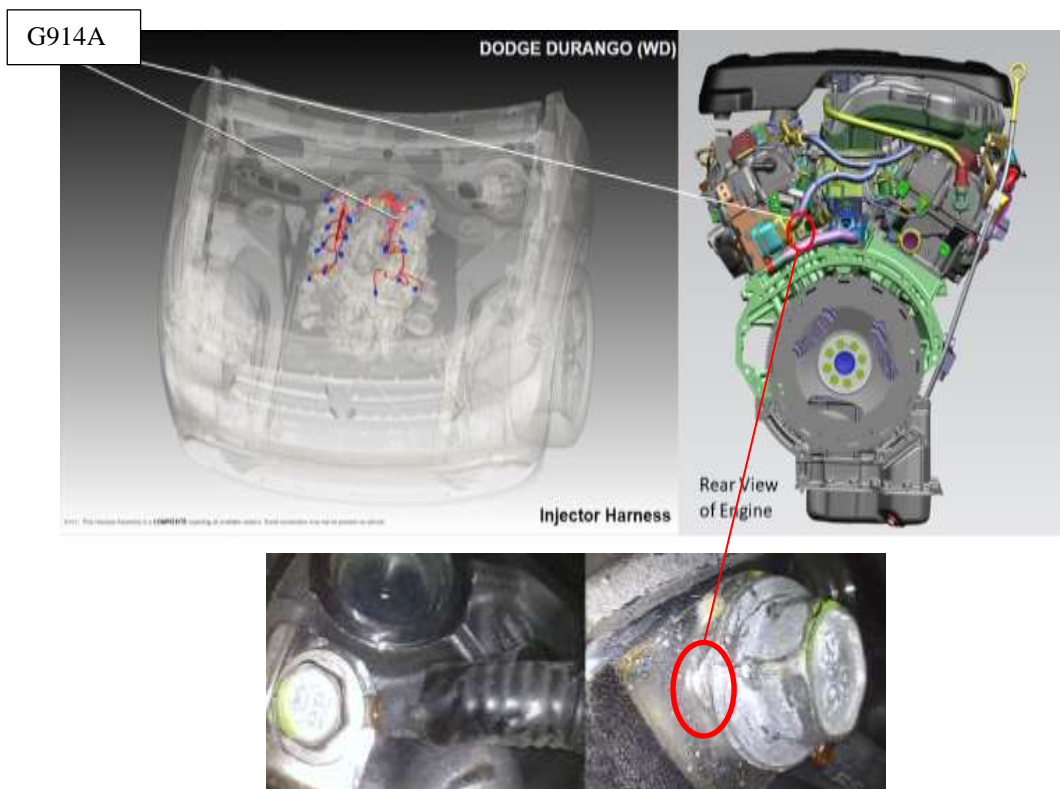

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**