



STAR ONLINE PUBLICATION



Case Number: S2219000001

Release Date: January 2022

Symptom/Vehicle Issue: Odometer Flashing And Or Active Lane Management Not Operational. C221F-00 ECU Not Initialized Set

Customer Complaint/Technician Observation: Customer complaint for any of the following:

- Flashing Odometer (any driving condition)
- Active Lane Management Not Operational (when feature is engaged properly)

AND:

- Technician finds C221F-00 ECU Not Initializing

Discussion: If these conditions are present AND there is an ACTIVE EPS C221F-00 DTC, the ADAS feature is disabled due to the EPS missing PROXI information. Using wiTECH, perform a proximi configuration alignment. This routine is available under the 'Diagnostic Procedures' tab found on the home, 'Vehicle View', page of wiTECH. After the PROXI is performed, conduct a Perform an EPS reset. This can be found in the Guided Diagnostics menu of wiTECH.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found