



## STAR ONLINE PUBLICATION



**Case Number:** S2208000025

**Release Date:** January 2022

**Symptom/Vehicle Issue:** ABS Lamp On, U0121 Lost Communication With ABS Module, Stop Start Inoperative U0037-00 LIN BUS

**Customer Complaint/Technician Observation:** Owner complains the ABS lamp turns on intermittently, stop start inoperative message displayed on the cluster. Technician observed DTC U0121 Lost Communication With Anti-Lock Brake Module and U0037-00 LIN BUS as stored or active.

**Repair Procedure:** Inspect the ground location G907A, clean and secure the location as needed. No parts required, Fig 1, 2.

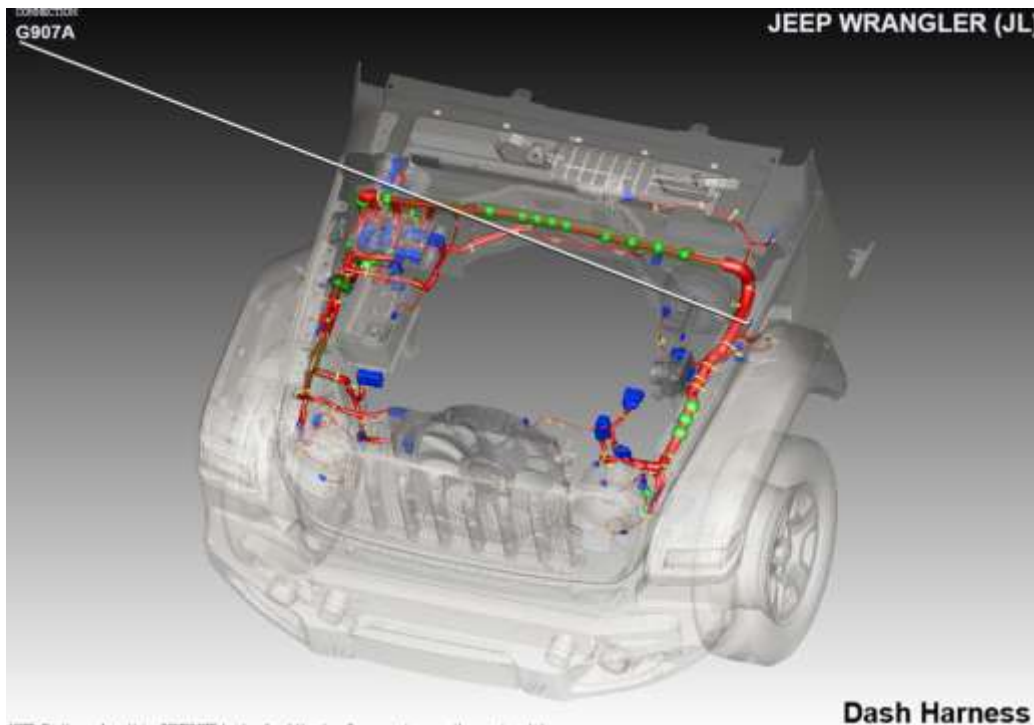


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**



# STAR ONLINE PUBLICATION

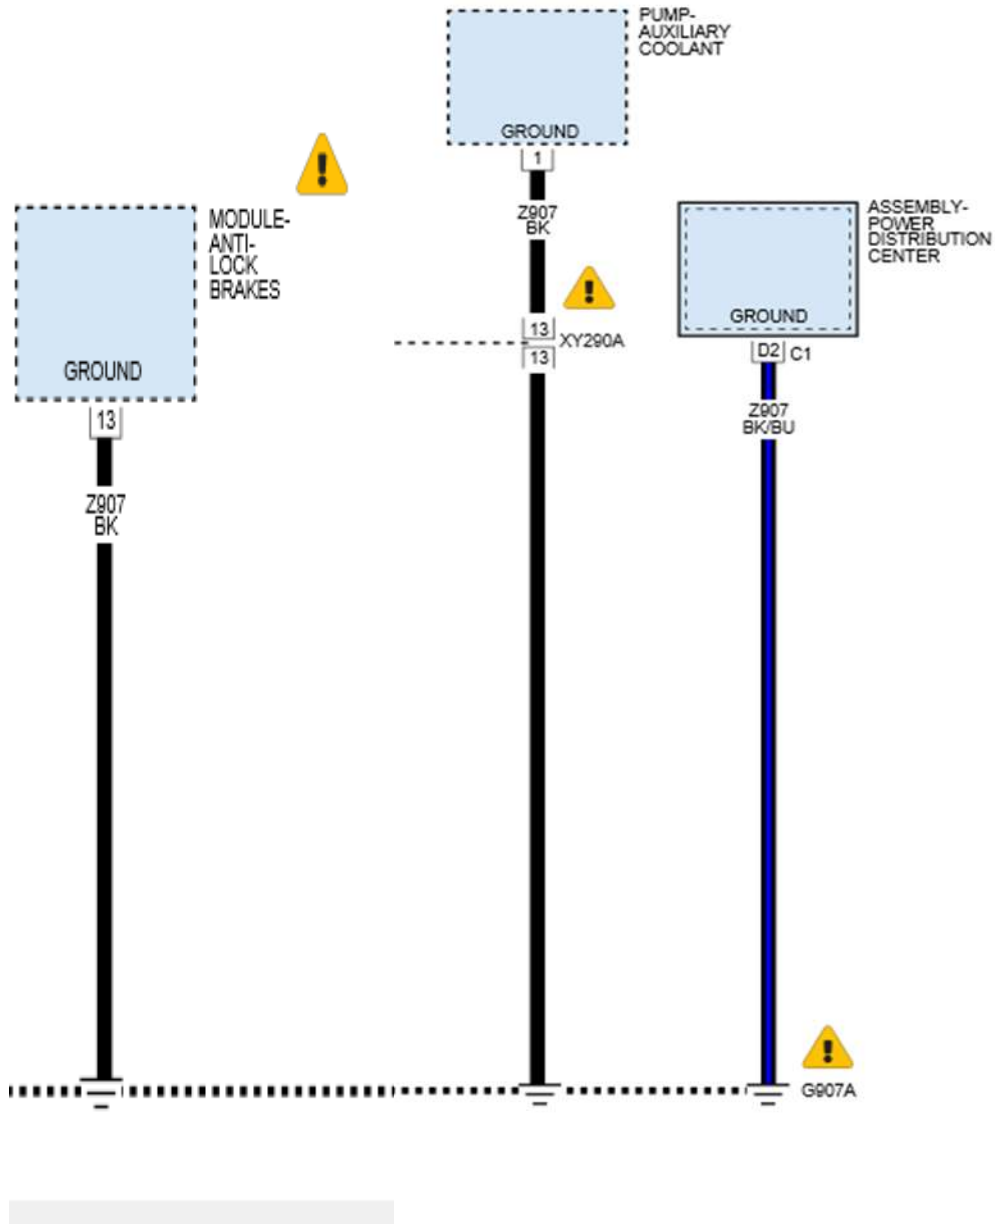


Fig 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

**Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found**