



STAR ONLINE PUBLICATION



Case Number: S221800001

Release Date: January 2022

Symptom/Vehicle Issue: Customer concern includes Mil-On/Check Engine Lamp-On. There also may or may not be driveability-related concerns that accompany the Mil-On condition. Upon further investigation, there may be a fault code for P062A-FUEL PUMP CONTROL PERFORMANCE.

Discussion: Before performing normal diagnostic routines for P062A, check for worn spark plugs. End-of-life gap for spark plugs is 0.052 in. Replace worn plugs. If spark plug gaps exceed 0.065 in, replacement of ignition coils may also be necessary to eliminate the condition.

If after replacing worn ignition components, the condition still exists, proceed with performing normal published diagnostic routines for the related fault code.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found