



NUMBER: 03-001-22

GROUP: 03 - Differential and Driveline

DATE: January 25, 2022

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

SUBJECT:

Charger Pursuit All Wheel Drive (AWD) Front Halfshafts

MODELS:

2014 - 2020 (LD) (Dodge Charger)

NOTE: This Informational bulletin applies to vehicles equipped with Performance Handling Group (Sales Code AHB).

DISCUSSION:

If a front halfshaft boot is found to be leaking due to fatigue, replace the halfshaft with the updated part numbers listed. Previous versions of front halfshaft boots can leak from fatigue due to pursuit vehicle duty cycles being outside the optimal travel limits for boot fatigue life. The new boot design accommodates additional travel associated with pursuit vehicle duty cycles.

Updated AWD Front Halfshaft Part Numbers:

- 68545640AA - Halfshaft, Right-Front Axle.
- 68545641AA - Halfshaft, Left-Front Axle.

POLICY:

Information Only