



Preliminary Information

PIT5626D Intermittent Communications Concerns - Possible Multiple MILs on U0073 or Multiple U-Codes Stored

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2016 - 2022	All	All	LCV	All
GMC	Canyon	2016 - 2022	All	All	LCV	All

Involved Region or Country:	North America
Condition:	Intermittent multiple MIL's or messages, loss of communication, potential U-codes.
Cause:	Main harness chaffed under hood.

Correction:

Check for harness chaffing on the low side A/C pipe, left side below the exhaust manifold. This is best observed through the left wheel well opening.



Service Procedure:

Repair per instructions in SI and secure harness away from the pipe.

The plant is investigating the root cause and will put in corrective action.

Version History

Version	5
Created	07/31/2018 - Created on 07/09/2019 - Updated to include 2019 Model Year. 10/16/2019- Updated to add 2020 Model Year. 12/09/2021- Updated to add the 2021 Model Year. 09/06/2022- Updated to add the 2022 Model Year.



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.