



Preliminary Information

PIT5723A Service Engine Soon (SES) Lamp Illuminated, DTC P1467 and/or P1469 Set

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	2.7L (RPO L3B)	All
Chevrolet	Silverado 1500	2020	All	All	2.7L (RPO L3B)	All
GMC	Sierra 1500 (New Model)	2019	All	All	2.7L (RPO L3B)	All
GMC	Sierra 1500	2020	All	All	2.7L (RPO L3B)	All

Involved Region or Country	North America
Additional Options (RPO)	
Condition	Some customers may comment that the SES light is on. Dealer may find DTC's P1467 and/or P1469 set in the ECM.
Cause	The EVAP purge pump may be filling with liquid fuel due to customer over filling the fuel tank.

Correction:

Engineering has released an updated Evaporative Emission Purge Pump and Evaporative Emission Canister to correct this concern. Please follow latest version of [N202324990](#) : Special Coverage - Evaporative Emissions Purge Pump.

Version History

Version	2
Modified	12/09/2019 - Created on 09/14/2022 - Updated to follow N202324990: Special Coverage - Evaporative Emissions Purge Pump

