



Preliminary Information

PIT5949 Overhead Roof Console Inoperative / Service Safety Restraints Message / Sunroof Inoperative / Dome Lights Inoperative / DTCs B1A7A and U1121

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade Models	2021 - 2023	All	All	All	All
Chevrolet	Suburban	2021 - 2023	All	All	All	All
Chevrolet	Tahoe	2021 - 2023	All	All	All	All
GMC	Yukon Models	2021 - 2023	All	All	All	All

Involved Region or Country	North America
Condition	<p>In some rare cases, a customer may comment at start up that their vehicle has the following symptoms:</p> <ul style="list-style-type: none"> - Service Safety Restraints System Message - Sunroof Inoperative - Sunshade Lights Inoperative - Dome Lights Inoperative - Power Liftgate Inoperative when using switch in overhead console - DTCs U1121 set in the BCM and B1A7A set in the Restraints Module <p>During the condition, if one of the overhead roof console dome/map lights is cycled on/off then all functions will return to normal operation for the entire ignition cycle.</p> <p>Important: Even when all other overhead roof console functions are inoperative, the Onstar button / LED will still be operational.</p> <p>Note: For the 2021 model year vehicles, please be aware of PIT5774F which has a similar condition, but the conditions listed in that PI do not recover functionality if the dome/map light switch is cycled on/off.</p>
Cause	Unknown

Correction:

GM Engineering is working on a fix. In the meantime, if this condition occurs please ask the customer to cycle one of the overhead roof console dome/map lights on/off. This will correct the concerns for that ignition cycle.

Version History

Version	1
Modified	09/27/2022 - Created on.



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.