



37-20-01TT - Multifunction Steering Wheel Control Module -J453- Replacement

Release date: 10/13/2022

### Condition

**ATTENTION:**

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.**

**TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Tiguan LWB	2018-2020	All	All	All	All

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2060583/2	10/13/22	37-20-01TT	Update to step 2 scan tool navigation.
2060583/1	8/28/20	37-20-01TT	Original publication.

### Technical Background

Fault codes B114E96 or B114F96 in Multifunction Steering Wheel Control Module -J453-.

The Databus Diagnostic Interface -J533- needs to be configured upon Multifunction Steering Control Module -J453- replacement for vehicles that are not equipped with tiptronic buttons.

### Service

1. After replacing the Multifunction Steering Wheel Control Module -J453-, check to see if the fault codes **B114E96: Tiptronic downshift button on steering wheel internal malfunction** and/or **B114F96: Tiptronic upshift button on steering wheel internal malfunction** occur in Address Word 19 (AW19) Databus Diagnostic Interface.
2. If the faults are present, Start Self-diagnosis, go to AW19, go to adaptation, search for multi-function steering wheel control module coding value, use the drop down menu to find and set the steering wheel Tiptronic switch to "Not installed".

### Additional Information

© 2022 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.