

Technical Service Bulletin

GROUP	NUMBER	
FUEL SYSTEM	22-FL-002H	
DATE	MODEL(S)	
OCTOBER 2022	SONATA (DN8a) SANTA FE (TMa) SANTA CRUZ (NXT) TUCSON (NX4a)	

SUBJECT: MISFIRE DTC (P030X) - INTERNAL GDI INJECTOR LEAK REPAIR

Description: This bulletin provides the diagnostic procedure for the GDI injector(s) in certain 21-22MY Sonata, Santa Fe, and certain 22MY Santa Cruz, and Tucson equipped with 2.5L GDI engines with one or more misfire DTC(s) due to internally leaking GDI injector(s).

Applicable Vehicles:

- Certain 2021~22MY Sonata (DN8a) (VINS starting with 5NP)
- Certain 2021~22MY Santa Fe (TMa) (VINS starting with 5NM)
- Certain 2022MY Tuscon (NX4a) (VINS starting with 5NM)
- Certain 2022MY Santa Cruz (NXT)

Parts Information:

MODEL	PART NAME	PART NUMBER	QTY
Sonata (DN8a)		35310-2S000QQH	*Must replace for any affected injector(s)
Santa Cruz (NXT) Santa Fe		35305-2S000QQH	1 (Must replace with new for reassembly)
(TMa) Tucson	COMBUSTION SEAL RING	35312-04AA0	*Must replace for any reused injector(s)
(NX4a)	BOLT	11403-08556K	1-4 Required only for replaced injector(s)

Warranty Information:

MODEL	OP CODE	OPERATION	OP TIME	CAUSAL PART	NATURE CODE	CAUSAL CODE
Sonata (DN8a)	20DA14R1	Replace 1 GDI fuel injector	1.3	35310-2\$000	I3T	ZZ5
Santa Cruz (NXT)	20DA14R2	Replace 2 GDI fuel injectors	1.3	35310-2S000	I3T	ZZ5
Santa Fe (TMa)	20DA14R3	Replace 3 GDI fuel injectors	1.3	35310-2\$000	I3T	ZZ5
Tucson (NX4a)	20DA14R4	Replace 4 GDI fuel injectors	1.3	35310-2S000	I3T	ZZ5

NOTE 1: Submit Claim on Campaign Claim Entry Screen.

NOTE 2: If a part that is not covered by this TSB is in need of replacement while performing this TSB, and the affected part is still under warranty, please submit a separate claim using the same repair order. If the part is out of warranty, submit a prior approval request for goodwill consideration

SUBJECT:

LEAKING GDI INJECTOR REPAIR (P030X)

prior to performing the work.

NOTE 3: A STUI video/picture(s) showing the replacement injector(s), high pressure fuel pump, and re-used injector(s) with the new combustion seal ring(s) along with a piece of paper displaying the last 6 digits of the VIN and the date of the repair must be included and uploaded to STUI. **If not included, claim will be subject to debit.**

NOTE 4: The incident parts are subject to callback through the normal Warranty Technical Center(WTC) parts return process. Claim is subject to debit if the part is requested and not returned.

STUI



This TSB includes STUI pictures as a requirement. The STUI pictures require the VIN and date of the repair to be clearly visible. Please include the last 6 digits of the VIN and date of the repair on a piece of paper next to injectors (1-4), high pressure fuel pipe replacement, new bolts, re-used injectors with combustion seal rings. Ensure the captured pictures are completed according to the steps in the TSB. All submitted claims without associated STUI pictures that do not capture the VIN, repair date, or injectors (1-4), high pressure fuel pipe replacement, new bolts, re-used injectors with new combustion ring seal are subject to debit. In addition, any claims found to have an illegible, incomplete, missing, or incorrect pictures are subject to debit.


Service Procedure:

- If Check engine light (P030X) is stored, leaking GDI fuel injector may be the cause.
 Follow the troubleshooting steps to correctly identify if the misfire is caused by a leaking GDI fuel injector.
- 2. Using the GDS, select **DTC Analysis** and **ENGINE** menu. Record the DTC and Freeze Frame Data. Note which cylinder(s) are affected. Delete the DTC.


TSB #: 22-FL-002H Page 2 of 4

LEAKING GDI INJECTOR REPAIR (P030X)

3. From the GDS home screen, select **Data Analysis** and menu. Then select **ENGINE**.

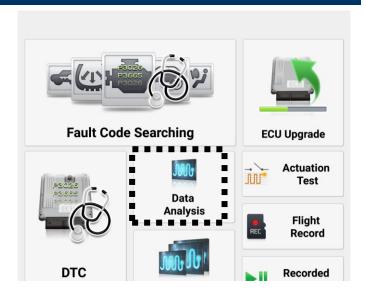


4. Start the engine and monitor the Fuel Pressure.

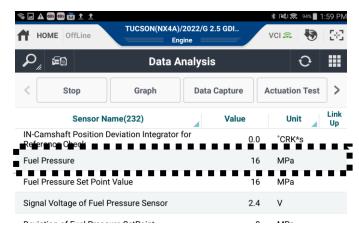

5. Shut off the engine and monitor the fuel pressure. If the pressure does not drop, this bulletin does not apply and continue with normal diagnostic for misfires.

If the pressure drops, replace the GDI fuel injector(s) on the affected cylinder(s).

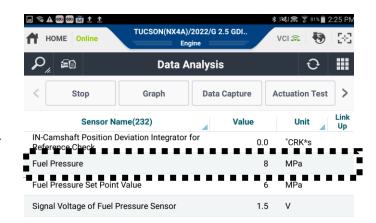

Follow the repair procedure in the shop manual: Engine Control / Fuel
 System→ Engine Control System→ Injector→ Repair procedures→ GDI Injector.

TSB #: 22-FL-002H Page 3 of 4

7.

STUI



Using STUI, take photos of the injectors (1-4), high pressure fuel pipe replacement, new bolts, re-used injectors with new combustion ring seal with the last 6 digits of the VIN and the date of repair on a piece of paper.

Upload the photos to STUI.



Install new combustion seals on all the reused injectors during reinstallation.

In addition, replace the high pressure fuel pipe with a new part after reinstallation of the fuel rail.

Refer to the shop manual section for complete service procedure:

Engine Control / Fuel System → Fuel Delivery System → Injector

- 8. Upload the freeze frame data for future claim verification.
- 9. Service procedure is now complete.

TSB #: 22-FL-002H Page 4 of 4