



# HYUNDAI

## Technical Service Bulletin

GROUP	NUMBER
CAMPAIGN	22-01-073H
DATE	MODEL(S)
OCTOBER 2022	SANTA FE SPORT (AN)

**SUBJECT:** JUNCTION BOX UPPER COVER LABEL REPLACEMENT (SERVICE CAMPAIGN 985)


**\* IMPORTANT**

**\*\*\* Retail Vehicles \*\*\***

Dealers must perform this Service Campaign whenever an affected vehicle is in the shop for any maintenance or repair.

Access the “Vehicle Information” screen (VIS) via WEBDCS to identify open campaigns.

**Description:** Certain 2017-2018MY Santa Fe Sport (AN) vehicles received an incorrectly labeled fuse cover during Recall 218. This bulletin describes the procedure to replace the label with a corrected one.

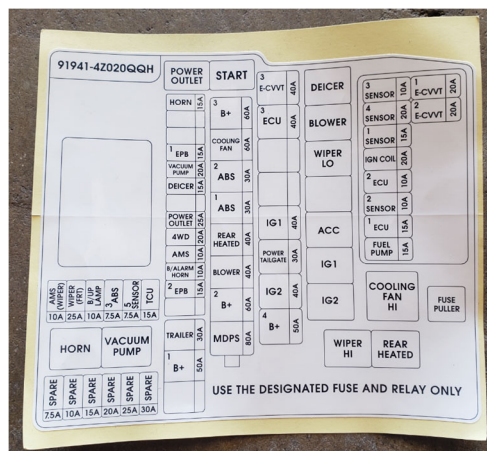

**Applicable Vehicles:**


- Certain 2017-2018MY Santa Fe Sport (AN) not equipped with Smart Cruise Control (“SCC”) and produced from 12/17/2015 ~ 04/11/2018.

**STUI**



**This TSB includes a STUI picture requirement.** The two STUI pictures require the VIN and date of repair to be clearly visible. Please include a copy of the RO or last 6 digits of the VIN and date of repair on a piece of paper for each STUI picture. Ensure the captured pictures are done according to the steps in this TSB and uploaded to STUI once completed. **All claims found to have an illegible, incomplete, missing, or incorrect picture(s) are subject to debit.**

**Parts Information:**

Model	Part Name	Part Number	Figure	QTY.
Santa Fe Sport (AN)	Upper Cover Label	91940-4Z020QQH		1

**Warranty Information:**

Model	Op. Code	Operation	Op. Time	Causal Part	Nature Code	Cause Code
Santa Fe Sport (AN)	20D092R0	Upper Cover Label Replacement	0.2 M/H	91940-4Z020QQH	B1A	ZZ1

**NOTE 1:** Submit Claim on Campaign Claim Entry Screen

**NOTE 2:** Op time includes taking two pictures using STUI. Claim must include STUI pictures with a piece of paper displaying the last 6 digits of the VIN and the date of repair. **If illegible, incomplete, missing, or incorrect, claim will be subject to debit.** The two pictures must show:

- 1) The currently installed multi-fuse.
- 2) The junction box upper cover with the new label installed.

**Service Procedure:**

1. Open the vehicle's hood and locate the engine room junction box.



2. Remove the junction box upper cover.




3. Confirm that the correct multi-fuse has been installed in the junction box.

Example of STUI Photo



**Correct multi-fuse.** Fuse is taller, with protruding individual, replaceable fuses.

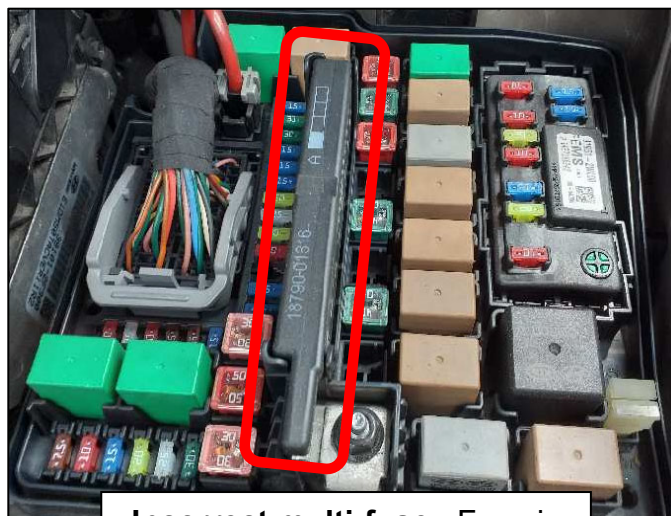

**Incorrect multi-fuse.** Fuse is shorter and flat across the top.

**STUI**



Using STUI, take a photo of the installed multi-fuse with the last 6 digits of the VIN and the date of repair on a piece of paper.

Upload the photo to STUI.

4. Clean the interior surfaces of the junction box upper cover using a damp towel. Dry thoroughly.


Affix the new label to the underside of the upper cover.

**STUI**



Using STUI, take a photo of the installed new label with the last 6 digits of the VIN and the date of repair on a piece of paper.

Upload the photo to STUI.

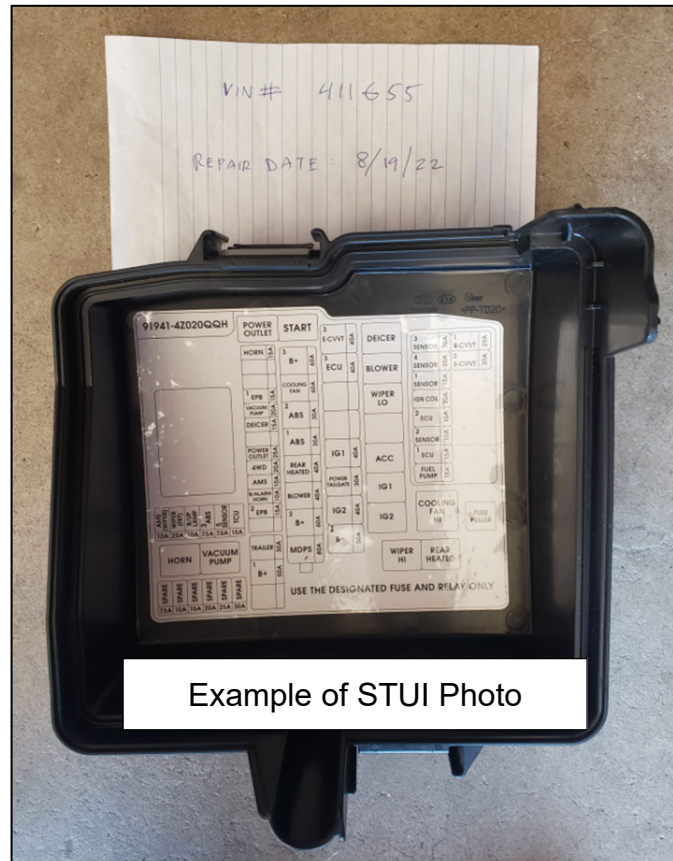

5. Replace the upper cover and close the hood to complete the service procedure.