

# Revised Fan Ring Bracket Mounting Screws

M-263-006

(July 2008)

## Valid for

GU models built before June, 24 2008

CXU and CHU models built before July, 8 2008


## Case description

Effective on the dates shown below, a longer mounting screw (part number 945444) for the left-side fan ring mounting bracket was implemented into production on all CXU, CHU and GU model chassis equipped with MP7 or MP8 engines, replacing the previous screw (part number 64AM12).

The revised screw is 25 mm long, 5 mm longer than the previous screw. Should broken left-side fan ring bracket mounting screws be encountered on a CXU, CHU or GU model chassis manufactured prior to the above mentioned dates, replacement with the revised screw is recommended.

*Note: Does not apply to Mack Trucks Australia.*

## Parts

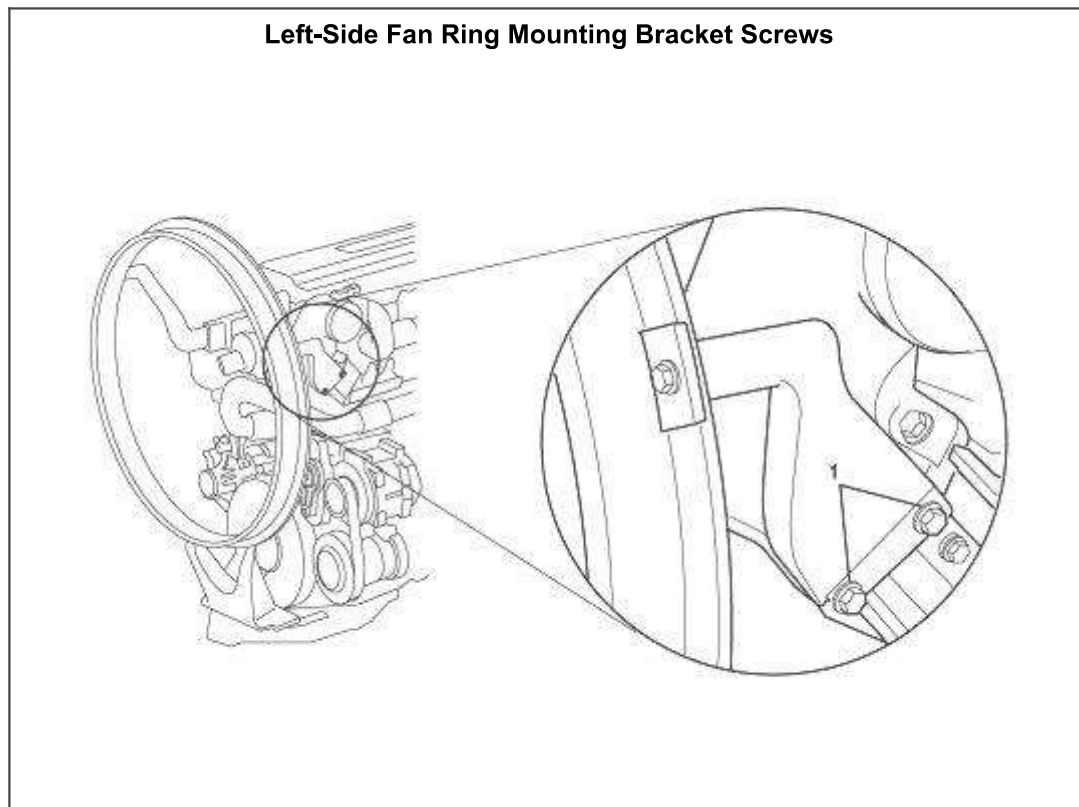

Key	Qty.	Part number	Description	Replaces
1	2	945444	Flange	64AM12

			screw, M8 x 1.25 x 25 mm long	
--	--	--	-------------------------------------	--

Torque specification for the revised bolt is 24 N•m (18 lb-ft).

## Warranty Information

### Reimbursement

<b>This repair may be eligible for reimbursement if a product failure was experienced within time and mileage limits of the applicable Warranty coverage. Reimbursement is obtained via the normal claim handling process.</b>	
<b>Claim Type (used only when uploading from the Dealer Bus. Sys.)</b>	01
<b>Labor Code</b>	
Primary Labor Code	215 6C 00 80 — 0.6 hrs., Time allowed to replace the left-hand fan ring mounting bracket screws on CXU, CHU and GU model chassis. Does not include “take-charge” time.
<b>Causal Part</b>	64AM12

## Issued by

### Technical Service

Mack Trucks, Inc. engages in a continuous program of testing and evaluating to provide the best possible product. Mack Trucks, Inc., however, is not committed to, or liable for updating existing chassis.