

# Rocker Arm Upgrade to Current Configuration

M-214-001


(November 2008)

## Valid for

CXU,CHU,GU,MRU built with an MP8 and before October 2008

## Case description

During 3rd and 4th Qtr 2008, revised rocker arms were implemented into production on MACK MP8 engines for the Inlet, Unit Injector and Exhaust locations. These revised rocker arms must be used for any repairs involving camshaft replacement due to damaged rocker arms and cam lobes. Additionally, if a rocker arm failure has resulted in camshaft lobe damage requiring camshaft replacement, ALL inlet, unit injector and exhaust rocker arms must be replaced except those which may already be current part numbers. Current rockers have the part numbers on them. If any are the part numbers below, do not replace them unless they are damaged. Those which have a part number other than given below, or no part number, are to be replaced with these current part numbers.

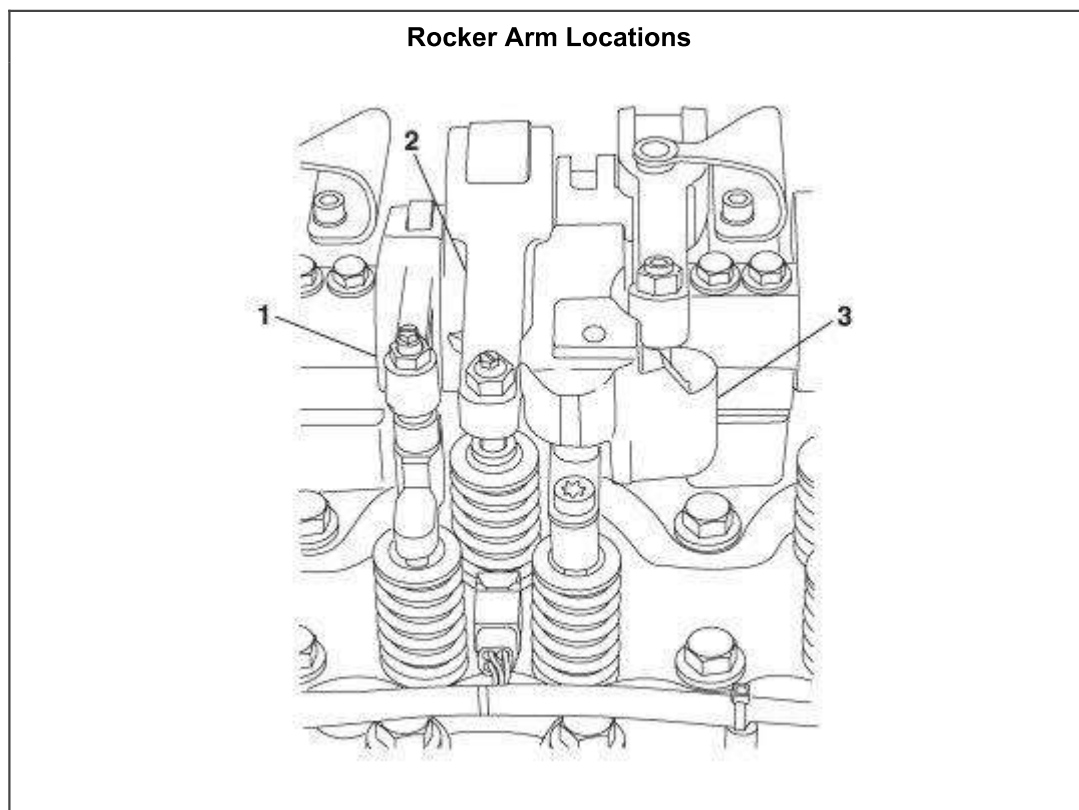

Key	Part number	Description
1	21260905	Inlet Rocker Arm (Production implementation, 10/13/2008)
2	21266310	Unit Injector Rocker Arm (Production

		implementation, 10/27/2008)
3	21228650	Exhaust Rocker Arm (Production implementation, 07/07/2008)

*Note: There is no update applicable to the PowerLeash™ engine brake rocker arm's and they are not to be replaced unless damaged.*

## **Issued by**

Technical Service

Mack Trucks, Inc. engages in a continuous program of testing and evaluating to provide the best possible product. Mack Trucks, Inc., however, is not committed to, or liable for updating existing chassis.