Technical Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



Subject:

A/C BLOWS WARM AIR AFTER ACCELERATION AND/OR AT AMBIENT TEMPERATURE OF AROUND 68 °F (20 °C) IN DAYTIME

Bulletin No.: 07-004/22

Last Issued: 10/10/2022

BULLETIN NOTES

Previous TSBs:	Date(s) Issued:
07-004/22	09/23/22
07-006/20	12/07/20

APPLICABLE MODEL(S)/VINS

2019-2022 Mazda3 (Japan built) with VINS lower than JM1BP*****516941 (produced before March 1, 2022)

2019-2022 Mazda3 (Mexico built) with VINS lower than 3MZBP*****302558 (produced before February 27, 2022)

2020-2022 CX-30 with VINS lower than 3MVDM******414338 (produced before February 27, 2022)

NOTE: To identify vehicles with cylinder deactivation, examine the 8th digit of the VIN.

- L: 2.5L without cylinder deactivation
- · M: 2.5L with cylinder deactivation

DESCRIPTION

Some customers may complain the A/C blows warm. This may be caused by one of two things.

- Cause 1: After accelerating in hot weather, the A/C blows warm air for a longer time than other models. This is caused by improper control software of the PCM not allowing the A/C compressor to resume properly after acceleration. During a hard acceleration above a certain throttle level opening, the PCM stops the A/C compressor operation for better acceleration. It then resumes the compressor operation after the acceleration. To eliminate this concern, the control software of the PCM has been modified.
- Cause 2: Insufficient cooling performance at ambient temperature of around 68 °F (20 °C) in daytime. This is caused when both the ambient temperature and the cabin temperature are at around 20 °C (68 °F), auto A/C set at around 20 °C (68 °F) may not cool down the cabin temperature properly. To eliminate this concern, control software of the dash-electrical supply unit (Dash-ESU) has been modified.

Customers having this concern should have their vehicle repaired using the following repair procedure.

Page 1 of 6

Last Issued : 10/10/2022

Bulletin No.: 07-004/22

REPAIR PROCEDURE

- 1. Verify customer concern.
- 2. Perform one or both of the following reprogramming procedures, depending on the VIN and production date.
 - Reprogram the PCM for the following vehicles (for Cause 1). Refer to MDARS ECU Reprogramming Procedure.
 - 2019-2021 Mazda3 (Japan built) with VINS lower than JM1BP*****319059 (produced before October 28, 2020)
 - 2019-2021 Mazda3 (Mexico built) with VINS lower than 3MZBP******208291 (produced before October 30, 2020)
 - 2020-2021 CX-30 with VINS lower than 3MVDM******231004 (produced before November 13, 2020)
 - Reprogram the ESU for the following vehicles (for Cause 2). Refer to MDARS ECU Reprogramming Procedure.
 - 2019-2022 Mazda3 (Japan built) with VINS lower than JM1BP*****516941 (produced before March 1, 2022)
 - 2019-2022 Mazda3 (Mexico built) with VINS lower than 3MZBP*****302558 (produced before February 27, 2022)
 - 2020-2022 CX-30 with VINS lower than 3MVDM******414338 (produced before February 27, 2022)

NOTE:

- If the current calibration file name in the ECU FILENAME screen is the same as shown in the Calibration Files Information or with a later suffix, reprogramming is not necessary.
- After reprogramming, pending DTC P2610:00 [PCM] will be stored without the Check Engine Light ON. Start the engine and clear the DTC.
- If DTC U2120:00 or/and U2500:82 are stored and i-ACTIVSENSE warning light (amber) turns on after the reprogramming, refer to SA-036/19.
- 3. Clear the DTC, turn the ignition off, and get out of the vehicle.
- 4. Close and lock the door.
- 5. Wait for at least ten minutes.
- 6. Verify the repair by starting the engine and making sure the Check Engine light is OFF and no abnormal warning lights are ON.

NOTE: If any DTC should remain after performing a DTC erase, diagnose the DTC according to the instructions on MGSS.

Page 2 of 6

Bulletin No.: 07-004/22 Last Issued : 10/10/2022

CALIBRATION

For ESU

<u>FOT ESO</u>
File Name
BDGF-66S11-M

For PCM

2019-2021 US / 2019-2021 Canada spec.

Mazda3 (Japan built) with VINS starting with JM1

Engine	Transmission	Drive	File Name	Note	
	ΔТ	OME	PAH9-188K2-L	Mitsubishi	
2.0L	AT	2WD	PAJ1-188K2-M	Denso	
(Canada spec.)	MT	2WD	PAJ2-188K2-K	Mitsubishi	
	IVI I	2000	PAJ3-188K2-L	Denso	
		2WD	PX05-188K2-N	Mitsubishi	
	ΔТ	2000	PX06-188K2-N	Denso	
2.5L w/	cylinder	4WD	PX07-188K2-R	Mitsubishi	
deactivaton		4000	PX08-188K2-R	Denso	
		NAT	MT 2WD	PX58-188K2-M	Mitsubishi
		WII 2WD	PX59-188K2-M	Denso	
	2.5L w/out cylinder deactivation (Canada spec.)	2WD	PXJ7-188K2-F	Mitsubishi	
			PXJ8-188K2-G	Denso	
		4)///D	PX4V-188K2-C	Mitsubishi	
		4WD	PX4W-188K2-C	Denso	
[MT	2WD	PX4X-188K2-C	Mitsubishi	
	IVII	PX5A-188K2-C	Denso		

Page 3 of 6

Bulletin No.: 07-004/22 Last Issued : 10/10/2022

Mazda3 (Mexico built) with VINS starting with 3MZ

Engine	Transmission	Drive	File Name	Note	
A.T.	AT	OME	PAJ8-188K2-G	Mitsubishi	
2.0L	AI	2WD	PAJ9-188K2-H	Denso	
(Canada spec.)	MT	2WD	PAK1-188K2-F	Mitsubishi	
	IVI I	2000	PAK2-188K2-G	Denso	
	2.5L w/ cylinder AT deactivaton	OWD	PX13-188K2-H	Mitsubishi	
		AT -	2000	PX14-188K2-H	Denso
			PX15-188K2-H	Mitsubishi	
		4000	PX16-188K2-H	Denso	
	214/0	2WD	PXK5-188K2-E	Mitsubishi	
2.5L w/out	2000	PXK6-188K2-F	Denso		
(Canada spec.)	cylinder deactivation (Canada spec.) AT 4WD	41MD	PX6R-188K2-C	Mitsubishi	
		4VVD	PX6S-188K2-C	Denso	

CX-30

Engine	Transmission	Drive	File Name	Note
		2WD	PA6W-188K2-F	Mitsubishi
	A.T.		PA6X-188K2-F	Denso
2.0L	AT	AWD	PA7G-188K2-F	Mitsubishi
(Canada spec.)		4WD	PA7H-188K2-F	Denso
Γ	NAT	2MD	PA6T-188K2-F	Mitsubishi
	MT	2WD	PA6V-188K2-F	Denso
	ΑT	2WD	PXH7-188K2-F	Mitsubishi
2.5L w/ cylinder AT deactivaton			PXH8-188K2-F	Denso
	AI	4WD	PXJ9-188K2-F	Mitsubishi
			PXK1-188K2-F	Denso
	٨٠	2WD	PXM1-188K2-F	Mitsubishi
2.5L w/out			PXL4-188K2-F	Denso
cylinder deactivation (Canada spec.)	AT	4WD	PXM2-188K2-F	Mitsubishi
			PXL5-188K2-F	Denso

Page 4 of 6

Last Issued : 10/10/2022

Bulletin No.: 07-004/22

Mexico spec.

Mazda3 (Japan built) with VINS starting with JM1

Engine	Transmission	Drive	File Name	Note
	AT	OME	PAJ4-188K2-K	Mitsubishi
2.0L	Ai	2WD	PAJ5-188K2-L	Denso
2.0L	NAT	31/10	PAJ6-188K2-K	Mitsubishi
	IVI I	MT 2WD	PAJ7-188K2-L	Denso
	AT 2V	2WD	PX09-188K2-K	Mitsubishi
2.5L			2000	PX10-188K2-L
Z.5L	МТ	OWD.	PX11-188K2-K	Mitsubishi
		2WD	PX12-188K2-L	Denso

Mazda3 (Mexico built) with VINS starting with 3MZ

Engine	Transmission	Drive	File Name	Note	
	AT	2WD	PAK3-188K2-G	Mitsubishi	
2.0L	Α1	2000	PAK4-188K2-H	Denso	
2.0L	MT 2WD		OVAID	PAK5-188K2-G	Mitsubishi
		2000	PAK6-188K2-H	Denso	
	ΛТ	AT 2WD	PX17-188K2-G	Mitsubishi	
2.5L	AI		2000	PX18-188K2-H	Denso
2.5L	MT	2WD	PX19-188K2-G	Mitsubishi	
		2000	PX20-188K2-H	Denso	

Page 5 of 6

Bulletin No.: 07-004/22 Last Issued : 10/10/2022

CX-30

Engine	Transmission	Drive	File Name	Note
0.01	ΛТ	2WD	PA7A-188K2-D	Mitsubishi
2.0L	OL AT		PA7B-188K2-D	Denso
AT	2MD	PXH9-188K2-D	Mitsubishi	
2.5L	Ai	2WD	PXJ1-188K2-D	Denso
2.5L	AT 4W	4MD	PXK2-188K2-B	Mitsubishi
		4000	PXK3-188K2-B	Denso

WARRANTY INFORMATION

NOTE:

- · This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- · Additional diagnostic time cannot be claimed for this repair.

Warranty Type	А
Symptom Code	60
Damage Code	9W
Part Number Main Cause	5555-18-881
Quantity	0
Operation Number / Labor Hours:	XXS8NXFX / 0.3 Hrs. (Cause 1) XXW4CXFX / 0.3 Hrs. (Cause 2)

Page 6 of 6