

STAR ONLINE PUBLICATION















Case Number: S2202000010

Release Date: September 2022

Symptom/Vehicle Issue: Service Air Suspension Message In Cluster. C1522-11 Right Front Ride Height Sensor- Circuit Short To Ground.

Discussion: Clarify with the operator of the vehicle when the diagnostic trouble code C1522-11 set. The fault diagnostics suggest the sensor has a short to ground however, it is possible the dtc could set if the vehicle is lifted by jacks or on a hoist during service or repairs such as installing a spare tire. If the vehicle was not hoisted or jacked prior to the code setting, closely inspect the wiring and connections in the RF height sensor circuit for damage, corrosion, and water damage. Perform diagnostic testing in Service Library.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.

Stellantis US LLC Version 4.5 07/22/2022