

Case Number: S2214000002

Release Date: September 2022

**Symptom/Vehicle Issue**: Customer complaint of fuel filler tube loose or rattling at nozzle fill location.

**Repair Procedure**: If the fuel filler tube is found to be loose then inspect the fuel filler bracket area for the attachment bolt.

- If the bolt is loose then tighten the bolt to 8 Nm +/- 0.8 Nm.
- If the bolt is missing (Fig 1), then install the bolt (p/n 06104366AA or its equivalent) and torque the bolt to 8 Nm +/- 0.8 Nm.





This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

## Stellantis US LLC