

Case Number: S2219000004

Release Date: September 2022

Symptom/Vehicle Issue: Service Electric Power Steering Message On Cluster. C0051-54 Steering Wheel Position Sensor Calibration, C0051-64 Steering Angle Set.

Discussion: If Diagnostic Trouble Codes (DTCs) C0051-54 and C0051-64 are both set active at the same time and will not go stored after performing a steering angle calibration routine with wiTECH, alignment of the steering mechanical components should be inspected. Note, this condition may have happened during service work or possibly a minor collision like wheel contact with a curb.

Access but do not remove the steering wheel by removing the air bag assembly. Refer to Service Library 19 - Steering / Column / WHEEL, Steering / Removal and Installation.

- 1. Do the tick marks line up as in Figure 1?
 - Yes >>> Replace the column referencing Service Library 19 Steering / Column / Removal and Installation. Proceed to step2
 - No >>> Replace the steering wheel. Refer to 19 Steering / Column / WHEEL, Steering / Removal and Installation. Proceed to step 2.
- 2. Once the steering column or steering wheel has been replaced, perform a steering alignment, run steering angle calibration routine and confirm that the DTCs have been resolved. If the condition is not resolved, replace the component not replaced in step 1 (steering wheel or column) and perform step 2 again. Replacement of both components is expected to be extremely rare.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.





Figure 1

Figure 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.