Reference	SSM75410
Models	F-PACE / X761
	I-PACE / X590
Title	I-Pace - F-Pace Clicking Noise On Full Left - Right Lock From Front Wheel Area At Low Speed.
Category	Chassis
Last modified	21-Oct-2022 00:00:00
Symptom	303000 Steering/Handling
Attachments	11Front axle hub click noise (Attachment 3).pptx (11Front axle hub click noise (Attachment 3).pptx)
	11Hub click noise wheel off.mp4 (11Hub click noise wheel off.mp4)
	11Road_test_hub noise.mp4 (11Road_test_hub noise.mp4)
Contont	legue:

Content <u>Issue:</u>

Customers may experience a clicking/ticking noise whilst turning left or right and full lock at low speeds. Noise originating from the front wheel area.

Cause:

Brake disc to wheel hub flexing/moving during cornering load allows stick-slip movement of the disc along the wheel hub spigot.

Action:

- Confirm customer complaint from the front wheel area.(Attached media files)
- Remove road wheels.
- Follow TOPIx WSM-28106 (F-Pace) & WSM-32604 (I-Pace) remove and instalation front brake discs.
- Clean hub spigot area. (Attachment 3)
- Apply Molycote grease to hub area (MOLYKOTE® Cu-7439 Plus Paste) or equivalent anti seize compound.
- Care point not to get Molycote grease on the wheel nut hub threads.
- Check wheel nuts have free spinning captive washers if they do not have free spinning washers, replace affected wheel nuts.
- · Refit the road wheels.

anBhdHRlcnM7MiAvMi0xMC0vMVQxMzowODo0MS4vMidaOzEzNi4vMiYuNzluODY7