

Reference	SSM75865
Models	Defender / L663
Title	Raised Air Intake Accessory – Rattling
Category	Accessories
Last modified	17-Oct-2022 00:00:00
Symptom	General Accessories

Content**Issue:**

Customers may report a rattle or vibration from the raised air intake.

Cause:

Vehicles have experienced loads that exceed that of the upper A-pillar plastic bracket, causing the bracket to crack.

Action:

Parts:

- 1x LR180431 Metal A-Pillar Bracket Kit

Do not replace the complete Raised Air Intake assembly

Please carry out the following steps*:

1. Remove the raised air intake cap
2. Remove the upper raised air intake Screw (M6x20) and plastic A-pillar bracket
Ensure that the rivet nut (C) is correctly formed in the A-pillar and is checked to ensure it is secure before moving to the next step, if not please replace it with the rivet nut provided in LR180431
3. Fit the new metal A-pillar bracket and upper raised air intake screw (M6x20), torque: 4Nm
4. Refit the raised air intake cap

*Please refer to the accessory fitting instruction (VPLEP0435) for further guidance, 102-03 Exterior Raised Air Intake.

anBhdHRicnM7MjAyMj0xMC0xOVQxNzo1ODowMy4zNThtaOzEzNi4yMjYyNzluMTAwOw==