

WLD5 Workshop campaign - Replacing hose for positive crankcase ventilation

WLD5 Workshop campaign - Replacing hose for positive crankcase ventilation

ID Number	WLD5
Models	Panamera (971) Cayenne (9YA)
Model Years	2017-2019
VIN List	Attached
Number of affected VINs	11,076
Issue Description	<p>A part-load valve was installed in the hose for crankcase ventilation on the affected vehicles which has a sealing washer that does not meet the required specifications and could possibly crack when the crankcase pressure rises.</p> <p>Consequently, small amounts of engine oil can leak from the oil filler cover into the adjacent engine compartment, resulting in a reduced engine oil level over time.</p> <p>The driver is alerted by an appropriate warning message if the engine oil level is too low.</p> <p>To prevent this from happening, the hose for the crankcase ventilation will be replaced on the affected vehicles.</p>
What Dealers should do	<p>Please arrange for this measure to be carried out as soon as possible on affected vehicles.</p> <p>As of the time of this posting, the repair is immediately available.</p> <p>Parts can be ordered via PPL as normal.</p>
California Dealers only	<p>The Department of Motor Vehicles (DMV) in California may require that the customer furnish proof of completion of this Campaign in the form of a copy of the</p>

dealer's repair order, including a signed "Proof of Correction" certificate, before the next renewal of the vehicle registration. Your dealer must supply this documentation to the customer only after the campaign has been completed. Please instruct the customer to retain the signed "Proof of Correction Certificate" within their vehicle records.

Customer Notification

Will be posted at a later date

TI Number

[No. 72-20](#)

Parts required

Scope 1: 3.0-litre V6 monoturbo (971)

Part No.	Designation	Quantity/vehicle	Parts return*
V04015001K	Vent line with intake pipe	1 ea.	No

Scope 2: 2.9-litre V6 biturbo (971)

Part No.	Designation	Quantity/vehicle	Parts return*
V04015001L	Vent line with intake pipe	1 unit	No

Scope 3: 3.0-litre V6 monoturbo (9YA)

Part No.	Designation	Quantity/vehicle	Parts return*
V04015001M	Vent line with intake pipe	1 unit	No

Scope 4: 2.9-litre V6 biturbo (9YA)

Part No.	Designation	Quantity/vehicle	Parts return*
V04015001N	Vent line with intake pipe	1 unit	No

* The parts must be stored until such a time as the related warranty or campaign claim has been credited. If a barcode is generated with the credit note, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the genuine remanufactured parts process or be scrapped.

Warranty processing

Scope 1: 3.0-litre V6 monoturbo (971)

Damage Code

WLD5 66 000

Repair Code

2

Working time

187 TU

WLD5 Workshop campaign - Replacing hose for positive crankcase ventilation

Scope 2: 2.9-litre V6 biturbo (971)

Damage Code	WLD5 66 000
Repair Code	2
Working time	73 TU

Scope 3: 3.0-litre V6 monoturbo (9YA)

Damage Code	WLD5 66 000
Repair Code	2
Working time	113 TU

Scope 4: 2.9-litre V6 biturbo (9YA)

Damage Code	WLD5 6 6 000
Repair Code	2
Working time	118 TU

Please enter the campaign that was carried out in the Warranty and Maintenance booklet for the vehicle.

Porsche Mobility

If requested, the mobility of the affected customer can be guaranteed by offering a suitable replacement vehicle.

Please invoice this additional service with the campaign scope via WWS.