



Thor Motor Coach Technical Service Bulletin

TSB #	TSB 22-13		
Description/Title:	2022 Omni & Magnitude with Firefly software(v7.25 or later)		
Affected Product Line(s):	Certain model year 2022 Omni & Magnitude		
Service Campaign # :	RC000283	Released Date:	11/8/2022
Codes:	Inspect with Repair: TMCTS80279W	Document Date:	11/7/2022
Time Allowed:	Inspect with Repair: .1	Document Revision:	

Issue:

I/C controls may appear on the touchscreen's electrical page—they will not control anything.

Tools Required:

- N/A

Part(s) Required:

N/A

Instructions:

See attached repair instructions below.

To remove the controls:

1. Press and hold the floorplan button.
2. Go to floorplan settings/options page
3. Select "Sapphire" in the bottom row of buttons (Fig 1, circled in red)
4. On this page, you will see "Inverter Brand" selection which lists both a "MAGNUM" and "XANTREX" selection (Fig 2, circled in red).
 - a. If either button is blue (indicating selected), that is the cause of I/C controls appearing on the screen.
5. Both of those buttons must be deselected, just like the Red circled area in Fig 2 shows below.



Thor Motor Coach Technical Service Bulletin

FIG 1

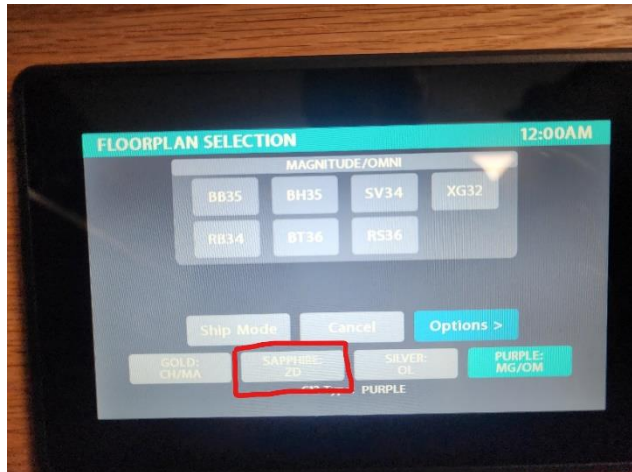


FIG 2

