



Technical Service Bulletin

45 DTC B2F0100, U012700, U112200, and/or U112300 is stored in the ABS control module

45 22 28 2064758/3 November 2, 2022. Supersedes Technical Service Bulletin Group 45 number 22-25 dated May 20, 2022, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
e-tron GT, and RS e-tron GT	2022 – 2024	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised <i>header</i> (Added Model Year) Revised <i>Condition</i> (Symptom Code modified)
2	05/20/2022	Revised <i>header</i> (Added Model Year)
1	10/11/2021	Initial publication

Customer states:

- No customer concerns, it is found during PDI or any other diagnostic work.

Workshop findings:

- The ABS/ESC warning lamp may flash in the instrument cluster when the diagnostic tester is connected.

During PDI inspection the following DTCs might be found in the ABS control module, J104 (address word 0003):



Technical Service Bulletin

- DTC **B2F0100** (Development code 1) with symptom codes: 358656 (static) and 339457 (intermittent).

And/Or

- DTC **U012700** (Tire Pressure Monitoring Control Module - no Communication) with symptom code 358656 (static).

In addition to one or more of the above DTCs, the below DTCs may also appear:

- DTC **U112200** (Data bus implausible message) may be logged with symptom code 303616 (static).

And/Or

- DTC **U112300** (Data bus error value received) may be logged with symptom code 169984 (intermittent) and with symptom code 303360 (static).



Note:

The static DTCs cannot be erased.

The intermittent DTCs can be erased but will be logged again as soon as the conditions for them occur.

Technical Background

The DTCs above are logged for design reasons (control module communication) but do not cause any issues for the customer. The function of the ABS/ESC is not altered or restricted by these DTCs.

Production Solution

Not applicable.

Service



Technical Service Bulletin

Erase all intermittent DTCs in the ABS control module, J104 (address word 0003), and release the vehicle.

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4530		
Damage Code:	0040		
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2064758/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information



Technical Service Bulletin

All part and service references provided in this TSB (2064758) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2022 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.