



Bulletin No.: PIP5884
Published date: 10/7/2022

Preliminary Information

PIP5884 Diagnostic Tip: Low Oil Pressure or DTC's P0521 or/and P06DE Set

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Camaro	2022	All	All	3.6 LGX	All

Involved Region or Country	North America
Condition	You may have a Camaro with a LGX V6 engine that comes in with low oil pressure or a check engine light on with DTC's P0521 and/or P06DE set.
Cause	If the vehicle actually has low oil pressure, we have seen the seal between the oil pan and oil pump break or split allowing oil to leak back into the pan and not hold pressure.

Correction:
If you find this condition, replace the oil pan and seal and reevaluate the vehicle.

Parts Information

Description	Part Number	QTY.
Oil Pan	12716562	1

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4065870	Oil Pan Replacement	Use Published Labor Time

Version History

Version	1
Modified	10/06/2022 - Created on.



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.