



# Preliminary Information

PIP5880 2019 2020 6L50 MYB Automatic Transmission diagnostic  
Tip: Slips In Reverse.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2019 - 2020	All	All	LCV, LWN	MYB
GMC	Canyon	2019 - 2020	All	All	LCV, LWN	MYB

Involved Region or Country	North America & NA Exports
Condition	Some customers may comment of no reverse or slips in reverse.
Cause	Torn or cut lip seal on the low and revere clutch piston.

Correction:

If normal diagnostics does not lead to the root cause of this concern, remove and disassemble the transmission to inspect the low and reverse clutch piston seal for being torn or cut.

If the low reverse clutch seal is torn or cut, replace the low and reverse clutch piston, and the center support.

Version History

Version	1
Modified	10/14/2022 - Created on.

