



# Preliminary Information

## PIT5843A Gauges Drop Out, Warning Lights, Passive Entry Inoperative, Multiple Communication Codes

### Models

| Brand:    | Model: | Model Years: | VIN: |     | Engine: | Transmissions: |
|-----------|--------|--------------|------|-----|---------|----------------|
|           |        |              | from | to  |         |                |
| Chevrolet | Blazer | 2020 - 2021  | All  | All | All     | All            |

|                            |  |
|----------------------------|--|
| Involved Region or Country | North America  |
| Condition                  | A vehicle may be encountered with various complaints. These may include, multiple IPC indicators illuminated, gauges dropping out, IPC display dropping out, door locks cycling, headlamps inoperative, passive entry inoperative, side blind zone inoperative and possibly other concerns. Codes B280D, B3978, B3979, B3980, B3981, C0293, C0800, P057C, P0650, P2122, P2127, P2128, U023A, U026A, U0078, U0100, U0101, U0121, U0131, U0140, U0146, U0151, U0159, U0168, U0186 may be found or there may be others. |
| Cause                      | Terminals at G401 loose or not attached or terminal at G405 loose.   |

### Correction:

Inspect G401 which is located on the right side of the rear compartment. Note that G401 is located slightly below and forward of G405. Ensure that there are two wires attached to G401 and that the nut is properly installed. Inspect G405 to ensure that it is properly tightened.

### Version History

|           |   |
|-----------|---|
| Version 2 | 2   |
| Modified  | 05/17/2021 Created on.<br>10/19/2022 Added information to inspect G405 and update conditions. |



GENERAL MOTORS