

Bulletin No.: PIC6053B Published date: 10/20/2022

Preliminary Information

PIC6053B Diagnostic Tip - Base Radio Inoperative After Using Siri

Proactive

Models

| Brand: | Model: | Model Years: | VIN: | | Engine | Transmissions: |
|-----------|--------------------|--------------|------|-----|---------|----------------|
| | | | from | to | Engine: | Transmissions. |
| Cadillac | ATS | 2015 | All | All | All | All |
| Chevrolet | Impala | 2015 | All | All | All | All |
| Chevrolet | Colorado | 2015 | All | All | All | All |
| Chevrolet | Silverado 1500 | 2015 | All | All | All | All |
| Chevrolet | Silverado HD (AVF) | 2015 | All | All | All | All |
| Chevrolet | Suburban (AVF) | 2015 | All | All | All | All |
| Chevrolet | Tahoe (AVF) | 2015 | All | All | All | All |
| GMC | Canyon (AVF) | 2015 | All | All | All | All |
| GMC | Sierra (AVF) | 2015 | All | All | All | All |
| GMC | Yukon (AVF) | 2015 | All | All | All | All |

Supersession Statement

This PI was superseded to update Recommendation/Instructions. Please discard PIC6053A.

Equipped with Base Radio RPOs RAO or IO3

* Only Utilities and HD pickup trucks equipped with RPO AVF

Condition / Concern

A customer may state that the radio will lose audio (except chimes) and become inoperative after using Siri.

An ignition cycle may restore radio operation.

Recommendations / Instructions

The use of SIRI is not supported by this radio configuration.

The concern may be corrected by an ignition cycle.

If the radio is still in a locked state after performing the recommended ignition cycle, please attempt a 5 minute power-cycle of the radio.

If normal operation resumes, release the vehicle to the customer.

If the radio is still in a locked state, the radio will need to be replaced.

Once repaired, advise the customer to avoid using this feature to prevent reoccurrence since it is not supported.

















GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.