

Campaign 547

FROM: Maserati TSO

TO: Maserati Network



MASTERS OF CARE

Service Campaign 547 Grecale Half-Shafts Check



DATE: OCTOBER 10 2022

Certain Maserati Grecale MY23 listed in ModisCS+ are involved in a Service Campaign relating to the verification of conformity of the front axles.

This intervention is necessary to verify that the cap of the front half shafts has no signs of damage due to an incorrect assembly in production.

We remind you that all Service campaigns must be carried out at the first entry of the vehicle into the workshop, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Furthermore, for cars in Stock Dealer / PDI, it is necessary to perform all the campaign operations before delivery to the End Customer, as prescribed by the White Book and explicitly reported in the Pre-delivery checklist

Please read and review this bulletin first before starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (MaseratiTechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

Sections:

3.22.003.0 LH COMPLETE FRONT AXLE SHAFT (MHEV)

3.22.003.1 LH COMPLETE FRONT AXLE SHAFT (V6)

1. Always check in ModisCS+ to see if the vehicle is involved in this campaign and if the The campaign has not been previously performed.
2. Inspect the junction of the front drive shaft with the differential, using a lifting bridge (Vehicle Lift). With the gearbox in the N position, turn the left front wheel to inspect the drive shaft throughout its circumference.



NOT OK

*Example of damaged drive shaft boot
Always check the entire circumference*



NOT OK

3. If the drive shaft is damaged (**NOT OK**), proceed with the replacement of the component according to the procedure reported in the workshop manual.
4. Although no damage is expected on the right-side half-axis, proceed to check that side as well.
5. The operation can be considered complete.

Spare parts

Only if the inspection results are **NOT OK**, the non-compliant drive shaft must be replaced.

Please order the following PN:

Spare parts for MHEV engine	PN	QTY
LH AXLE SHAFT ASSEMBLY	675001727	1
NUT	675000138	1
SCREW	675001934	4

Spare parts for V6 engine	PN	QTY
LH AXLE SHAFT ASSEMBLY	675001724	1
NUT	675000138	1
SCREW	675001909	4

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	547
Warranty Code	23
Fault Code	063
Component Code	3.22.003
Operation Code	
Check	3.22.003.A (0,10 h)
Check + Replacement (MHEV)	3.22.003.0 (1,15 h)
Check + Replace (V6)	3.22.003.1 (1.65 h)