


MAS003311 MSC 22-40

Campaign 549

FROM: Maserati TSO

TO: Maserati Network

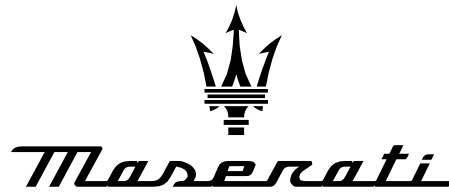

PERSONAL SERVICE LAB

MASTERS OF CARE

Service Campaign 549 Levante V8 Engine Harness Position Check



DATE: OCTOBER 26 2022

Certain Maserati Levante (M161), MY22-23 equipped with V8 engines listed in MODISCS+ are involved in a Service Campaign concerning the verification of conformity of the layout of the Engine Harness inside the engine compartment.

This intervention is necessary to verify that the Engine Harness is correctly routed inside the engine compartment and does not have an incorrect position due to incorrect assembly on the production line.

We remind you that all Service Campaigns must be carried out at the first entry of the vehicle into the workshop regardless of the mandatory setting set in Modis as required by Maserati policies.

Furthermore, for cars in Stock Dealer/POI, it is necessary to perform all the campaign operations before Delivery to the end customer as prescribed by the White Book and as reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.
Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Operating Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check in ModisCS+ to see if the vehicle is involved in this campaign and if the The campaign has not been previously performed.
2. Inside the engine compartment, inspect the engine harness and verify that the cable passed correctly in front of the protection plate and that the protective sleeve on the harness does not have abrasions.



Example of correct routing **IN FRONT** of the plate



Example of incorrect routing **BEHIND** the plate


3. If the inspection results in:
Check **OK** → the inspection is completed, and no further action is required.
Check **KO** → continue with the **rework** procedure indicated in the next step. (**Step 4**)

REWORK


4. During the rework, check the integrity of the harness.
 - If the harness does not present any type of damage proceed to **Step 5**.
 - If there is a sign of abrasion or damage to the sheath, Open a BOL for "SUPPORT REQUEST" attach pictures, and await further instructions




5. Unscrew the screws (1) and release the indicated clips.

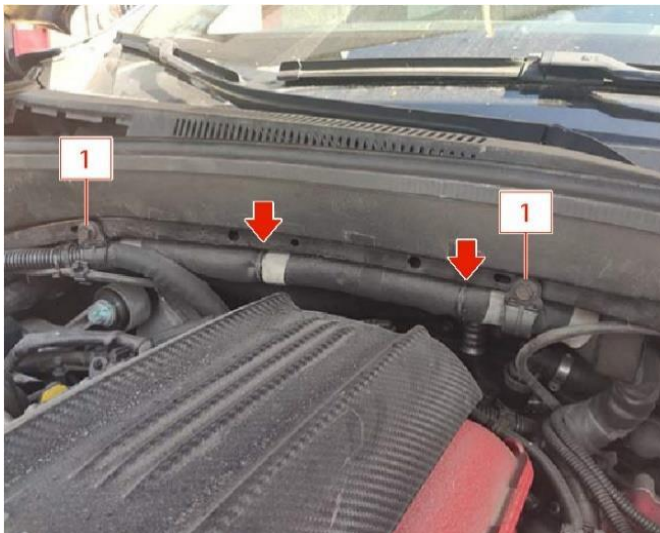

6. Move the cable (1) in front of the bracket (2) as shown in the figure.

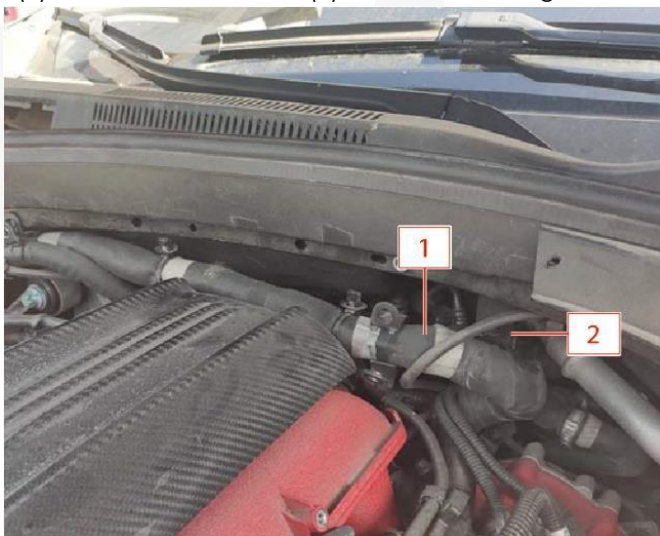

7. Mount the indicated clips and tighten the screws (1).

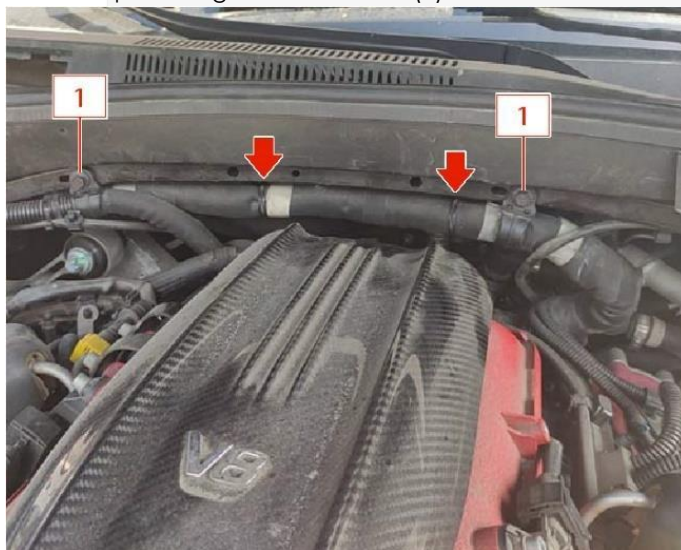

8. Reassemble all removed parts by following the removal procedure in reverse order.
9. The operation can be considered concluded.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Campaign Number	549
Warranty Code	23
Fault Code	063
Component Code	1.90.013
Operation Code Check Check + Rework	1.90.013.A (0.05 h) 1.90.013.B (0.20 h)