

SSM 51184

2020-2022 Escape/Corsair, 2021-2022 Bronco Sport - Hiss Or Rattle Noise While Driving - Manual Park Release Cable

Some 2020-2022 Escape/Corsair vehicles built on or before 17-May-2022 and 2021-2022 Bronco Sport vehicles built on or before 25-Feb-2022 may exhibit a hiss or rattle noise while driving. This may be due to an internal issue with the manual park release cable. If the noise is eliminated when the cable is disconnected from the transmission, install a new manual park release cable assembly LX6Z-7D246-T. Refer to the Workshop Manual (WSM), Section 307-05 > Automatic Transmission External Controls > Removal and Installation.