

SSM 51215

2020-2023 Lincoln Aviator, 2020-2022 Lincoln Corsair - Courtesy Lamps And/Or Ambient Lighting Inoperative - Service Tip

Some 2020-2023 Lincoln Aviator and 2020-2022 Lincoln Corsair vehicles may exhibit courtesy lamps not illuminating with a door open or always on. Also, ambient lighting may be inoperative or always on. If this concern occurs, check the center console cup holder area for evidence of liquid intrusion first. Liquid can short the local interconnect network (LIN) circuit. Temporarily disconnect the console inline connector(s) during diagnosis to isolate circuit shorts. Search Wiring Diagram (WD) for *cup holder ambient* to display the related connectors. If a short is found in cup holder ambient light ring light emitting diode (LED) connector, repair as necessary. If no evidence of liquid intrusion is found, continue with normal Workshop Manual (WSM) diagnostics.