

BODY & CHASSIS

Deployable Side Steps Inoperative	20– 23MY Defender
<p>Customer Voice:</p> <ul style="list-style-type: none">– A customer may complain that the deployable side steps are not operating to either deploy or stow. <p>Technical Description:</p> <ul style="list-style-type: none">– A check for DTC's finds either C1008-3A - Left Power Running Board Position/Motion Sensor and or C1009-3A - Right Power Running Board Position/Motion Sensor stored module. This may be a software concern. <p>Status:</p> <ul style="list-style-type: none">– Revised software has been created to address this concern.– SSM 75881 has been published to provide diagnostic guidance for this concern.	