



Service Bulletin


Bulletin No.: 21-NA-180

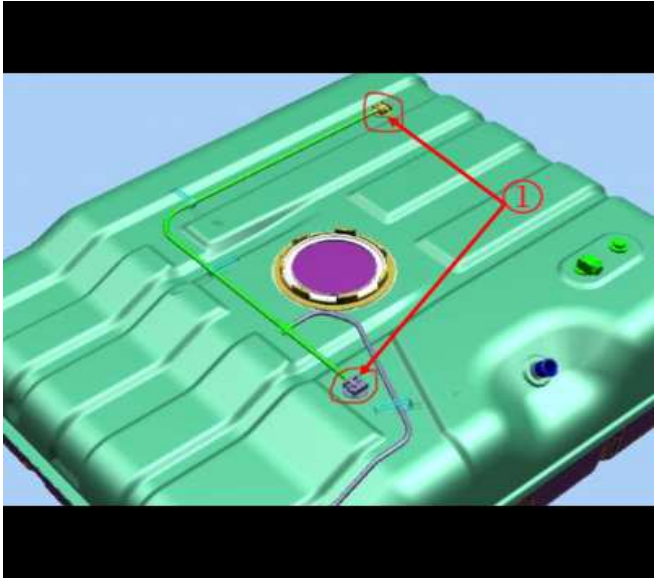
Date: November, 2022

INFORMATION

Subject: Information on Illuminated Check Engine Light, Possible Water in the Fuel, Evaporative Codes Set, Fuel Tank Evaporative Vent Valve Leak, Possible DTC's P0455 or P0442 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Express	2021	2022			All	All
GMC	Savana						

Involved Region or Country	United States and Canada
Additional Options (RPOs)	Equipped with FUEL TANK-216L, 57 GAL (NE7)
Condition	Some customers may comment on an illuminated check engine light. Technician may find possible water in the fuel, with evaporative codes set, as well as possible DTCs P0455 or P0442 set current or in recent history.
Cause	 <p style="text-align: right; font-size: small;">5890237</p> <p>The cause of the condition may be possible fuel tank evaporative vents not sealed properly to the fuel tank.</p>

<p>Correction</p>	<div style="text-align: right; margin-bottom: 10px;">  </div> <p style="text-align: right; font-size: small;">5890239</p> <p>Note: The fuel tank evaporative vents (1) are installed as part of the fuel tank assembly. Do not attempt to re-seat the vents.</p> <p>DO NOT try to remove and reinstall the fuel tank evaporative vents. The proper repair requires the fuel tank to be replaced. Refer to the appropriate <i>Fuel Tank Replacement</i>, in SI,</p>
--------------------------	---

Parts Information

Use the VIN and refer to the GM Electronic Parts Catalog (EPC) to determine the proper part to order.

Warranty Information

For vehicles repaired under warranty, submit the appropriate labor operation for the repair performed.

Version	3
Modified	Released August 12, 2021 Revised October 15, 2021 – Adding DTCs to Condition Section. Revised November 23, 2022 – Added 2022 Model Year, removed breakpoint date and middle east.

