

<b>Reference</b>	SSM75901
<b>Models</b>	Discovery Sport / L550 New Range Rover Evoque / L551
<b>Title</b>	Non Start – 21-23MY - EPICB NO response and BECM DTC P0DA9-62
<b>Category</b>	Driveability
<b>Last modified</b>	25-Nov-2022 00:00:00
<b>Symptom</b>	603300 No Start
<b>Content</b>	<p><b><u>Issue:</u></b> Jaguar Land Rover is investigating customers reporting a non-start situation. Diagnosis concludes no communication to the EPICB (Electric Power Inverter Converter Control Module 'B') and P0DA9-62 Hybrid/EV Battery Voltage/Drive Motor "B" Inverter Voltage Correlation - Signal compare failure logged in the BECM (Battery Energy Control Module)</p> <p><b><u>Cause:</u></b> EPICB Software calibration</p> <p><b><u>Action:</u></b> Please complete the following steps:</p> <ol style="list-style-type: none"> <li>1. Complete 12v battery <b>disconnect</b> process following TOPIx process 414-00 - BATTERY AND CHARGING SYSTEM - GENERAL INFORMATION - 12V SYSTEM DISCONNECT/RECONNECT</li> <li>2. Press ignition button on to shutdown DCDC (negative connector still disconnected)</li> <li>3. Complete 12v battery <b>connect</b> process following TOPIx process 414-00 - BATTERY AND CHARGING SYSTEM - GENERAL INFORMATION - 12V SYSTEM DISCONNECT/RECONNECT</li> <li>4. Press unlock on the key remote, open and close the drivers door and press lock on the remote and wait for the vehicle to sleep</li> <li>5. Press unlock on the key remote and open the driver's door</li> <li>6. Connect the JAGUAR LAND ROVER approved battery support unit.</li> <li>7. Please ensure the latest version of the Diagnosis Device Agent is installed</li> <li>8. Launch Diagnosis Device Agent (DDA) and log in</li> <li>9. Select 'Browse all' in 'OPTION SELECTION'</li> <li>10. Within the Diagnostics tab, select "EPICB" in the "Vehicle Data Modules" section</li> <li>11. Within the "Applications and Troubleshooting" section select the "Module Programming" tab</li> <li>12. Select EPICB - Software - Update Module'</li> <li>13. Select 'Run'</li> <li>14. Follow all on-screen instructions and complete the routine</li> <li>15. Disconnect the JAGUAR LAND ROVER approved diagnostic equipment and the JAGUAR LAND ROVER approved battery support unit.</li> </ol>

Thank you in advance for your assistance with this matter

anBhdHRlcnM7MjAyMj0xMj0wNDoyODozOC45MzhaOzEzNjYyYU50NTU1MT11Ow==