

Bulletin No.: PIC6289C Published date: 11/29/2022

# Preliminary Information


## PIC6289C Noise from Exhaust Valves

## <u>Models</u>

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to	Eligilie.	Transmissions.
Chevrolet	Camaro	2016 - 2023	All	All	LGX, LT1, LT4	All

Involved Region		United States, Canada, Mexico, United Kingdom, Sweden							
Condition	exha Upor	Some customers may comment on a Check Engine Light (CEL) or an exhaust noise.  Upon further inspection, dealership technicians may find a P12FD or a P12F0 set.							
Cause	but t This	This concern may be caused by an exhaust actuator that was installed but the learn procedure was not completed.  This concern will occur on new vehicles with low mileage, or on vehicles that recently had service work done to the exhaust system.							
	valve Some pure They cont Phot		uipped w nature. ated and of valve o	they an b	Passive Extract ale	naust Va	lives (PEVs) that are		



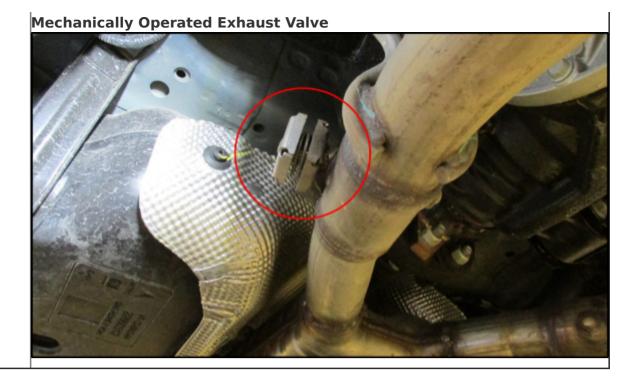

#### **Correction:**

Dealership technicians are to relearn the Cylinder Deactivation Valves using GDS2 to resolve

These valves are also referred to as the Active Fuel Management (AFM) valves.

They are located before, or in front of, the muffler.

Do not replace any parts for this concern.

Note: If the vehicle's battery becomes discharged or if it is disconnected for any reason, the Cylinder Deactivation Valves and/or Flow Control Valve relearn procedure may also need to be performed. If not, the exhaust valves may hunt or search for position and continue to make an audible noise.

### <u>Version History</u>

Version	4	
Modified	06/26/2017 - Created	
	02/08/2019 - Updated Model Years and Engine RPOs	
	06/15/2021 - Updated Model Years and added graphics	
	11/29/2022 - Updated to add model years.	

















GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.