



STAR ONLINE PUBLICATION



Case Number: S2208000177

Release Date: October 2022

Symptom/Vehicle Issue: Speed Control Operates Intermittently

Owner Complaint/Technician Observation: Owner complains that Cruise/Speed control operation is intermittent. Technician observed the Steering Column Control Module (SCCM) set Diagnostic Trouble Code (DTC) **P0579-00-Speed Control Switch 1 Performance** as stored or active.

Discussion: Disconnect the SCCM steering wheel harness connection at the SCCM (see image below). Examine the connector D3816F for any loose or broken terminals, repair as needed. Apply dielectric grease to male terminals of SCCM and circuits at the speed control switch, reconnect and test switch voltage values as needed per the diagnostic test for P0579-00 within Service Library to confirm proper operation Fig 1 and 2.

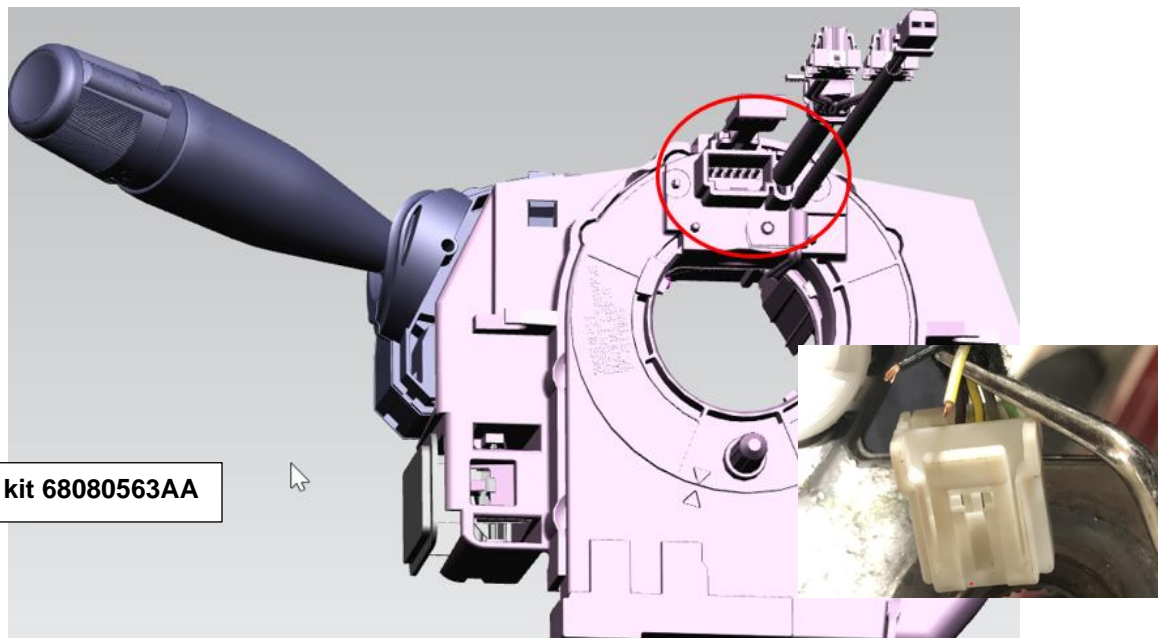


Fig 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.


Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.



STAR ONLINE PUBLICATION



15-way black connector

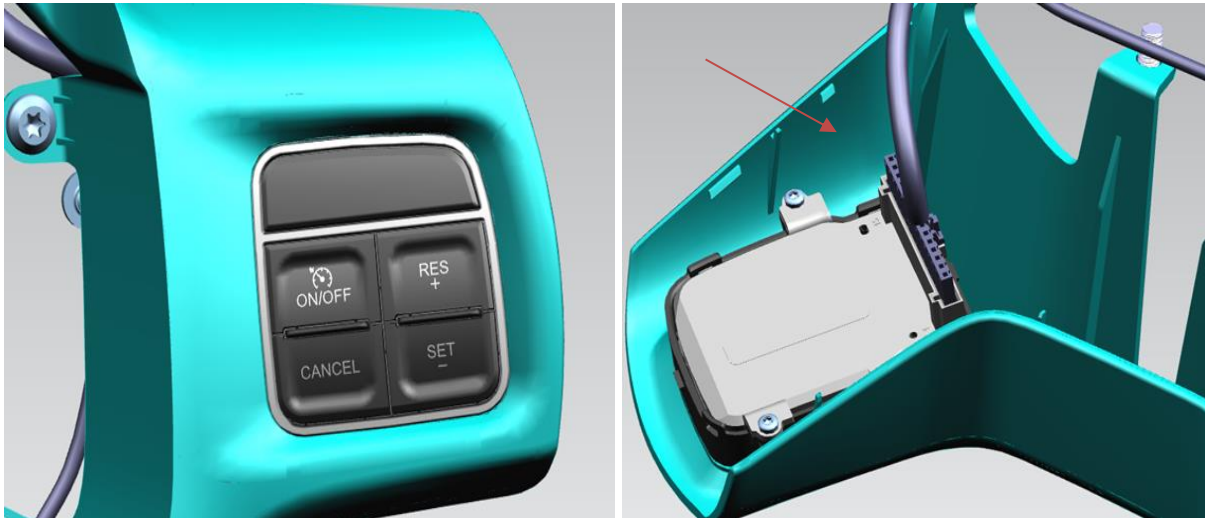

13	V38	YE/BK	0.35	S/C SIGNAL 2
14	V937	GY	0.35	S/C SWITCH GROUND
15	V37	GN	0.35	S/C SIGNAL 1

Fig 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.