

# Technical Journal

TITLE:

**Unintentional VIDA Wi-Fi Connection Leading to 12V Battery Drain**

<b>REF NO:</b> TJ 36426.1.1	<b>ISSUING DEPARTMENT:</b> Technical Service	<b>CAR MARKET:</b> United States and Canada	
<b>PARTNER:</b> 3 US 7510 Volvo Car USA		<b>ISSUE DATE:</b> 2022-11-14	<b>STATUS DATE:</b> 2022-11-21
<b>FUNC GROUP:</b> 3111	<b>FUNC DESC:</b> Battery, complete	<b>Page 1 of 53</b>	

**“Right first time in Time”**

## Attachment

File Name	File Size
Service Journal 1000046.pdf	1.8612 MB
Service Journal 32310.pdf	0.0762 MB
Stethoscope.jpg	0.0703 MB
VOE Adapter Plugged-In.png	0.7915 MB

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

## DESCRIPTION:

TCAM = Telematics Connectivity Antenna Module

Vehicles equipped with a TCAM can unintentionally populate in VIDA through Wi-Fi connection. When this happens, the 12V battery can drain.

This unintentional connection to VIDA Wi-Fi is currently under investigation and will be corrected in an upcoming SW release.

This TJ will be updated when additional information becomes available.

Please follow the steps under Service.

# Technical Journal 36426.1.1

## CSC Customer Symptom Codes

Code	Description
LM	12 V main battery/Dead battery
LN	12 V main battery/Weak or low electrical power

## DTC Diagnostic Trouble Codes

### Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
224							2023-9999		-	202222-999952
225							2023-9999		-	202222-999952
227							2023-9999		-	202222-999952
235							2022-9999		-	202122-999952
236							2022-9999		-	202122-999952
238							2022-9999		-	202122-999952
246							2022-9999		-	202122-999952
256							2023-9999		-	202222-999952
536							2021-9999		-	202037-999952
539							2022-9999		-	202139-999952

### SERVICE:

CCD = Center Console Display

In order to avoid unintentional connections to VIDA Wi-Fi, please note the following:

1. Leave the vehicle in Transport mode as long as possible (until the vehicle is ready for delivery)

### **THIS IS THE MOST EFFECTIVE WAY TO PREVENT UNINTENTIONAL VIDA WI-FI CONNECTIONS AND 12V BATTERY DRAIN**

If you must take the vehicle out of Transport mode (therefore placing it into Normal mode), please note the following:

1. The vehicle will attempt to connect to VIDA Wi-Fi whenever the LOCK button on the key fob is pressed 3 or more times repeatedly.
  - a. To prevent unintended activation of VIDA Wi-Fi (and therefore unintended 12V battery drain), do NOT press the LOCK button 3 times consecutively (as is often done when retailer personnel are trying to locate a vehicle)
2. A stethoscope icon will appear in the top-right corner of the CCD (see attached “Stethoscope.png”) when the vehicle is attempting to connect (or has already successfully connected) to VIDA Wi-Fi

## Technical Journal 36426.1.1

3. In order to disconnect VIDA Wi-Fi, you have 3 options:
  - a. Plug a VOE adapter (PN 9513108 OR PN 9513062 from Service Journal 32310) into the OBD-II port for 5 seconds—**no computer connection is necessary**
    - i. Reference attached picture “VOE Adapter Plugged-In.png”
  - b. Connect the vehicle to VIDA (manually or through VIDA Wi-Fi) and then Disconnect from VIDA (according to Service Journal 1000046)
  - c. Drive the vehicle out of range of the Wi-Fi access point


**Note: This is valuable information for everyone in the retailer (especially the sales team)—please share this information!**

### **VEHICLE REPORT:**

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area “Vehicle Report” and sub concern area “Support not needed”, use function group 3111.

**To view TJ attachments continue to next page. This TJ has four attachments.**

# Technical Journal 36426.1.1

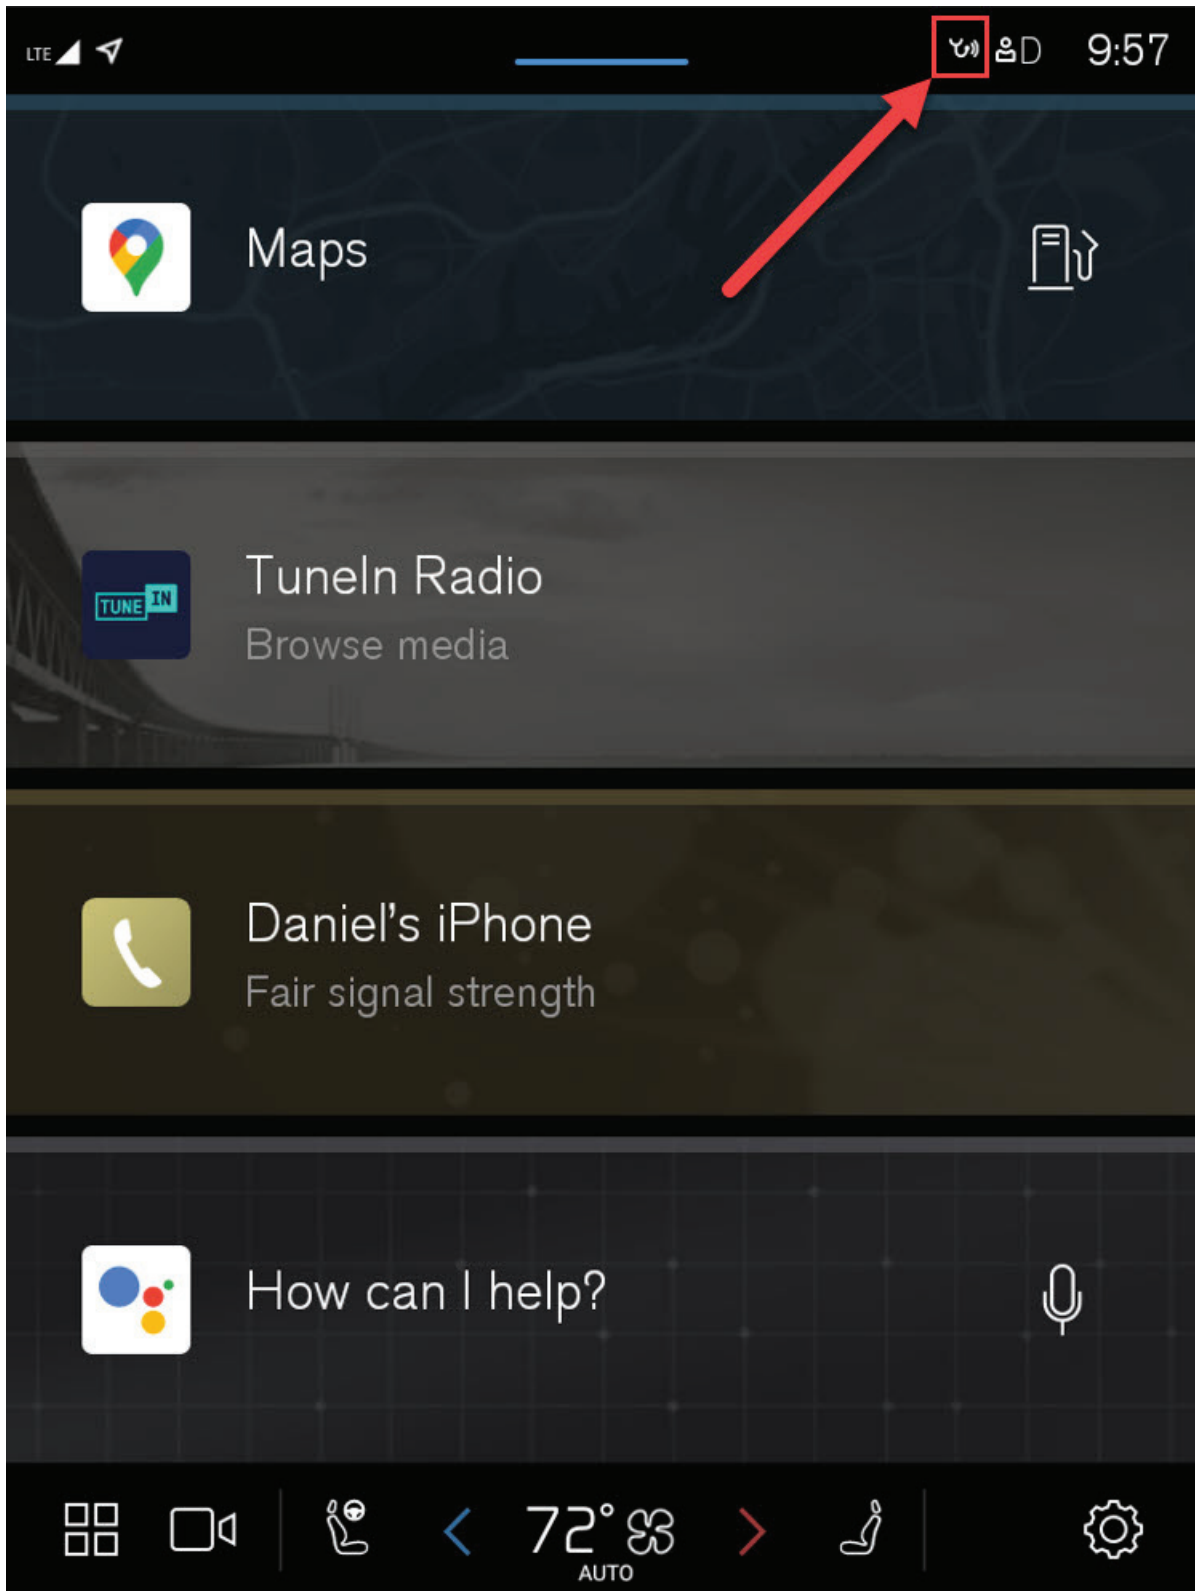

Service Journal 32310 - Version 1

## 9513108 VOE Adapter


Tools & Equipment - Diagnostic Tools

VOE Adapter updated.

9513108 VOE Adapter replace 9513062 VOE Adapter.  
Adapter for onboard diagnostic (OBD).

Use 9513108 for software download.

9513062 can still be used for other work/readouts on cars.

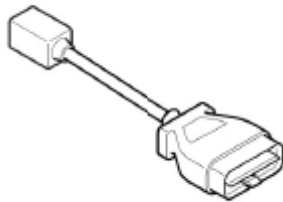

Ulf Ljungberg - Jan 23, 2017 06:50

Volvo Car Corporation





**CONTENTS**

<b>1</b>	<b>TARGET GROUPS FOR THIS DOCUMENT .....</b>	<b>3</b>
<b>2</b>	<b>PURPOSE OF THIS DOCUMENT .....</b>	<b>3</b>
<b>3</b>	<b>THE VOLVO CARS GLOBAL WI-FI SERVICE.....</b>	<b>4</b>
3.1	Overview.....	4
3.2	TIE Service Journals for Volvo Cars Global Wi-Fi Service .....	5
3.3	Requirements and Standards .....	7
<b>4</b>	<b>HOW TO ESCALATE MAJOR ISSUES.....</b>	<b>8</b>
<b>5</b>	<b>HOW TO CONNECT.....</b>	<b>9</b>
<b>6</b>	<b>VIDA.....</b>	<b>10</b>
6.1	Wi-Fi connected vehicles .....	10
6.2	How to disconnect.....	11
6.3	How to filter.....	11
<b>7</b>	<b>VIDA ADMIN.....</b>	<b>12</b>
7.1	What are the functionalities in VIDA Admin?.....	12
<b>8</b>	<b>ACCESS POINTS.....</b>	<b>13</b>
8.1	Prerequisites .....	13
8.2	How to fault trace and determine if an AP is broken or not. ....	14
8.3	How to request a replacement of a broken AP. ....	16
8.4	Return instruction for a none functional Access point. ....	17
<b>9</b>	<b>MERAKI DASHBOARD.....</b>	<b>18</b>
<b>10</b>	<b>FAULT TRACING – VEHICLE(S) DOES NOT APPEAR IN VIDA.....</b>	<b>22</b>
10.1	Vehicle(s) does not appear in VIDA after locking the vehicle 3 times.....	22
<b>11</b>	<b>FAULT TRACING CHART - VEHICLE(S) DOES NOT APPEAR IN VIDA AFTER LOCKING THE VEHICLE 3 TIMES. ....</b>	<b>31</b>
<b>12</b>	<b>FAULT TRACING - ERROR SHOWN WHEN TRYING TO CONNECT TO THE VEHICLE. ....</b>	<b>32</b>
12.1	Vehicle appears in VIDA, but an error message is shown when trying to connect to the vehicle. ....	32
<b>13</b>	<b>FAULT TRACING CHART - ERROR SHOWN WHEN TRYING TO CONNECT TO THE VEHICLE. ....</b>	<b>34</b>
<b>14</b>	<b>POOR PERFORMANCE – VEHICLE CONNECTION AND INSTALLATION OF SW ...</b>	<b>35</b>
14.1	A bad Radio Frequency (RF) environment can result in connection issues and high SWDL Failure rate. 35	
<b>15</b>	<b>EXAMPLES OF KNOWN ISSUES AND HOW TO RESOLVE THEM. ....</b>	<b>40</b>
15.1	Vehicles does not appear in VIDA for some internal VCC users having Windows 10. 40	
15.2	LED on access point is blinking orange and status also shown as grey in Meraki Dashboard. ....	41
<b>16</b>	<b>CHANGE LOG .....</b>	<b>45</b>
	Changelog .....	45

**SUPPORT DOCUMENT FOR HELPDESKS**



## 1 **TARGET GROUPS FOR THIS DOCUMENT**

---

Support organizations that are involved in supporting dealers using Volvo Cars Global Wi-Service, both during and after the implementation of the service.

## 2 **PURPOSE OF THIS DOCUMENT**

---

The purpose of this document is to, on the one hand, give the helpdesks an insight about new functionalities in VIDA & VIDA Admin and Workshop Wi-Fi functionality is added to the systems and, on the other hand, to guide through the Fault Tracing of eventual Symptom.

**Do not print** this document since it might be updated regularly and the document also contains links to other sections within the document.

## 3 THE VOLVO CARS GLOBAL WI-FI SERVICE

---

### 3.1 Overview

Volvo Cars, as an industry leader in car connectivity, has developed a Wi-Fi service designed to match with its connected car infrastructure and requirements for Wi-Fi connectivity.

This Wi-Fi service contains two different Wi-Fi connections:

- **Volvo Cars Diagnostic Wi-Fi (mandatory) SSID = VCCarDW**
  - Connects the car to the dealer's local network.
  - Enables a new and very efficient process for diagnostic and downloads at Volvo workshops.
- **Volvo Cars Vehicle Connectivity Wi-Fi (optional) SSID VCVCW**
  - Connects the car to Internet using the dealer's local network.
  - Provides dealers with a very simple and efficient way to demonstrate connectivity features in the showroom
  - Prepares connected cars for delivery to customer.

The Volvo Cars Global Wi-Fi service will be delivered as a mandatory subscription for the dealer. The service includes a set of pre-configured access points to be installed at the dealership for extending the IT infrastructure at dealerships.

## 3.2 **TIE Service Journals for Volvo Cars Global Wi-Fi Service**

### **SJ 1000046- Support document for Helpdesks - Volvo Cars Global Wi-Fi Service**

Target groups for this SJ:

Support organizations that are involved in supporting dealers using Volvo Cars Global Wi-Service, Both during and after the implementation of the service.

### **SJ 1000044 - Volvo Cars Global Wi-Fi Service – Basic Fault Tracing – VIDA and Vehicle.**

Target groups for this SJ:

For dealers for initial troubleshooting prior writing a report as for helpdesks to ensure everything has been done to exclude the vehicle itself as the reason for a fault.

Also to be used by all supporting Volvo Cars Global Wi-Fi Service.

### **SJ 1000045 - Technical overview and design - Volvo Cars Global Wi-Fi Service**

Target group of this SJ:

The aim of the attached document in this SPJ is to provide extensive and in-depth knowledge about the Volvo Cars Global Wi-Fi Service. It provides information on requirements for the Wi-Fi service and how to adapt an existing dealership network to dealership Wi-Fi. The primary target group is IT technicians at the dealerships and/or NSCs.

### **SJ 1000039- Verification Tool - Volvo Cars Global Wi-Fi Service**

Target group of this SJ:

Is intended to be used by the IT department or the IT partner at the dealership. When preparing an order for the Volvo Cars Global Wi-Fi Service the tool is helpful to verify compliance with the requirements on the IT infrastructure.

It can later on also be used for fault tracing when there is a need to check that the IT infrastructure is still supporting Volvo Cars Global Wi-Fi Service, or not.

**SJ 1000040- Validation Tool - Volvo Cars Global Wi-Fi Service**

Target group of this SJ:

Is intended to be used by the NSC to verify the XML file created by the Verification Tool by the dealer when placing an order for Volvo Cars Global Wi-Fi Service or when there is an issue after an implementation.

**SJ 1000038 - Introduction - Volvo Cars Global Wi-Fi Service**

Target group of this SJ:

To be used by all as an introduction to Volvo Cars Global Wi-Fi Service

**SJ 1000049- Wi-Fi Self-assessment and test report - Volvo Cars Global Wi-Fi Service**

Target group of this SJ:

To be used by workshops that have installed the service.

It will include a list of tests that should be done in order to verify the service.

### 3.3 Requirements and Standards

In order to ensure the functionality, it is necessary to ensure that below requirements have been fulfilled.

SJ – 1000692 - Workshop System Requirements & Guidelines - VIDA in 2015 (Dealers)

Also ensure that the latest version of VIDA Prerequisite is installed.

For users in countries except for China, the latest version can be downloaded here:

<http://vidainstaller.volvocars.biz/client-installer/VIDASetup.exe>

For users in China, the latest file can be downloaded here:

<http://vidainstaller-cncc.volvocars.biz/client-installer-cn/VIDACNSetup.exe>

Notes:


The installation requires that you are logged in as an Administrator on your computer.

The computer might restart after the installation and the installation might continue after the restart.

## 4 HOW TO ESCALATE MAJOR ISSUES

If **many workshops suddenly experience issues at the same time** when using Volvo Cars Global Wi-Fi Service, then it is most likely caused by an ongoing major incident.

Please then forward feedback from affected workshops by forwarding TIE reports to central using below Concern Area and Sub Concern Area.

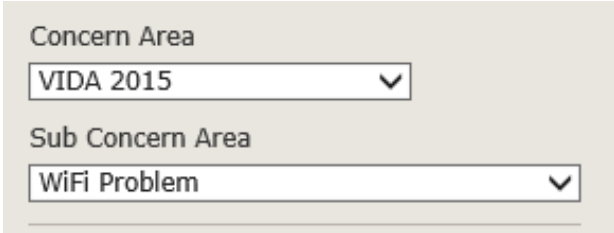

The image shows a screenshot of a web form. It has two dropdown menus. The first is labeled 'Concern Area' and has 'VIDA 2015' selected. The second is labeled 'Sub Concern Area' and has 'WiFi Problem' selected. Both dropdowns have a small downward arrow icon on the right side.

Please ensure that the following information is included in the TIE-report.

### **Description of the issue and business impact, e.g.**

- Vehicles does not appear in VIDA.
- Vehicle can be found in VIDA, but an error occurs when trying to connect to the vehicle.
- Other than above.

### **Please describe the symptom as clear as possible with impact.**

- Number of workshops affected.
- Time of occurrence (date and time.)
- If the vehicle appears in VIDA, but an issue occurs when trying to connect to the vehicle, then also attach below log files created by VIDA.

- ✓ **VIDAusername\_VIN.log**
- ✓ **VIDAusername\_VIDATrace.log**

Examples of:


- Network names according to Meraki (e.g SE-STO-6SE1234)
- Partner IDs according to VIDA Admin (e.g 6SE1234)
- VIN numbers if available.

## 5 HOW TO CONNECT


To establish a Wi-Fi connection between the vehicle and VIDA the technician or service advisor needs to enable the functionality in the vehicle first.

This is done by clicking the lock-button of the remote-key 3 times in range of the vehicle. Those 3 clicks needs to be done within 5 seconds and minimum 1 second between each click.

A Wi-Fi symbol will then first appear in the CCD in grey according to below example

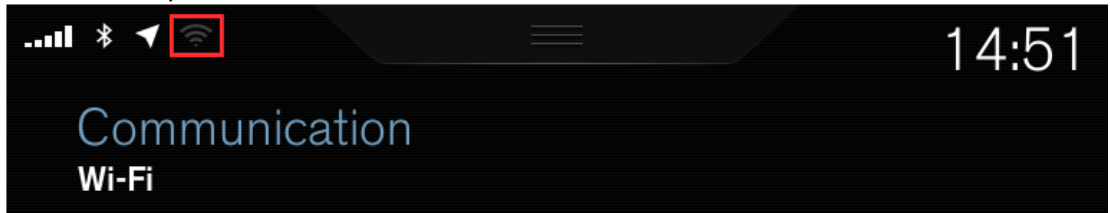

The Wi-Fi symbol will after 5-10 seconds change from grey to white when a successful connection has been established.

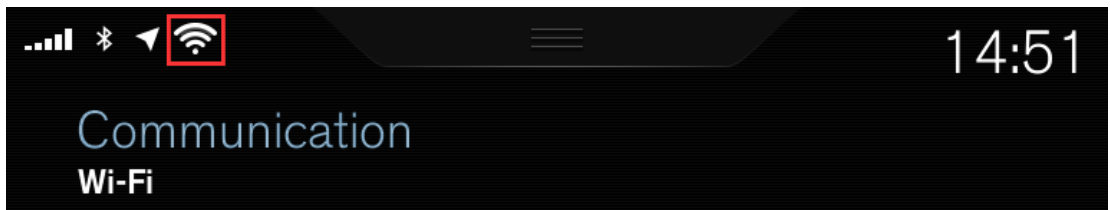

This sequence will be recognized by the vehicle. When the infrastructure is set up accordingly to the requirements and the vehicle is in range of Wi-Fi coverage, it then will be displayed and available in VIDA´s "Connected Vehicles" tab.

### Notes



The vehicle will in VIDA remain in the "Connected Vehicles" tab for 20 minutes, if no session is started by VIDA within this time the vehicle will disconnect from the Wi-Fi.


**A Dice or a VOE Adapter used for P2P cannot be connected to the vehicle since that will disable the Wi-Fi feature.**

## 6 VIDA


### 6.1 Wi-Fi connected vehicles

Wi-Fi connected vehicles will appear in the “Connected Vehicles” tab with a Wi-Fi symbol in the connection column.

After the vehicle has established a connection to the Volvo Cars Diagnostic Wi-Fi service, it will take about 10-15 sec until the vehicle appears in VIDA.

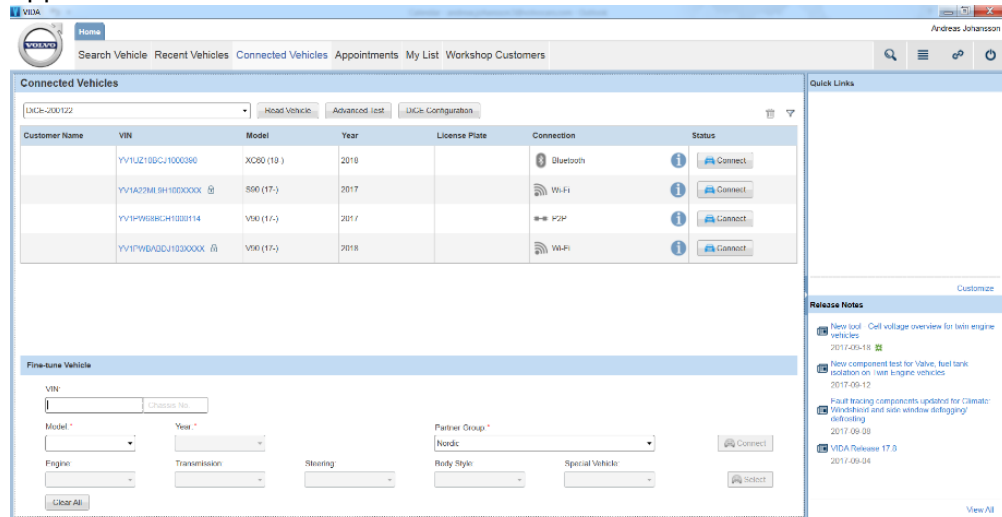

By clicking the “Connect”-Button the connection a pop-up window will appear where the last 4 digits of the Vehicle Identification Number (VIN) of the specific car needs to be entered.

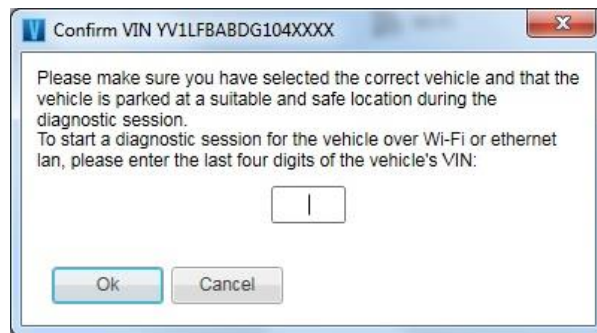

The VIN of a vehicle available via Wi-Fi is not totally displayed. The full VIN number can be looked up via DMS, TIE, vehicle papers or on the vehicle directly.

When the connection has been established the technician is able to do most of the work like (readout, software download, fault tracing, etc.) instead of using a cable-connection.

#### Note



Reload of VCM should not be performed via Wi-Fi since it will not be possible to establish a Wi-Fi connection due to lack of certificates in the ECU. Instead an Ethernet Cable (P2P) needs to be used.


Replacement of CEM need to be performed by using Ethernet Cable (P2P).



## 6.2 How to disconnect

To close an active connection with a vehicle the technician can do the following:

- A) Close vehicle – tab
- B) Select the Connection symbol
- C) Close VIDA

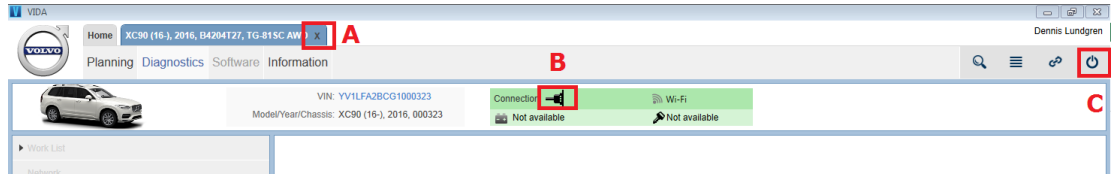


### Note

A secure disconnect is required otherwise the vehicle will remain in a connected – mode and the battery of the vehicle might drain.

It is also important to disconnect vehicles when ready with them to avoid too many vehicles in the Connected-Vehicle Tab.

## 6.3 How to filter

The filter functionality in VIDA can be helpful when there are a lot of (Wi-Fi available) vehicles on-site at the dealership.

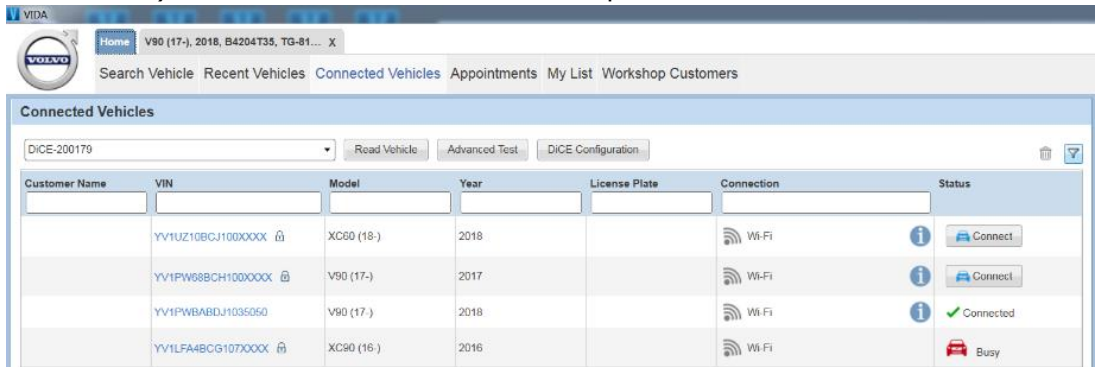

It is possible to filter for:

- Customer Name
- VIN
- Model
- Year
- License Plate
- Connection (type)

## 7 VIDA ADMIN

### 7.1 What are the functionalities in VIDA Admin?

VIDA clients and cars can be located in different IP subnets. Therefore the new functionality in VIDA Admin is needed, to set the IP settings according to the dealer network, when VIDA clients and vehicle are located in different networks/subnets.

More information can be found in:

#### **SPJ 34226 - Technical overview and design - Volvo Cars Global Wi-Fi Service**

**VIDA needs to be restarted after any changes have been done in VIDA Admin in order for the changes to take effect in VIDA.**

**LAN vehicle discovery**

VIDA clients and vehicles exist in different IP subnets.

VIDA can discover vehicles using two different methods:

1. Sequential scanning (always works)
2. Directed broadcast (better performance in LANs where routers support subnet directed broadcasts)

Specify which method should be used for each subnet.

Subnet 1 : \*  From  To  Subnet

Subnet 2 : \*

Subnet 3 : \*

Subnet 4 : \*

Subnet 5 : \*

Quantity of IP addresses

Quantity of scanning/sec

(\* Mandatory field )

## 8 ACCESS POINTS

---

### 8.1 Prerequisites

Access Points mounted at correct location and connected according to the installation Guide.



**During normal working conditions, the LED indicator on the AP will be:**

- Green - AP in Gateway mode with no clients
- Blue - AP in Gateway mode with clients

**Led patterns that will require actions:**

- Blinking Orange - AP can't find uplink
- Led not lit – No power supply or broken AP

**Other LED patterns that doesn't require any actions:**

- Orange - AP is booting
- Rainbow - AP is initializing/scanning
- Blinking Blue - AP is upgrading

## 8.2 How to fault trace and determine if an AP is broken or not.

*(AP is not active according to Meraki Dashboard)*

### Symptom 1 – LED is not lit on AP:



#### 1. Test of PoE/PoE injector.

Locate the Switch or PoE injector to where the non-functional AP is connected to.

Disconnect the ethernet cable used for the none functional AP at the Switch or PoE injector and move it to another ethernet outlet that has been connected to a functional AP.

- a. LED on the AP starts now starts to lit:  
Meaning that the ethernet cable between the AP and the Switch or PoE Injector is OK.  
But there is an issue with the power supply from the Switch or the PoE injector where the AP was previously connected to.
- b. LED on the AP is still not lit:  
Continue checkpoint 2.

#### 2. Test of Ethernet Cable

*(Checkpoint 1 has been followed and LED on the AP is still not lit)*

Move the non-functional AP and connect it to an Ethernet cable that has been connected to a functional AP.

- a. LED on the AP starts now start to lit:  
The ethernet cable initially used for the none working AP is broken.  
Replace the ethernet cable and try again.
- b. LED on the AP is still not lit:  
The AP seems to be broken and should maybe be replaced.  
See [How to request a replacement of a broken AP](#)  
**Note, Reconnect the non-functional AP in case it will be possible, and a need to perform further fault tracing.**

- **Symptom 2 – The LED will permanently remain lit with Orange color.**

1. Disconnect and Connect the Ethernet cable connected to the none functional AP in order to restart the AP.
  - a. The LED will now go from permanently Orange (*during startup*) to either green or blue. The AP seems to be OK and something unexpected happened during previous start-up of the AP.  
Wait 5-10 minutes and check the status of the AP in Meraki dashboard.
  - b. (*Checkpoint 1 has been followed but the LED on the AP is still permanently lit with orange color.*)

Perform a factory reset of the AP while connected to power supply:


Cisco Meraki devices can be reset to factory defaults using the reset button on the device. This requires a paper clip or object with a long thin tip. Insert the tip of the paper clip into the reset button, press, and hold it until the LED light turns off.

The reset button is located adjacent to the power and Ethernet ports on the AP. Exact location will vary by model. Example for model:

MR33 (Indoor AP)



MR72 (Outdoor AP)

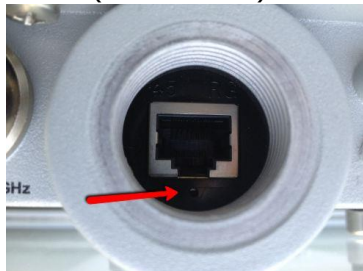


This will reset the device to factory defaults and reboot. Please be patient as this could take up to 5 - 10 minutes. If the reset resolved the issue, then the light of the LED will finally switch to either green or blue.

- c. (*Checkpoint 1 and 1b has been followed but the LED on the AP is still permanently lit with orange color.*)  
The AP seems to be broken and should maybe be replaced.  
See [How to request a replacement of a broken AP](#)  
**Note, Reconnect the non-functional AP in case it will be possible, and a need to perform further fault tracing.**

### 8.3 How to request a replacement of a broken AP.

Create and forward a TIE report to central using below Concern Area and Sub Concern Area.

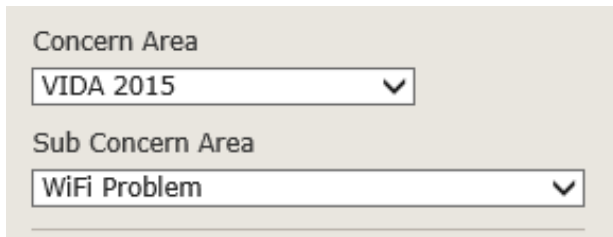

The image shows a screenshot of a web form. It has two dropdown menus. The first is labeled 'Concern Area' and has 'VIDA 2015' selected. The second is labeled 'Sub Concern Area' and has 'WiFi Problem' selected. Both dropdowns have a small downward arrow on the right side.

Include the following information in the free text field in case the AP will be replaced.

- Partner ID of the affected workshop.
- Serial number of the none working AP.
- Full company address to where a new AP could be delivered to.
- Name to a contact person.
- Email to the contact person.
- Phone number to the contact person.
- Optional, special instructions from the workshop and where to pick up the none functional access point. Such as time or special place for the pickup.

Also include the check list that is available in the same Service Journal as this document (Service Journal 1000046)

Updated 2020-11-25 – **AP-Check-List - Volvo Cars Global Wi-Fi Service-ver1.xlsx** has been replaced by **AP-Check-List - Volvo Cars Global Wi-Fi Service-ver2.docx**

**AP-Check-List - Volvo Cars Global Wi-Fi Service-ver2.docx** will now also have input fields for additional information that needs to be included.

The checklist is based on the checks that is being described in this document according to [7.2 How to fault trace and determine if an AP is broken or not.](#)

#### **8.4 Return instruction for a none functional Access point.**

Communication concerning replacement of a none functional access point will be done in the TIE report that has been sent to central concerning the none functional access point.

A none functional access point will be replaced with the same or equivalent model supporting the same functionality.

The none functional access point should be returned within 30 days after the new access point has been received.

Courier might contact the workshop before pickup depending on rules/country.

How to return the none functional access point.

- A prepaid return label will become available in the TIE report concerning the none functional access point or in the box that will be shipped with the new access point. Some other documents that also needs to be included in the return might also be sent from central depending on requirements /country.
- Date for the pick-up of the none functional access point will be communicated from central in the TIE report.
- The none functional access point should be placed in the same box that arrived with the new access point.)
- Seal the box and place the return shipping label on the box.
- Please also note the tracking number on the return label if a tracking number exists. Required in case there is a need to track the return.

## 9 MERAKI DASHBOARD

Request to access to Meraki Dashboard can be found in TIE SPJ 33048.


Login URLs for Meraki Dashboard:

When supporting workshops other than China. <https://dashboard.meraki.com>


When supporting workshops in China. <https://dashboard.meraki.cn>

Below will only show some basic steps and what to look for in Meraki Dashboard when there is a need to perform fault tracing.

Enter the Partner ID that you would like to look at and select the workshop after it is shown under the search field.

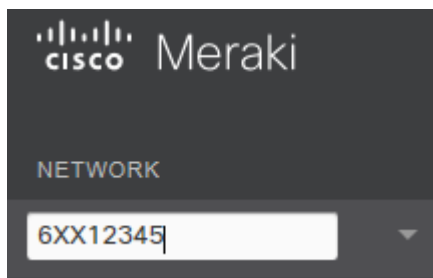

Then select Network-wide > Clients.

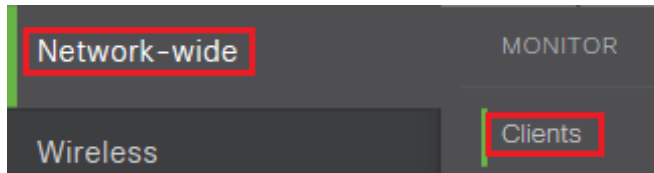


You will now see a view that will show what clients that have been connected to APs used for "Volvo Cars Global Wi-Fi Service"

- (1) **DoIP-VCCXXXXXX** means that the client is a vehicle.
- (2) The IP address provided for the vehicle.
- (3) What AP the vehicle is or has been connected to.
- (4) The vehicle is connected.
- (5) The vehicle is no longer connected.




Status	Description ^	IPv4 address	Connected to
 5	<a href="#">DolP-VCC7JRBR0FP5KG002731</a> <sup>1</sup>	192.168.131.206	<a href="#">EMEA-SE-SAA-AP1</a> <sup>3</sup>
 4	<a href="#">DolP-VCCYV1A22MK0H1014728</a>	192.168.131.43	<a href="#">EMEA-SE-SAA-AP2</a>
 4	<a href="#">DolP-VCCYV1LCBACDK1415620</a>	192.168.131.186	<a href="#">EMEA-SE-SAA-AP5</a>
 4	<a href="#">DolP-VCCYV1PW68UCK1085692</a>	192.168.131.7	<a href="#">EMEA-SE-SAA-AP5</a>
 4	<a href="#">DolP-VCCYV1PWAKUDK1098781</a>	192.168.131.157	<a href="#">EMEA-SE-SAA-AP4</a>
 4	<a href="#">DolP-VCCYV1PWBABDJ1035050</a>	192.168.131.224	<a href="#">EMEA-SE-SAA-AP5</a>
 4	<a href="#">DolP-VCCYV1PZA3TCK1067660</a>	192.168.131.156	<a href="#">EMEA-SE-SAA-AP3</a>
 4	<a href="#">DolP-VCCYV1UZA8VCK1189839</a>	192.168.131.239	<a href="#">EMEA-SE-SAA-AP6</a>

Default you will see the status for the last day.  
But it can be changed by using below option.

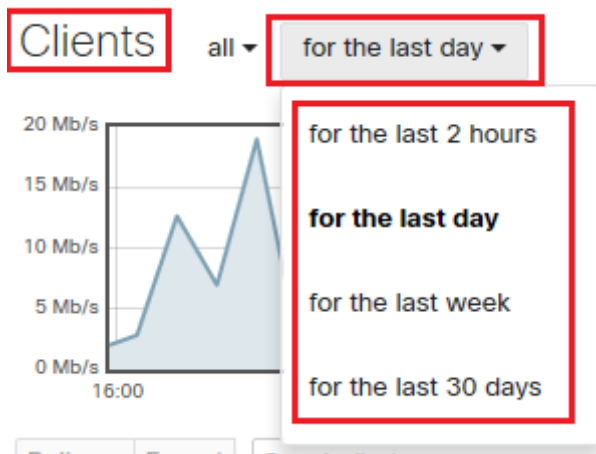


If the column IPv4 address or any other column is missing, then it can be added by selecting the Plus sign according to below.

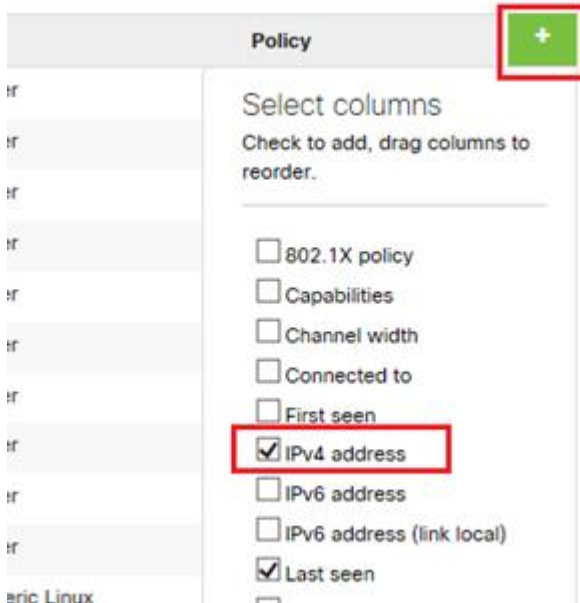

You can also see the status of all access points for a workshop and their history and current status towards the cloud used for “Volvo Cars Global Wi-Fi Service”

First, select below options:

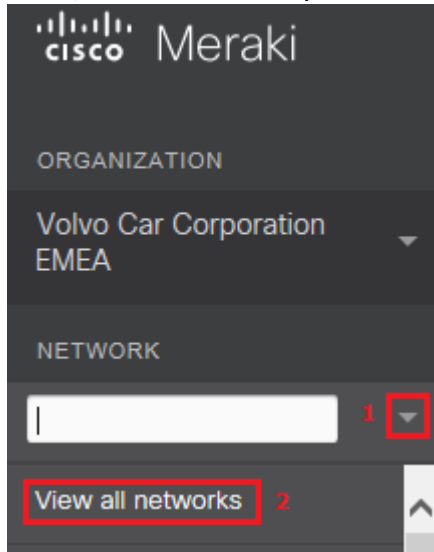


Next:

- (1) Enter the Partner ID for the workshop that you would like to check.
- (2) Select “Devices”.
- (3-4) Then you will see status for each access point and for that last week.

Networks		Network tags		2 Devices	
1		Se-got-vcc-saa	9 matches in 458	Over the last week: 1821 clients, 344.61 GB	
					CSV +
Model	Name ^	Network	MAC address	Connectivity	
MR33	EMEA-SE-SAA-AP1	SE-GOT-VCC-SAA	0c:8d:db:84:c1:8f	3	
MR74	EMEA-SE-SAA-AP2	SE-GOT-VCC-SAA	0c:8d:db:68:9a:86		
MR74	EMEA-SE-SAA-AP3	SE-GOT-VCC-SAA	0c:8d:db:68:9f:b3	4	
MR74	EMEA-SE-SAA-AP4	SE-GOT-VCC-SAA	0c:8d:db:68:9f:ce		
MR33	EMEA-SE-SAA-AP5	SE-GOT-VCC-SAA	0c:8d:db:84:c7:63		

If any column is missing, then it can be added by selecting the + sign icon according to below.

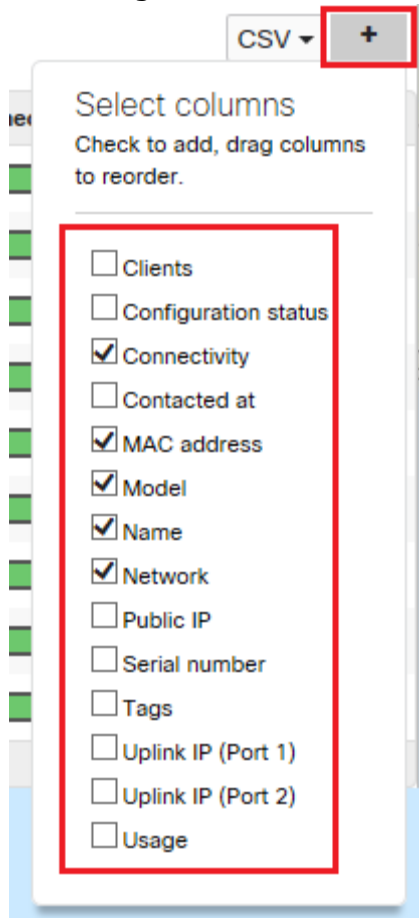

## 10 FAULT TRACING – VEHICLE(S) DOES NOT APPEAR IN VIDA

### 10.1 Vehicle(s) does not appear in VIDA after locking the vehicle 3 times.

You are recommended to start by using [Fault Tracing Chart](#)

The “Fault Tracing Chart” will have links to below sections 9.1.1 – 9.1.6 that will include more details if needed.

#### 10.1.1 Are all Access Points (AP) that are expected to operate showing green or not in Meraki Dashboard?

Also see [Meraki Dashboard](#)

Shows the network uptime percentage.

- 95–100% Network uptime
- 75–95% Network uptime
- 50–75% Network uptime
- <50% Network uptime
- No uptime data

Green	The AP is able to connect to internet and the cloud used for the AP.																														
<div style="display: flex; justify-content: space-between; align-items: center;"> <span>Se-got-vcc-saa</span> <span>9 matches in 458 Over the last week: 1821 clients, 344.61 GB</span> <span>CSV +</span> </div> <table border="1"> <thead> <tr> <th>Model</th> <th>Name ^</th> <th>Network</th> <th>MAC address</th> <th>Connectivity</th> </tr> </thead> <tbody> <tr> <td>MR33</td> <td>EMEA-SE-SAA-AP1</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:84:c1:8f</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span></td> </tr> <tr> <td>MR74</td> <td>EMEA-SE-SAA-AP2</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:68:9a:86</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span></td> </tr> <tr> <td>MR74</td> <td>EMEA-SE-SAA-AP3</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:68:9f:b3</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span></td> </tr> <tr> <td>MR74</td> <td>EMEA-SE-SAA-AP4</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:68:9f:ce</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span></td> </tr> <tr> <td>MR33</td> <td>EMEA-SE-SAA-AP5</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:84:c7:63</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span></td> </tr> </tbody> </table>		Model	Name ^	Network	MAC address	Connectivity	MR33	EMEA-SE-SAA-AP1	SE-GOT-VCC-SAA	0c:8d:db:84:c1:8f	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>	MR74	EMEA-SE-SAA-AP2	SE-GOT-VCC-SAA	0c:8d:db:68:9a:86	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>	MR74	EMEA-SE-SAA-AP3	SE-GOT-VCC-SAA	0c:8d:db:68:9f:b3	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>	MR74	EMEA-SE-SAA-AP4	SE-GOT-VCC-SAA	0c:8d:db:68:9f:ce	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>	MR33	EMEA-SE-SAA-AP5	SE-GOT-VCC-SAA	0c:8d:db:84:c7:63	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>
Model	Name ^	Network	MAC address	Connectivity																											
MR33	EMEA-SE-SAA-AP1	SE-GOT-VCC-SAA	0c:8d:db:84:c1:8f	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>																											
MR74	EMEA-SE-SAA-AP2	SE-GOT-VCC-SAA	0c:8d:db:68:9a:86	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>																											
MR74	EMEA-SE-SAA-AP3	SE-GOT-VCC-SAA	0c:8d:db:68:9f:b3	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>																											
MR74	EMEA-SE-SAA-AP4	SE-GOT-VCC-SAA	0c:8d:db:68:9f:ce	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>																											
MR33	EMEA-SE-SAA-AP5	SE-GOT-VCC-SAA	0c:8d:db:84:c7:63	<span style="display: inline-block; width: 100%; height: 10px; background-color: #90EE90; border: 1px solid black;"></span>																											

Orange	The AP is able to connect to internet and the cloud used for the AP, but has one or more active alerts.																														
<div style="display: flex; justify-content: space-between; align-items: center;"> <span>Se-got-vcc-saa</span> <span>9 matches in 458 Over the last week: 1821 clients, 344.61 GB</span> <span>CSV +</span> </div> <table border="1"> <thead> <tr> <th>Model</th> <th>Name ^</th> <th>Network</th> <th>MAC address</th> <th>Connectivity</th> </tr> </thead> <tbody> <tr> <td>MR33</td> <td>EMEA-SE-SAA-AP1</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:84:c1:8f</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span></td> </tr> <tr> <td>MR74</td> <td>EMEA-SE-SAA-AP2</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:68:9a:86</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span></td> </tr> <tr> <td>MR74</td> <td>EMEA-SE-SAA-AP3</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:68:9f:b3</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span></td> </tr> <tr> <td>MR74</td> <td>EMEA-SE-SAA-AP4</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:68:9f:ce</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span></td> </tr> <tr> <td>MR33</td> <td>EMEA-SE-SAA-AP5</td> <td>SE-GOT-VCC-SAA</td> <td>0c:8d:db:84:c7:63</td> <td><span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span></td> </tr> </tbody> </table>		Model	Name ^	Network	MAC address	Connectivity	MR33	EMEA-SE-SAA-AP1	SE-GOT-VCC-SAA	0c:8d:db:84:c1:8f	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>	MR74	EMEA-SE-SAA-AP2	SE-GOT-VCC-SAA	0c:8d:db:68:9a:86	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>	MR74	EMEA-SE-SAA-AP3	SE-GOT-VCC-SAA	0c:8d:db:68:9f:b3	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>	MR74	EMEA-SE-SAA-AP4	SE-GOT-VCC-SAA	0c:8d:db:68:9f:ce	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>	MR33	EMEA-SE-SAA-AP5	SE-GOT-VCC-SAA	0c:8d:db:84:c7:63	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>
Model	Name ^	Network	MAC address	Connectivity																											
MR33	EMEA-SE-SAA-AP1	SE-GOT-VCC-SAA	0c:8d:db:84:c1:8f	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>																											
MR74	EMEA-SE-SAA-AP2	SE-GOT-VCC-SAA	0c:8d:db:68:9a:86	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>																											
MR74	EMEA-SE-SAA-AP3	SE-GOT-VCC-SAA	0c:8d:db:68:9f:b3	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>																											
MR74	EMEA-SE-SAA-AP4	SE-GOT-VCC-SAA	0c:8d:db:68:9f:ce	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>																											
MR33	EMEA-SE-SAA-AP5	SE-GOT-VCC-SAA	0c:8d:db:84:c7:63	<span style="display: inline-block; width: 100%; height: 10px; background-color: #FFD700; border: 1px solid black;"></span>																											

**Red** The AP is **NOT** able to connect to internet and the cloud used for the AP.

Model	Name ^	Network	MAC address	Connectivity
MR33	EMEA-SE-SAA-AP1	SE-GOT-VCC-SAA	0c:8d:db:84:c1:8f	[Red Bar]
MR74	EMEA-SE-SAA-AP2	SE-GOT-VCC-SAA	0c:8d:db:68:9a:86	[Red Bar]
MR74	EMEA-SE-SAA-AP3	SE-GOT-VCC-SAA	0c:8d:db:68:9f:b3	[Red Bar]
MR74	EMEA-SE-SAA-AP4	SE-GOT-VCC-SAA	0c:8d:db:68:9f:ce	[Red Bar]
MR33	EMEA-SE-SAA-AP5	SE-GOT-VCC-SAA	0c:8d:db:84:c7:63	[Red Bar]

**Grey** The AP has not yet been connected or it has not been able to connect to internet and cloud used for the AP during the last 7 days.

Model	Name ^	Network	MAC address	Connectivity
MR33	EMEA-SE-SAA-AP1	SE-GOT-VCC-SAA	0c:8d:db:84:c1:8f	[Grey Bar]
MR74	EMEA-SE-SAA-AP2	SE-GOT-VCC-SAA	0c:8d:db:68:9a:86	[Grey Bar]
MR74	EMEA-SE-SAA-AP3	SE-GOT-VCC-SAA	0c:8d:db:68:9f:b3	[Grey Bar]
MR74	EMEA-SE-SAA-AP4	SE-GOT-VCC-SAA	0c:8d:db:68:9f:ce	[Grey Bar]
MR33	EMEA-SE-SAA-AP5	SE-GOT-VCC-SAA	0c:8d:db:84:c7:63	[Grey Bar]

If any AP is shown as **Grey** in Meraki dashboard at the time when the workshop faced an issue, then it could mean:

1. The AP has been offline unexpectedly for more than 7 days and fault tracing should be done.
2. Or the workshop has just ordered an additional AP that has not yet been mounted or connected and the status is then expected to be shown as grey until it has been installed and connected properly.

In TIE, try to find an additional order for an additional access point.

**Note.** In TIE you also need to have access to Partner ID **4 SE GWO** in order to see Wi-Fi orders done by workshops.

If you don't have access to Partner ID **4 SE GWO**, then you need to request access by creating a TIE report using below template and state the reason for the request and that you need to have "VCC\_Reader access"

Concern Area

Sub Concern Area

When you have access to **4 SE GWO**

Make a search under the section TIE Report and use the Partner ID as input for the search.



Inform the workshop to perform necessary actions in case not all tests are shown as green.



IP settings	IP services	Cloud Connect
Interface (1000 Mbit)	Proxy	Gateway Ping
Subnet Size (/24)	DNS	Internet Ping
DHCP (10.4.2.5)	NTP	Controller Primary
Leasetime (123 hours)	HTTP	Controller Secondary
Scope size (254 IPs)	HTTPS	

After a conclusion has been made and possible actions has been taken, then please proceed back to the [Fault Tracing Chart](#)

### 10.1.2 Is the VIN present in Meraki Dashboard?

Also see [Meraki Dashboard](#)

Clients all for the last day 5.87 GB (↓ 2.95 GB, ↑ 2.93 GB) | Matches: 98 KB (↓ 21 KB ↑ 77 KB) Applications

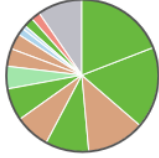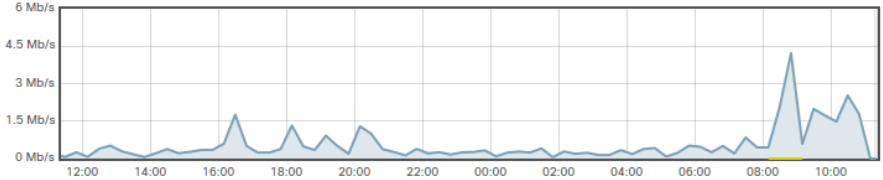

[More »](#)

Policy Forget **YV1UZA8VCK1189839** **You can search for the VIN here** 1 client device in 48 Download as

<input type="checkbox"/>	Status	Description	Last seen ^	Usage	OS	IPv4 address	Policy	Recent SSID	Connected to	+
<input type="checkbox"/>	1	Wi-Fi DoIP-VCCarDW <b>YV1UZA8VCK1189839</b>	Mar 04 08:52	98 KB	Generic Linux	192.168.131.239	normal	VCCarDW	EMEA-SE-SAA-AP6	

After a conclusion has been made, then please proceed back to the [Fault Tracing Chart](#)



**10.1.3 Can a MAC ID be found in Meraki Dashboard that starts with 00:10:02:XX:XX:XX at the time when Wi-Fi was activated in the vehicle?**

In [Meraki Dashboard](#), select the affected workshop by searching for the Partner ID for the affected workshop.

Go to Network-wide > Clients.

Check if there are any vehicles that have been trying to establish a connection, without the possibility to get an IP address and were the description is only showing the Mac ID address from the vehicle.

A MAC ID address for a vehicles always starts with **00:10:02:XX:XX:XX** And the Manufacture is shown as ACTIA.

Can a MAC ID be found in Meraki Dashboard that starts with **00:10:02:XX:XX:XX** at the time when Wi-Fi was activated in the vehicle?

Description	Select and sort on IPv4 address	IPv4 address ^	Manufacturer
00:10:02:25:28:ec			ACTIA
00:10:02:28:cd:47			ACTIA
00:10:02:2e:d8:aa			ACTIA
00:10:02:2f:02:85			ACTIA
00:10:02:2f:8e:24			ACTIA
00:10:02:3d:60:64			ACTIA
00:10:02:3f:61:81			ACTIA
00:10:02:90:5e:03			ACTIA
1c:48:ce:3b:a4:50			GUANGDONG OPPO MOBILE...
9c:a5:c0:7a:cf:4c			vivo Mobile Communication
DoIP-VCCYV1LC10GXX1466226			ACTIA
DoIP-VCCLYVPD10D1KP103636		192.168.108.101	ACTIA
DoIP-VCCYV1LFA2D2G1011078		192.168.108.101	ACTIA
DoIP-VCCYV1LFA2D4K1416612		192.168.108.103	ACTIA

Annotations in the image:

- A red box highlights the first seven rows of the table, with the text "Only MAC ID address is shown" next to it.
- A red box highlights the "IPv4 address" column for the first seven rows, with the text "IP addresses missing" inside.
- A red box highlights the "Manufacturer" column for the first seven rows, with the text "Manufacturer ACTIA means that it is a vehicle" next to it.
- A red arrow points to the "Select and sort on IPv4 address" text.

After a conclusion has been made, then please proceed back to the [Fault Tracing Chart](#)

**10.1.4 Is an IP-address present or not for the VIN in Meraki Dashboard.**

Select and sort on IPv4 address and check if any vehicles are not getting an IP address at the day when the issue occurred.

If a vehicle is shown with DoIP-VINVCCXXXXXX, then it means that the vehicle has a valid certificate in the ECU VCM, but the missing IP address could be caused by lack of IP addresses from the local DHCP.

Contact local IT and inform them to ensure a working DHCP function.

<input type="checkbox"/>	Status	Description	Vehicles showing Do-IP trying to connect	Last seen	IPv4 address ^
<input type="checkbox"/>	1	<a href="#">60:57:18:1e:55:28</a>	↓	Jan 17 15:04	IP address missing
<input type="checkbox"/>	2	<a href="#">DoIP-VCCYV1LFA2MCJ1190931</a>		Jan 17 17:58	
<input type="checkbox"/>	3	<a href="#">DoIP-VCCYV1PZ10MCJ1035433</a>		Jan 19 16:02	
<input type="checkbox"/>	4	<a href="#">DoIP-VCCYV1XZACMCK2059870</a>		Jan 25 14:08	
<input type="checkbox"/>	5	<a href="#">DoIP-VCCYV1ZW10MDK1009874</a>		Jan 28 14:12	
<input type="checkbox"/>	6	<a href="#">DoIP-VCCYV1ZW10MDK1013260</a>		Jan 17 17:44	

How it can look when an IP address is present for a vehicle.

<input type="checkbox"/>	Status ▾	Description	IPv4 address
<input type="checkbox"/>	1	<a href="#">DoIP-VCCYV1UZ10BCJ1000390</a>	192.168.131.11
<input type="checkbox"/>	2	<a href="#">DoIP-VCC7JRBR0FP5KG002731</a>	192.168.131.206
<input type="checkbox"/>	3	<a href="#">DoIP-VCCYV1LCBACDK1415620</a>	192.168.131.186
<input type="checkbox"/>	4	<a href="#">DoIP-VCCYV1LFA4BCG1000504</a>	192.168.131.55

After a conclusion has been made and possible actions have been taken, then please proceed back to the [Fault Tracing Chart](#)

**10.1.5 If needed, adjust settings in VIDA Admin if different subnets are intended to be used for Volvo Cars Diagnostic WI-Fi and computers used for VIDA.**

If local IT states that different Subnets are intended to be used for Volvo Cars Diagnostic WI-Fi.

Then it also has to be configured in VIDA Admin.

More information can also be found in:

*SPJ 1000045 - Technical overview and design - Volvo Cars Global Wi-Fi Service*

**LAN vehicle discovery**

VIDA clients and vehicles exist in different IP subnets.

VIDA can discover vehicles using two different methods:

1. Sequential scanning (always works)
2. Directed broadcast (better performance in LANs where routers support subnet directed broadcasts)

Specify which method should be used for each subnet.

Subnet 1 : \*  From  To  Subnet

Subnet 2 : \*

Subnet 3 : \*

Subnet 4 : \*

Subnet 5 : \*

Quantity of IP addresses

Quantity of scanning/sec

(\* Mandatory field )

After a conclusion has been made and possible actions has been taken, then please proceed back to the [Fault Tracing Chart](#)

### 10.1.6 Check and if needed adjust local infrastructure such as firewalls and blocking of ports.

Check that there is no local proxy/firewall within the network or on computers used by VIDA that are blocking required ports according to:

*SPJ – 1000692 - Workshop System Requirements & Guidelines - VIDA in 2015 (Dealers)*

A check can be done by connecting a computer to the same network as the APs and to run the verification tool on that computer.

*SPJ 1000039 - Verification Tool - Volvo Cars Global Wi-Fi Service.*

If needed consult with local IT if some of the results in the verification tool is showing Red.


The user guide available in SPJ 1000039 will include guidance for when some of the tests are not shown as green.

Inform the workshop to perform necessary actions in case not all tests are shown as green.

IP settings	IP services	Cloud Connect
Interface (1000 Mbit)	Proxy	Gateway Ping
Subnet Size (/24)	DNS	Internet Ping
DHCP (10.4.2.5)	NTP	Controller Primary
Leasetime (123 hours)	HTTP	Controller Secondary
Scope size (254 IPs)	HTTPS	

After a conclusion has been made and possible actions has been taken, then please proceed back to the [Fault Tracing Chart](#)

**11 FAULT TRACING CHART - VEHICLE(S) DOES NOT APPEAR IN VIDA AFTER LOCKING THE VEHICLE 3 TIMES.**

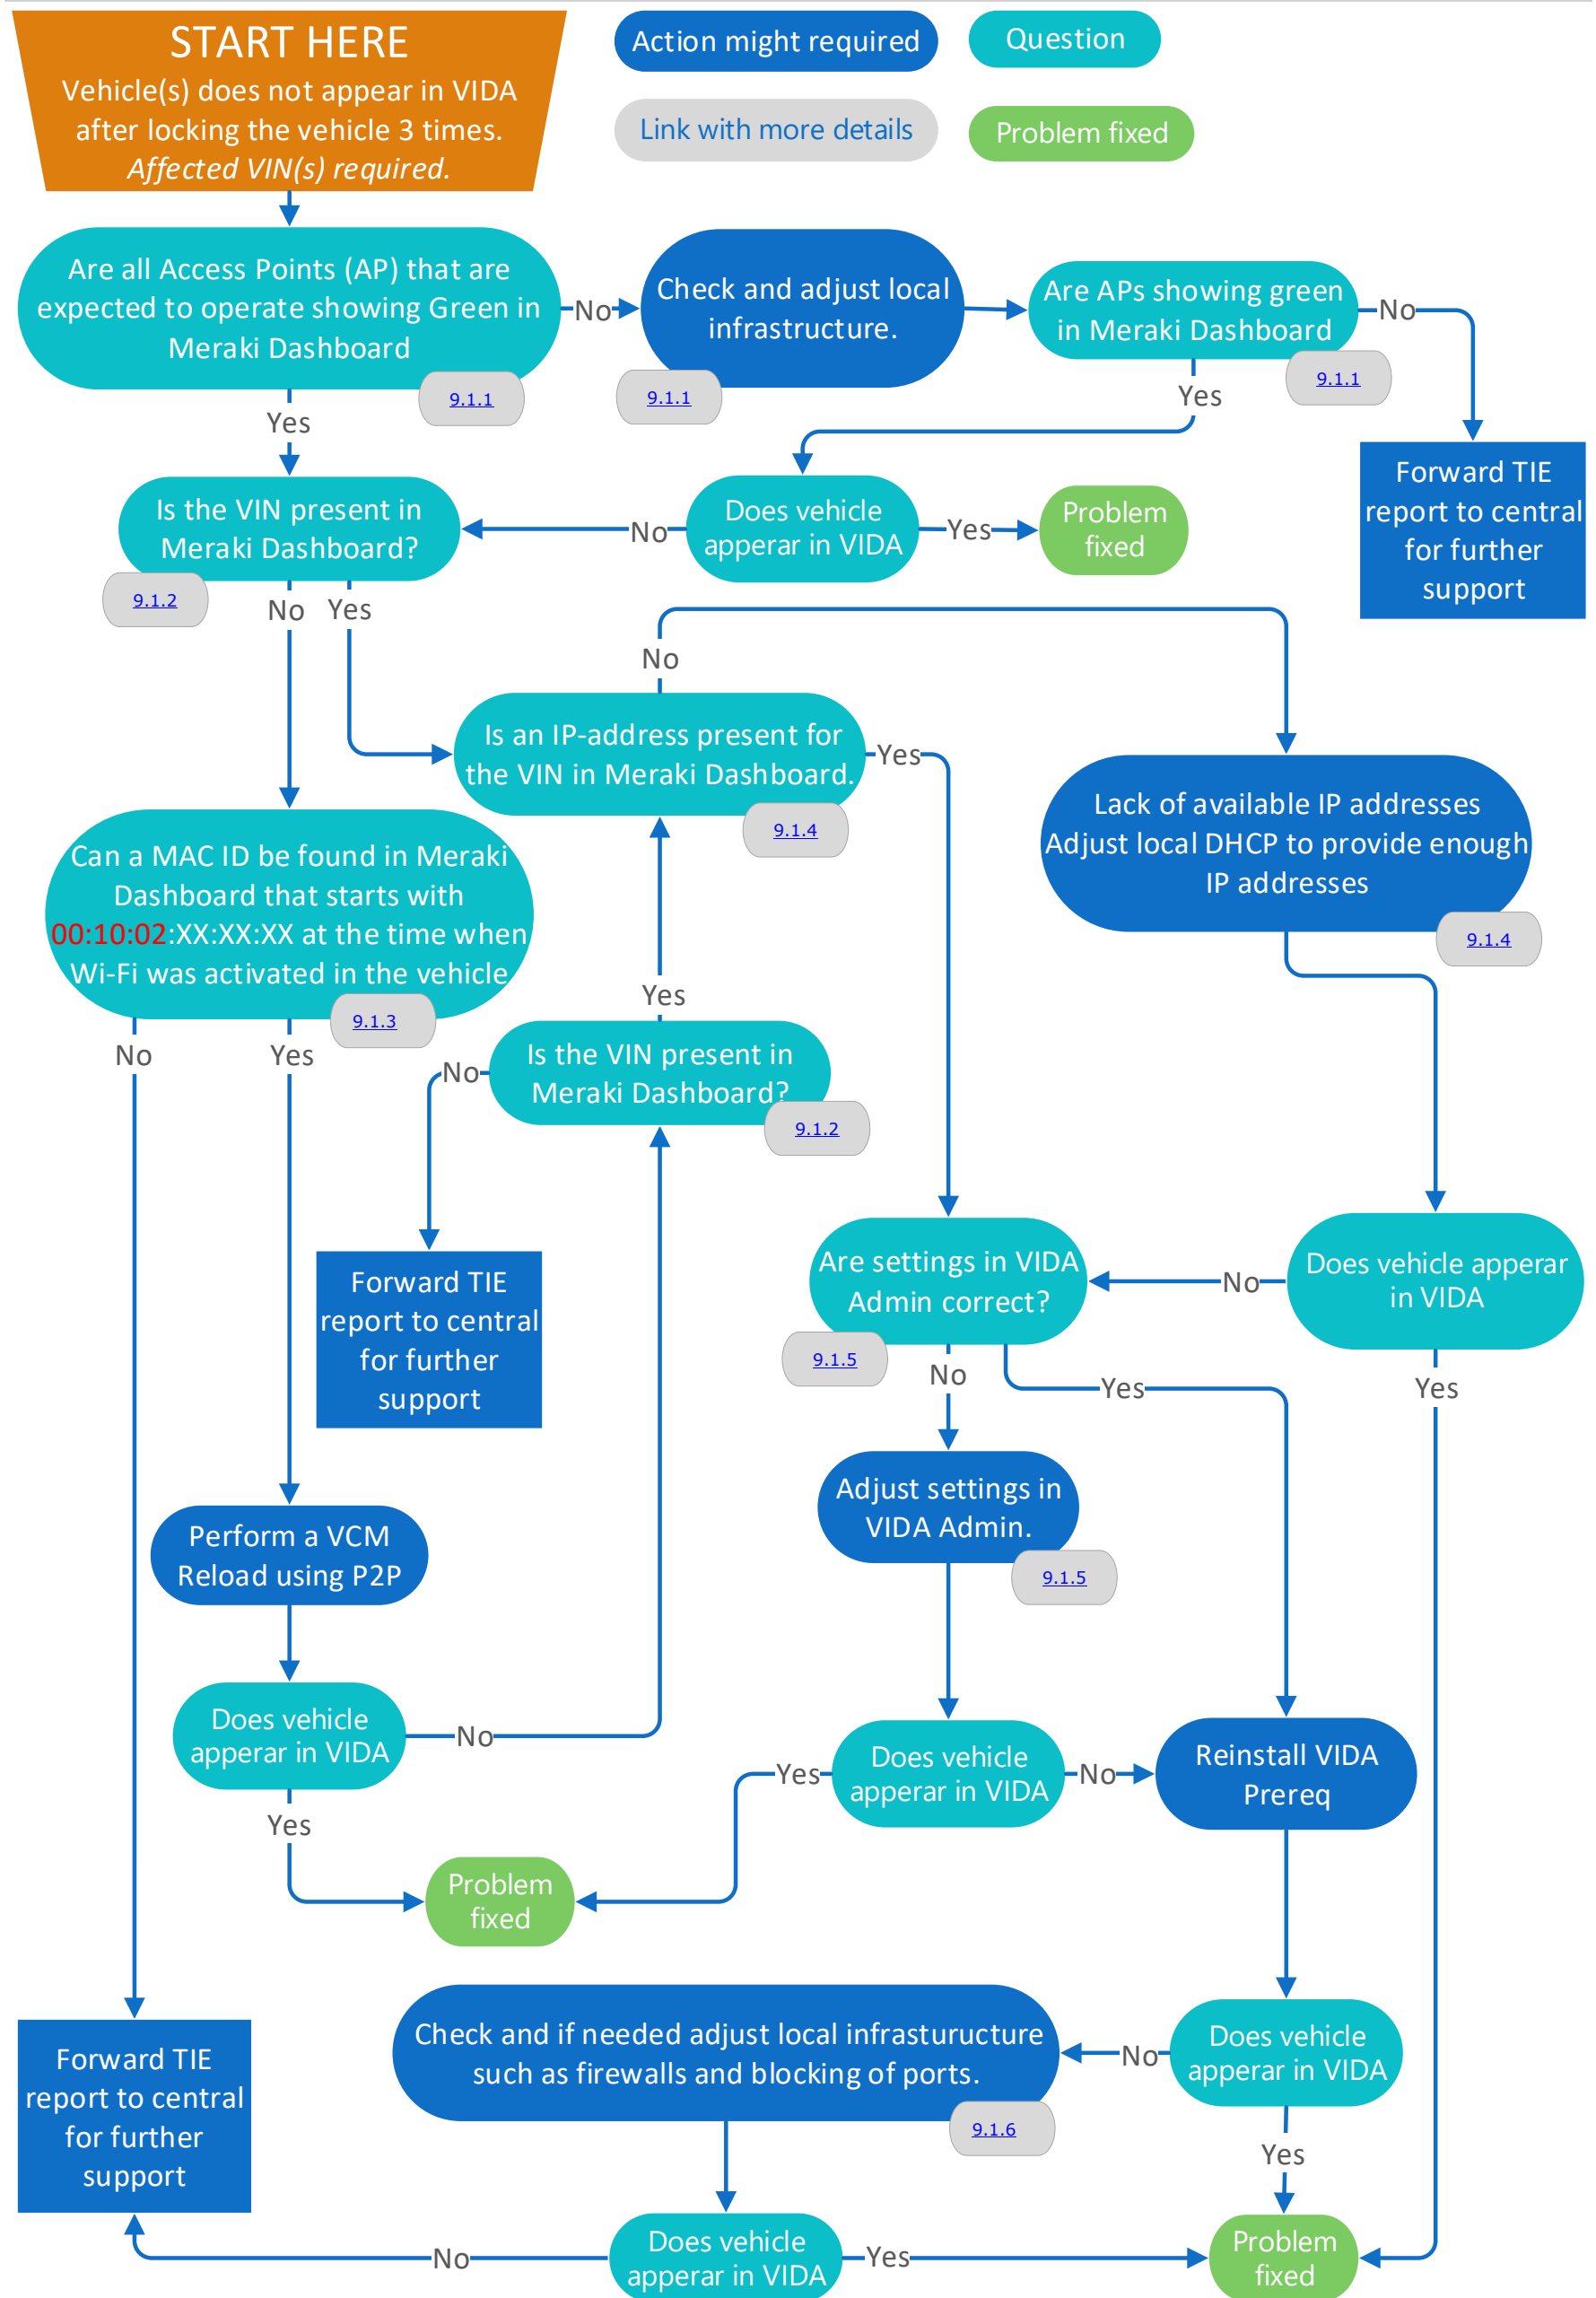

## 12 FAULT TRACING - ERROR SHOWN WHEN TRYING TO CONNECT TO THE VEHICLE.

---

### 12.1 Vehicle appears in VIDA, but an error message is shown when trying to connect to the vehicle.

Below error message is shown in VIDA instead of a successful readout of the vehicle.



#### 12.1.1 Perform a battery reset of the vehicle.

If above error message is shown, then start with performing a battery reset of the vehicle.

It is important that you first turn ignition mode to off.

- Disconnect the negative pole of the main battery in the trunk.
- Wait 1 minute in order for the car to get fully discharged.
- Reconnect the negative pole of the main battery in the trunk.

After a conclusion has been made and possible actions has been taken, then please proceed back to the [Fault Tracing Chart](#)

### 12.1.2 Check and if needed adjust local infrastructure such as firewalls and blocking of ports.

Check that there is no local proxy/firewall within the network or on computers used by VIDA that are blocking required ports according to:

*SPJ – 1000692 - Workshop System Requirements & Guidelines - VIDA in 2015 (Dealers)*

Especially port TCP 13400.

A check can be done by running the verification tool on the computer where the issue occurs.

*SPJ 1000039 - Verification Tool - Volvo Cars Global Wi-Fi Service.*

If needed consult with local IT if some of the results in the verification tool is showing Red.


The user guide available in SPJ 1000039 will include guidance when some of the tests are not shown as green.

Inform the workshop perform necessary actions in case not all tests are shown as green.

IP settings	IP services	Cloud Connect
Interface (1000 Mbit)	Proxy	Gateway Ping
Subnet Size (/24)	DNS	Internet Ping
DHCP (10.4.2.5)	NTP	Controller Primary
Leasetime (123 hours)	HTTP	Controller Secondary
Scope size (254 IPs)	HTTPS	

After a conclusion has been made and possible actions has been taken, then please proceed back to the [Fault Tracing Chart](#)

**13 FAULT TRACING CHART - ERROR SHOWN WHEN TRYING TO CONNECT TO THE VEHICLE.**

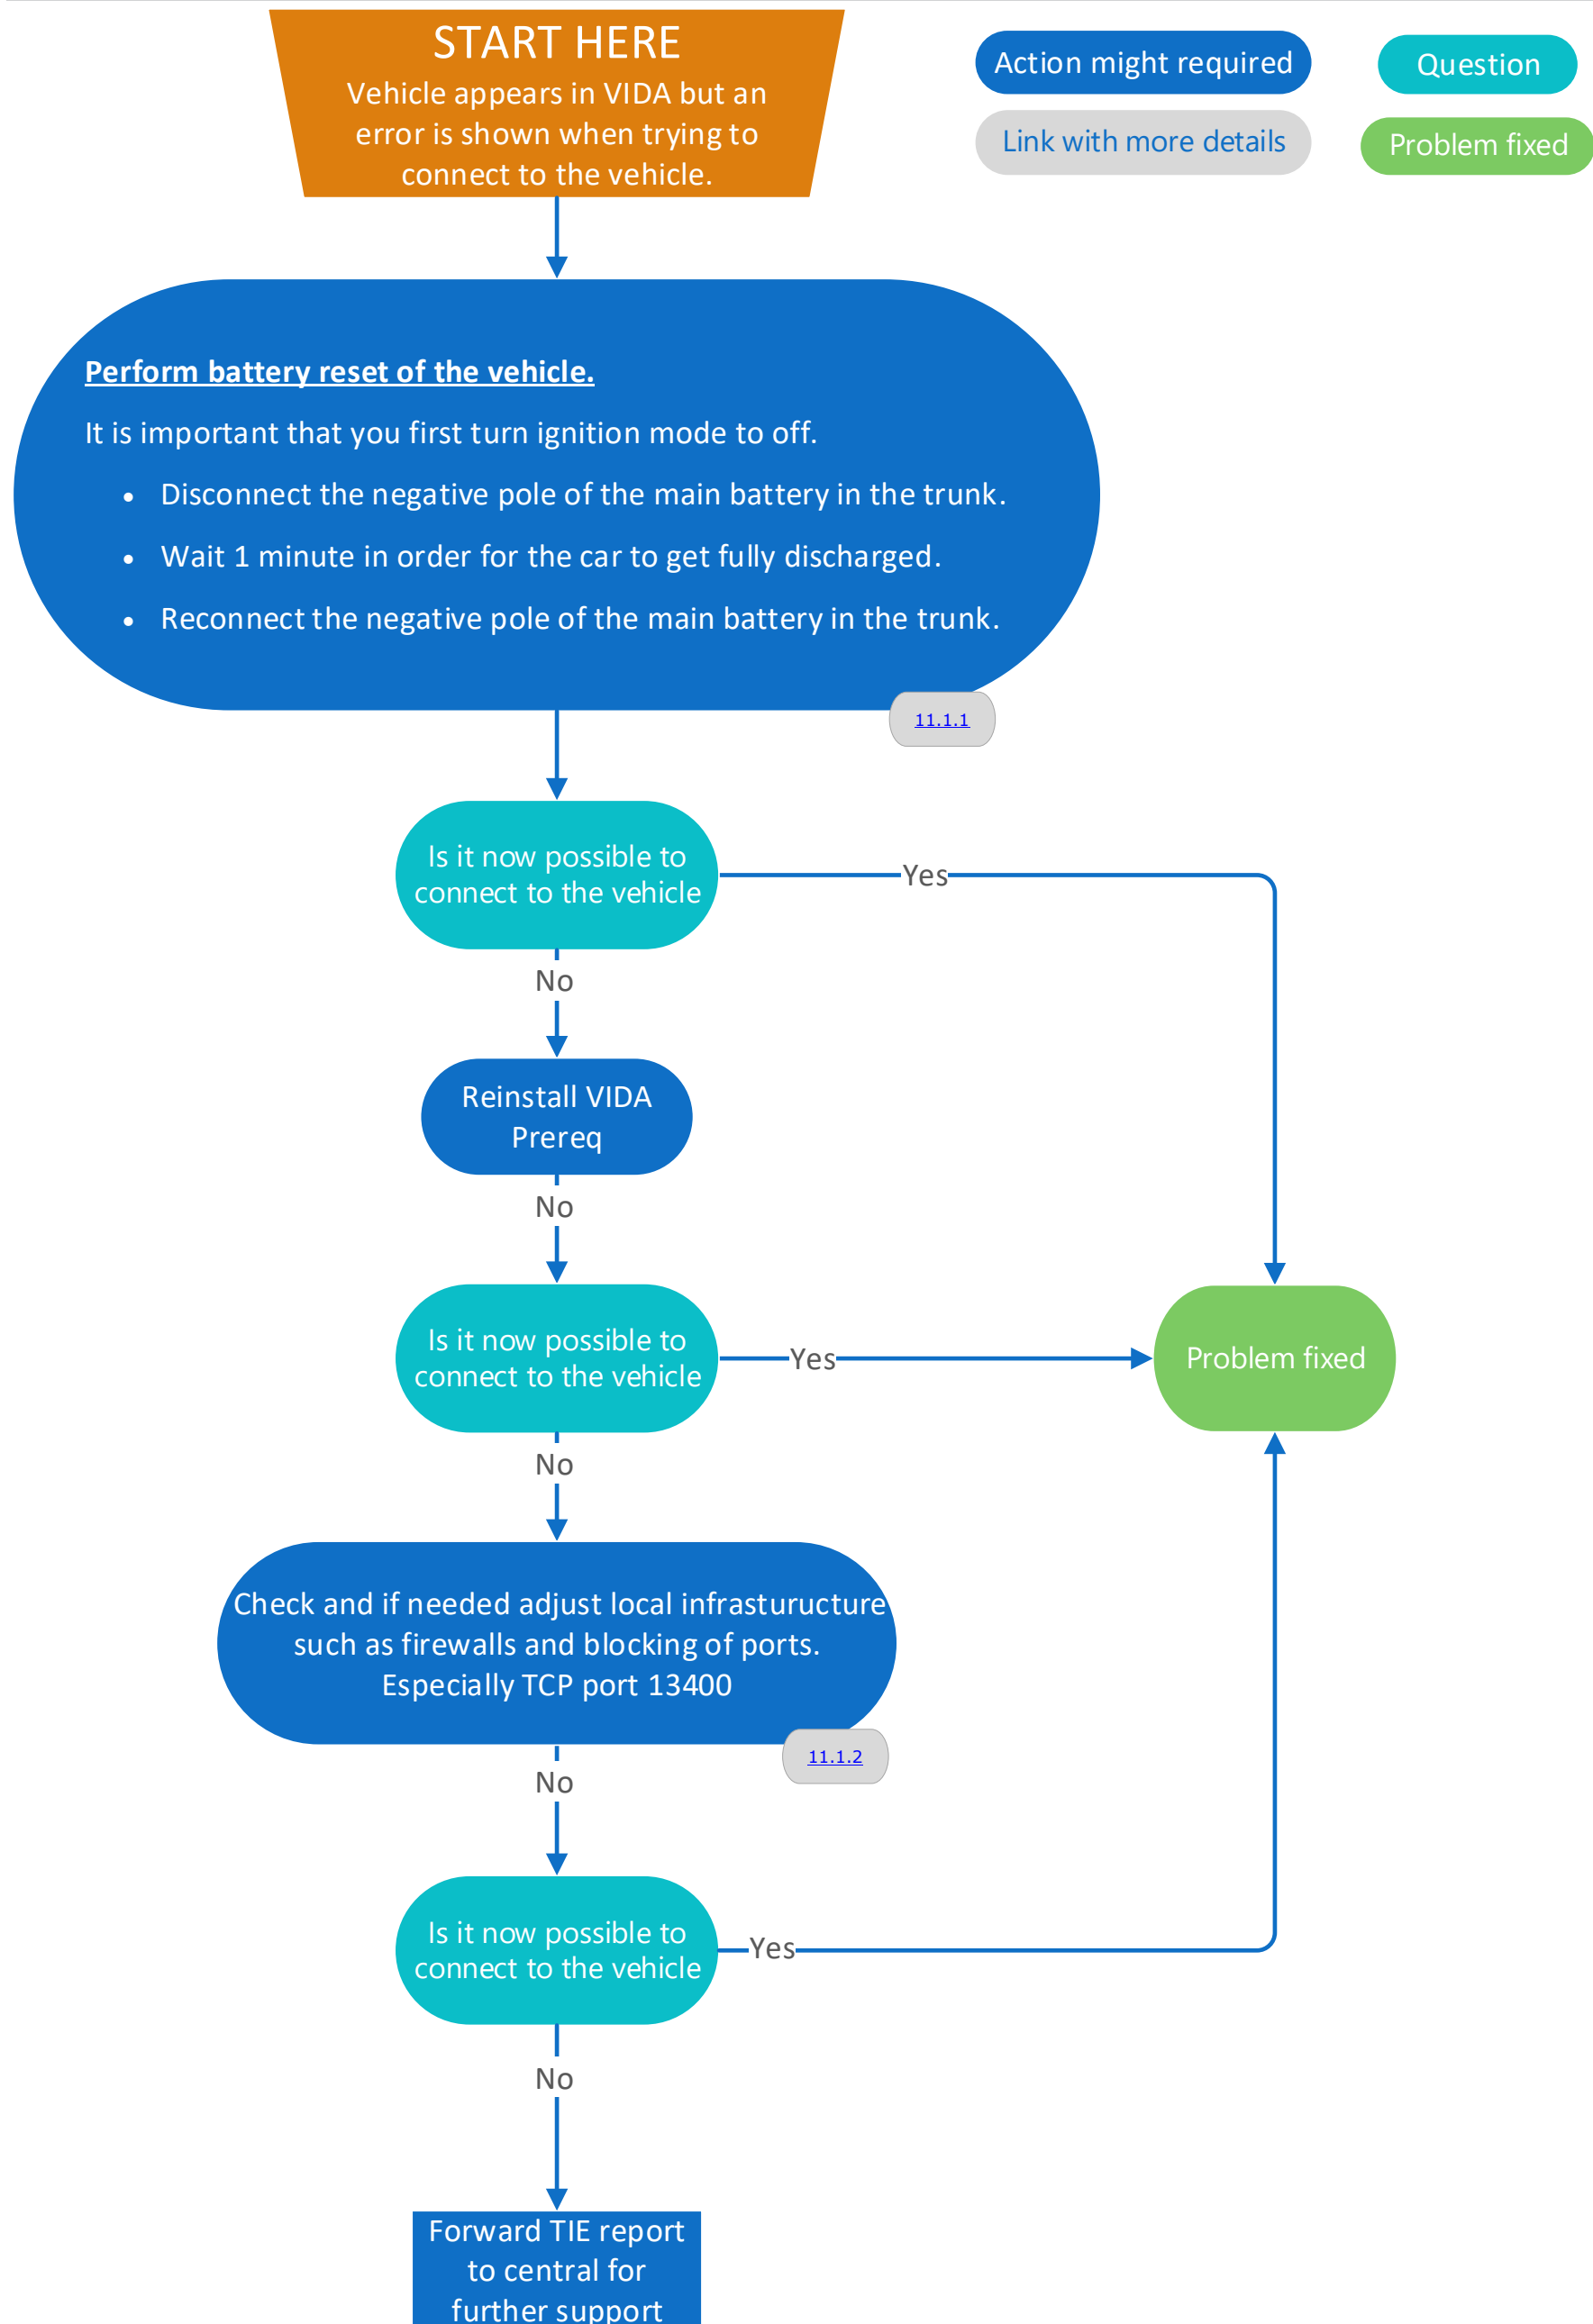



## 14 POOR PERFORMANCE – VEHICLE CONNECTION AND INSTALLATION OF SW

### 14.1 A bad Radio Frequency (RF) environment can result in connection issues and high SWDL Failure rate.


Guide for discovering RF problems in Meraki Dashboard.

Maintaining a good wireless environment is essential for benefiting the most from Volvo Cars Global Wi-Fi service. As more RF devices (access points, smartphones, laptops, etc.) are present in the workshop environment, complexity increases and the potential for degraded performance is larger.

Individuals providing support to workshops can use this guide in order to find RF issues in Meraki Dashboard. A bad RF environment can result in connection issues and high SWDL failure rate with no clear root cause. There's no guarantee that solving RF issues will resolve the workshop's problems, but it can improve the Wi-Fi performance.

#### 1. Access point connection:

Navigate to **Wireless -> Access Points** and verify that all access points are **ONLINE**. The Access Points table should show all access points with a valid local IP address (depends on the network setup). Here are some examples of workshops with issues:

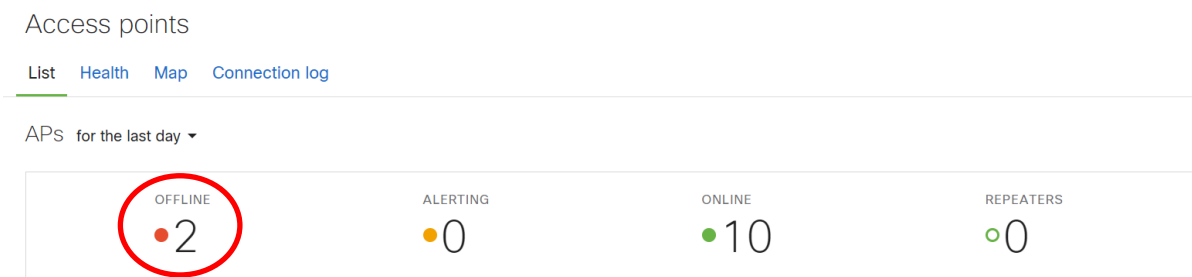

AP possibly connected to wrong network:

#	Status	Name	MAC address	Model	Connectivity	Usage	Clients with Usage	Current clients	Local IP	
1	●	BR-QMI-6BR7960-AP01	e0:cb:bc:bf:e4:7b	MR33	●	None	0	0	192.168.0.216	
2	●	BR-QMI-6BR7960-AP02	e0:cb:bc:bf:e3:01	MR33	●	None	0	0	192.168.0.208	
3	●	BR-QMI-6BR7960-AP03	34:56:fe:c8:21:fb	MR74	●	None	0	0	10.0.0.100	

**Recommendation to workshop:** Make sure all access points are installed in the right position and location. They should also be connected to the right local network and always have internet connection.

#### 2. Low signal strength:

Navigate to **Network-wide -> Event log** and for the field **“Event type include:”** select the option **“802.11 association”**. Associations with RSSI (received signal strength indication) values lower than **25** indicate that there can be issues with the workshop's signal strength. The **“Access Point:”** field can be used to identify which access point is having

problems. For example, in the image below, vehicles connected the access point AP23 show a low RSSI. This can be due to the vehicles being too far from the AP, there might be obstructions between the vehicle and the AP or the AP TX-power is too low.

Jan 22 12:16:12	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 15
Jan 22 12:15:50	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 12
Jan 22 12:02:48	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 10
Jan 22 12:01:39	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 13
Jan 22 11:58:44	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 23
Jan 22 11:46:29	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 9
Jan 22 11:45:59	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 19
Jan 22 11:42:52	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 41
Jan 22 11:41:36	<a href="#">SE-SLN-6SE484-AP23</a>	VCVCW	<a href="#">ISTA-VCCXXXXXXXXXXXXXXXXXX</a>	802.11 association	channel: 11, rssi: 20

**Recommendation to workshop:** Analyze the location of the vehicles in relation to the access points:

- Is there any obstacle between the vehicles and the access point such as: a wall, beams or glass?
- Verify that the location of the vehicles is covered by the access points according to the site survey.

### 3. Interference from other Wi-Fi devices:


Several Wi-Fi devices in the proximity of the workshop or the access points will result in a high channel utilization and a crowded RF environment. There are two main ways of detecting this in Meraki:

**Option 1:** Navigate to **Wireless -> RF Spectrum** and look at the **Avg. channel utilization (2.4 GHz)**. A channel utilization of more than **70%** can generate problems in the communication. Click on the AP to see more information on what channels are used the most and how the RF spectrum looks like.

RF spectrum

Name *	Channels used	Avg. channel utilization (2.4 GHz)	Avg. channel utilization (5 GHz)
<a href="#">BE-HSS-6BE033-AP01</a>	11,40	13% - low	0% - very low
<a href="#">BE-HSS-6BE033-AP02</a>	1,48	17% - low	3% - very low
<a href="#">BE-HSS-6BE033-AP03</a>	11,36	23% - low	4% - very low
<a href="#">BE-HSS-6BE033-AP04</a>	6,112	28% - low	3% - very low
<a href="#">BE-HSS-6BE033-AP05</a>	1,44	17% - low	4% - very low
<a href="#">BE-HSS-6BE033-AP06</a>	6,36	13% - low	1% - very low
<a href="#">BE-HSS-6BE033-AP07</a>	1,40	17% - low	1% - very low
<a href="#">BE-HSS-6BE033-AP08</a>	1,116	68% - high	1% - very low

**Option 2:** Navigate to **Wireless -> Access points** and click on an access point. In the access point view click on the **RF** tab at the top of the window. Select **“for 2.4 GHZ radio”** and **“for the last week”**. Check the channel utilization graph and see if there is high **802.11 traffic**. Analyze why the access point is seeing channel utilization: is it a constant high channel utilization? Is the channel utilization proportional to the number of clients connected to the AP and network usage? Are there specific time intervals with higher utilization? See figure below.

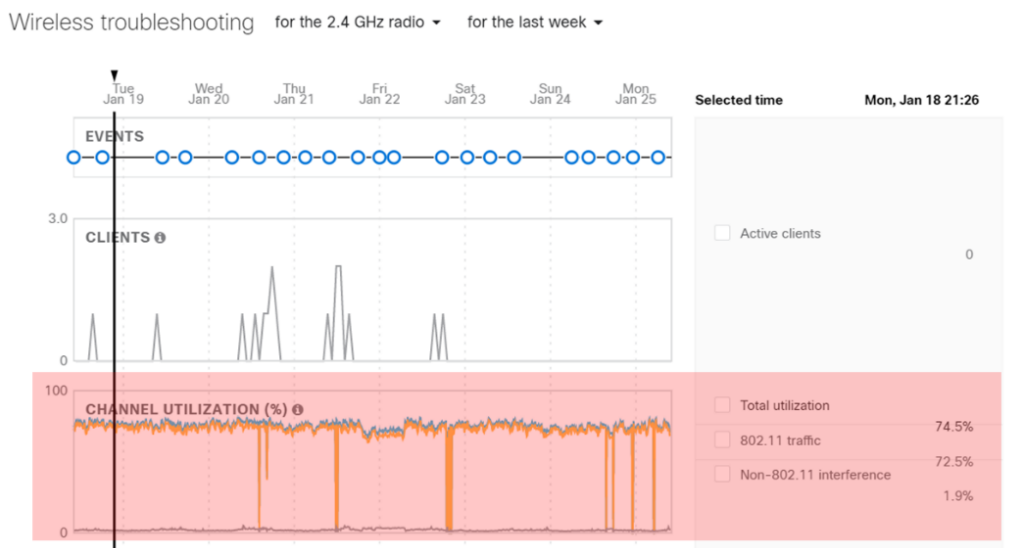

Most of the time the workshops do not have control over all the Wi-Fi devices in their proximity as they can come from places/devices outside the workshop area, however, there are some things that they can do to improve the 2.4 GHz band channel utilization:

#### Recommendations to workshop:

- Make sure the access points are installed far from other devices that can cause Wi-Fi RF interference such as: other access points, routers, IP phones, repeaters.
- Band steering – As vehicles will only communicate on the 2.4 GHz band, other devices capable of using the 5GHz band should be steered into it to avoid overcrowding the 2.4GHz band.
- Connect the VIDA-client computers to the internet using ethernet cables whenever possible and investigate if there are other devices that use Wi-Fi but can be connected by cable. (e.g. surveillance cameras, HDMI wireless casting devices).

#### 4. Local SSID management:

Every SSID broadcasting from the local access points (private or Volvo Cars Global Wi-Fi service) generates an overhead in the channel utilization which leads to poor wireless network performance. There are two ways of finding issues with SSIDs in Meraki:

**Option 1:** Navigate to **Wireless** -> **RF Spectrum** click on an access point and click on **“Interfering APs”**. Sort the list by **“dBm”** to see how much interference is the SSID causing to the access points. SSIDs with strength greater than **-60dBm** (notice the negative sign) can be causing problems. Sort by **“SSID”** and check if there are SSIDs with the same or similar name but different **“Mode”** (authentication), if SSIDs are managed by the workshop, they could optimize the number of different SSIDs. If the Volvo Cars Global Wi-Fi Services SSIDs (VCCarDW and VCVCW) can be seen in the list with high **dBm** it can indicate that the access points are too close and could be interfering with each other if they are in the same channel.

Utilization		Interfering APs		
Channel: <span>all channels</span> ▼				
BSSID	SSID	dBm ▼	Channel Mode	On LAN
b0:b8:67:e1:0c:80	Bilia Connect	-40	6 802.11n (WPA2)	not seen
b0:b8:67:e1:0c:81	Bilia Guest	-40	6 802.11n (open)	not seen
b0:b8:67:e1:0c:82	Biliacom	-40	6 802.11n (802.1x)	not seen
b0:b8:67:e1:0c:83	Vida_Test	-40	6 802.11n (WPA2)	not seen
b0:b8:67:e1:0c:80	Bilia Connect	-40	6 802.11n (WPA2)	not seen
b0:b8:67:e1:0c:81	Bilia Guest	-40	6 802.11n (open)	not seen
b0:b8:67:e1:0c:82	Biliacom	-40	6 802.11n (802.1x)	not seen

**Option 2:** Navigate to **Wireless -> Air Marshall**, wait a few seconds for the Air Marshall to load the data. Click on **“Rogue SSIDs”** to see those SSIDs that are part of the LAN (managed by the workshop). The image below shows a workshop whose APs are announcing the same SSID in 3411 ways, this can lead to high channel utilization and turn into Wi-Fi service issues.

5 rogue SSIDs <sup>i</sup> seen for the last 2 hours ▼

Edit ▼ Search... ▼

<input type="checkbox"/>	SSID ▲	Broadcast MACs	Last seen	First seen	Containment	Rogue because	
<input type="checkbox"/>	urov	00:1a:70:3c:0c:d8 (and 3411 others)	2 seconds ago	1 year ago	<span style="color:red">●</span> uncontained	Recently seen on LAN	
<input type="checkbox"/>	VOLVO_6BE302	0c:8d:db:17:38:0e (and 3 others)	1 second ago	1 year ago	<span style="color:red">●</span> uncontained	Recently seen on LAN	
<input type="checkbox"/>	VOLVO_CONNECT	06:8d:db:17:38:0e (and 3 others)	1 second ago	1 year ago	<span style="color:red">●</span> uncontained	Recently seen on LAN	
<input type="checkbox"/>	VOLVO_GUEST	0a:8d:db:17:38:0e (and 3 others)	1 second ago	1 year ago	<span style="color:red">●</span> uncontained	Recently seen on LAN	
<input type="checkbox"/>	Hidden	1a:e8:29:ca:07:13 (and 118 others)	1 second ago	1 year ago	<span style="color:red">●</span> uncontained	Recently seen on LAN	

Click on **“Other SSIDs”** to see if there is an overflow of any other SSID (not connected to the LAN) that can be reported to the workshop to see if they can take any measure.

**Recommendation to workshop:** As rule of thumb, only one SSID should be created for each type of authentication required (open, WPA, 802.1x) and combine any SSIDs that use the same type authentication.

## 5. Non Wi-Fi interference:

To discover non Wi-Fi interference issues in Meraki, navigate to **Wireless -> Access points** and click on an access point. In the access point view click on the **RF** tab at the top of the window. Select **“for 2.4 GHZ radio”** and **“for the last week”**. Check the channel utilization graph and see if there is high **Non-802.11 interference**. Analyze to see if there’s any time pattern in the channel utilization graph.

Wireless troubleshooting for the 2.4 GHz radio for the last day



**Recommendation to workshop:** The following devices can also cause RF interference degrading the performance of the wireless network. These devices should be kept as far as possible from the workshop area:

- Microwave ovens
- Cordless phones
- Bluetooth devices
- Wireless video cameras
- Wireless peripherals
- Zigbee devices
- Fluorescent lights

## 15 EXAMPLES OF KNOWN ISSUES AND HOW TO RESOLVE THEM.

### 15.1 Vehicles does not appear in VIDA for some internal VCC users having Windows 10.

#### Problem description:


Vehicles does not appear in VIDA for some internal users having Windows 10

#### Possible Reason for the issue:

Communication (TCP and UDP port 24200 and 13400) blocked on computer. This affects only Windows 10 due to a difference in how Windows 7 and 10 Windows handles the configuration of Ports in the local firewall. The issue will also cause the same issue when trying to connect to the vehicle using P2P

#### How to Identify the reason for the issue:

Below firewall rules are missing

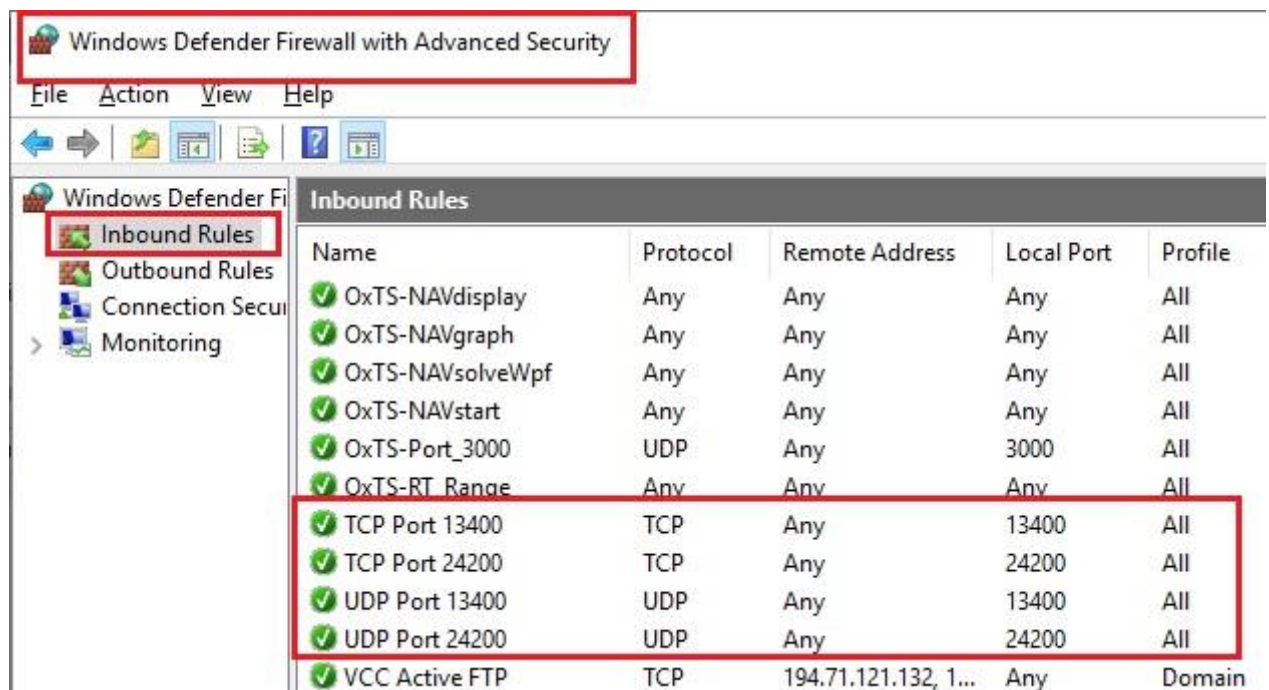

#### How to resolve the issue:

Order VIDA through Service-Now even if VIDA is already installed and even if VIDA has been ordered through Service-Now in the past.


Use below URL when ordering VIDA Prod  
[https://volvocars.service-now.com/sp?id=sc\\_home](https://volvocars.service-now.com/sp?id=sc_home)

Search for VIDA and select the one called only VIDA.

**Verification:**

Vehicles appears in VIDA and below firewall rules have been added to the computer after the request has been approved and the computer has been restarted.

*Can only be verified if you have admin rights on user level and also on the affected computer.*

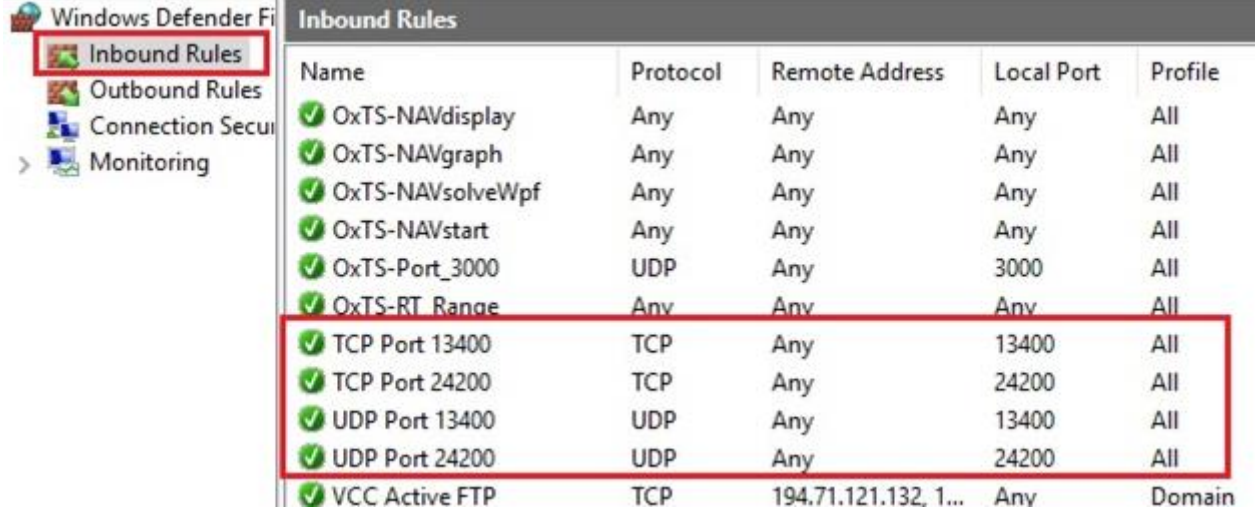

Name	Protocol	Remote Address	Local Port	Profile
✓ OxTS-NAVdisplay	Any	Any	Any	All
✓ OxTS-NAVgraph	Any	Any	Any	All
✓ OxTS-NAVsolveWpf	Any	Any	Any	All
✓ OxTS-NAVstart	Any	Any	Any	All
✓ OxTS-Port_3000	UDP	Any	3000	All
✓ OxTS-RT Range	Any	Any	Any	All
✓ TCP Port 13400	TCP	Any	13400	All
✓ TCP Port 24200	TCP	Any	24200	All
✓ UDP Port 13400	UDP	Any	13400	All
✓ UDP Port 24200	UDP	Any	24200	All
✓ VCC Active FTP	TCP	194.71.121.132, 1...	Any	Domain

## 15.2 LED on access point is blinking orange and status also shown as grey in Meraki Dashboard.

**Problem description:**

LED on 2 Access points are blinking Orange while 2 other access points at the same workshop are operational.



They are also shown as grey in Meraki Dashboard and without IP address.

#	Status	Name	MAC address	Model	Serial number	Connectivity	Local IP
1		NL-OOS- AP01	68:3a:1e:33:50:94	MR33	Q2PD-P9BJ-ZYAR		
2		NL-OOS- AP02	68:3a:1e:33:45:e4	MR33	Q2PD-K9NN- J4FU		
3		NL-OOS- AP03	34:56:fe:c8:78:ba	MR74	Q2QD-GRMN- AY3Q		10.11.1
4		NL-OOS- AP04	34:56:fe:c8:74:50	MR74	Q2QD-EWJV- S6M6		10.11.1

An orange blinking LED on the access point means that the access point is not able to establish a connection to Internet or the cloud used for the service "Volvo Cars Global Wi-Fi Service"

The reason is most likely locally in this case since 2 other access points at the same workshop are able to connect to the cloud used for the service "Volvo Cars Global Wi-Fi Service"

#### Possible Reason for the issue:

- Access to Internet or the cloud used for the service "Volvo Cars Global Wi-Fi Service" is being blocked by local firewall for the affected access points.
- Affected access point is not obtaining an IP address.
- Broken ethernet cable between the access point at the switch/router to where the access point is connected.

#### How to Identify the reason for the issue:

- Disconnect and connect the Ethernet cable connected to the none functional AP in order to restart the AP. If the issue still exists, go to next step:
- At the switch or router used for the access point, disconnect the ether cable used for the access point and connect another ethernet cable to the same port that is being used for the access point. Connect the other end of the ethernet cable to a computer that normally has access to Internet. On this computer, install the Verification tool used for "Volvo Cars Global Wi-Fi Service" Run the Verification tool and check that all tests are shown as green. The verification tool including information about each test can be found in TIE Service Journal 1000039.



IP settings	IP services	Cloud Connect
Interface (1000 Mbit)	Proxy	Gateway Ping
Subnet Size (/24)	DNS	Internet Ping
DHCP (10.4.2.5)	NTP	Controller Primary
Leasetime (123 hours)	HTTP	Controller Secondary
Scope size (254 IPs)	HTTPS	

### How to resolve the issue:

If some of the tests fails when running the verification tool, then ensure that required ports are not being blocked by any local firewall, required port-numbers are being described in the "User guide" that is available in TIE Service Journal 1000039.

IP settings	IP services	Cloud Connect
Interface (1000 Mbit)	Proxy	Gateway Ping
Subnet Size (/24)	DNS	Internet Ping
DHCP (10.4.2.5)	NTP	Controller Primary
Leasetime (123 hours)	HTTP	Controller Secondary
Scope size (254 IPs)	HTTPS	

If all tests are shown as green in the verification tool, but the AP is still blinking orange.

Then also check below before forwarding a TIE report to central.

- Connect another functional ethernet cable between the none functional access point and the switch/router used for the access point. If the issue still exists, go to next step:
- Check with local IT if the AP is being blocked or not on MAC ID address level. Ask them to check in their local firewall if any MAC address from the none functional access point are trying to access their network or not. If needed they need to unblock the access and ensure that an IP address becomes available for the affected MAC address.

The MAC address for each access point can be found in Meraki Dashboard according to below:

#	Status	Name	MAC address	Model	Serial number	Connectivity	Location
1	●	NL-OOS- AP01	68:3a:1e:33:50:94	MR33	Q2PD-P9BJ-ZYAR		
2	●	NL-OOS- AP02	68:3a:1e:33:45:e4	MR33	Q2PD-K9NN- J4FU		

**Verification:**

- The LED on the access point will finally lit with green color (blue if a device if connected)

And

- Status on the affected access point will switch from grey to green in Meraki Dashboard.  
And they will get a Local and Public IP address.

## 16 CHANGE LOG

### Changelog

Version	Date	Change
Version 1.0	2019-01-25	First version created
Version 1.1	2019-03-19	<p>Fault tracing charts added</p> <p><u>For when a vehicle does not appear in VIDA</u></p> <p><u>Details for each checkpoint</u></p> <p>---</p> <p><u>For when a vehicle appears in VIDA, but not be possible to connect to the vehicle.</u></p> <p><u>Details for each checkpoint</u></p> <p>---</p> <p><u>Basic info about Meraki dashboard and access points added.</u></p> <p>---</p> <p><u>Basic info about the Access points created.</u></p>
Version 1.2	2020-03-20	<p><u>How to fault trace and determine if an AP is broken or not.</u></p> <p>----</p> <p><u>How to request a replacement of a broken AP.</u></p> <p>---</p> <p><a href="#">Known issues and how to resolve them.</a></p>
Version 1.3	2020-03-26	<p>Below added one page 13 and 14</p> <p>Page 13 <a href="#">Note, Reconnect the non-functional AP in case it will be possible, and a need to perform further fault tracing.</a></p> <p>Page 14 <a href="#">Note, Reconnect the non-functional AP in case it will be possible, and a need to perform further fault tracing.</a></p>
Version 1.4	2020-05-14	<a href="#">13.2 LED on access point is blinking orange and status also shown as grey in Meraki Dashboard.</a>
Version 1.5	2020-05-28	Page 5 - Information about Guest Wi-Fi removed.

		<p>Page 6 – SPJ number replaced by TIE NG SJ number SPJ number 33048 has been replaced by TIE NG number 1000046</p> <p>SPJ number 33761 has been replaced by TIE NG number 1000038</p>
Version 1.6	2020-06-04	<p>Update on page 16: <a href="#">7.3 How to request a replacement of a broken AP.</a></p> <p>Below has been added: - Optional, special instructions from the workshop and where to pick up the none functional access point. Such as time or special place for the pickup.</p> <p>New on page 17: <a href="#">7.4 Return instruction for a none functional Access point.</a></p>
Version 1.7	2020-10-14	<p>Update on page 16</p> <p><a href="#">Information added with a reference to a check list that should be filled in when sending in a request for replacing a none functional access point.</a></p>
Version 1.8	2020-11-25	<p>Update on page 16</p> <p><a href="#">AP-Check-List - Volvo Cars Global Wi-Fi Service-ver1.xlsx</a> has been replaced by <a href="#">AP-Check-List - Volvo Cars Global Wi-Fi Service-ver2.docx</a></p> <p><a href="#">AP-Check-List - Volvo Cars Global Wi-Fi Service-ver2.docx</a> will now also have input fields for additional information that needs to be included.</p>
Version 1.9	2021-02-15	<p>Update on page 35- 38</p> <p>A bad Radio Frequency (RF) environment could be the reason for poor performance or cause issues when installing software into vehicles when using WI-Fi. New section added describing how to detect a possible bad RF environment.</p> <p><a href="#">POOR PERFORMANCE – VEHICLE CONNECTION AND INSTALLATION OF SW</a></p>

Version 1.10	2021-04-14	New on page 8 <a href="#"><u>4 - HOW TO ESCALATE MAJOR ISSUES</u></a>
--------------	------------	--