Rev1

December 15, 2020



Driveline Vibration Under Deceleration Between 30 - 10 mph

Service

Category Drivetrain

Section Drive Shaft/Propeller Shaft

Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2016 - 2023	Tacoma	VDS(s): AZ5CN, CZ5AN, EZ5CN, GZ5AN, RZ5CN, SZ5AN Drive Type(s): 2WD, 4WD Transmission(s): 6AT

REVISION NOTICE

November 28, 2022 Rev1:

- Applicability has been updated to include 2022 2023 model year Tacoma vehicles.
- The Introduction, Production Change Information, Warranty Information, Parts Information, and Repair Procedure sections have been updated.

Any previous printed versions of this bulletin should be discarded.

SUPERSESSION NOTICE

The information contained in this bulletin supersedes Service Bulletin No. T-SB-0071-19.

- Applicability has been updated to include 2020 2021 model year Tacoma vehicles.
- The entire bulletin has been updated.

Service Bulletin No. T-SB-0071-19 is obsolete and any printed versions should be discarded.

Page 2 of 16

Driveline Vibration Under Deceleration Between 30 - 10 mph

Introduction

Some 2016 – 2023 model year Tacoma vehicles equipped with an automatic transmission (6AT) may exhibit a vibration under deceleration (coasting or braking) typically between 30 – 10 mph. This vibration is felt in the seat, floorboard, and/or steering wheel. Follow the Repair Procedure in this bulletin to address this condition.

NOTE

- This Service Bulletin ONLY applies to models equipped with an automatic transmission (6AT). Do NOT
 use the spring part number found in the Service Bulletin for ANY manual transmission models. This
 could lead to NEW, currently nonexistent issues.
- If the vehicle is installed with an aftermarket suspension/body lift or leveling kit, this Service Bulletin does NOT apply.

Production Change Information

- This bulletin applies to ALL 2016 2023 model year Tacoma vehicles NOT equipped with the 4WD TRD Off-Road package option.
- This bulletin applies to 2016 model year Tacoma vehicles equipped with the 4WD TRD Off-Road package option produced BEFORE the Production Change Effective VINs shown below

CAB TYPE	PRODUCTION CHANGE EFFECTIVE VIN		
	5TFGZ5AN#GX040536		
Double	3TMGZ5AN#GM039554		
Double	5TFCZ5AN#GX040121		
	3TMCZ5AN#GM039538		
Access	5TFSZ5AN#GX017523		

NOTE

ALL vehicles equipped with a 4WD Off-Road Package produced AFTER the effective VIN change use the same springs in production as the countermeasure part numbers listed in this Service Bulletin. Do NOT follow this Service Bulletin for vehicles equipped with a 4WD Off-Road package produced AFTER production change effective VINs provided in the production change information table.



T-SB-0124-20

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
SU1903	Install Steering Wheel Damper and Measure Joint Angle	1.1			
Combo A	R & R Leaf Springs	1.0	45816-60030	9B	57

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.



Parts Information

045 7/75	PART N	UMBER	2.22	077/	
CAB TYPE	PREVIOUS	NEW	PART NAME	QTY	
	48210-04700 48210-04701 48210-04702 48210-04810 48210-04811 48210-04710 48210-04711 48210-04711	48210-04841	Spring Assy, RR RH	1	
Double	48220-04340 48220-04341 48220-04342 48220-04450 48220-04451 48220-04452 48220-04350 48220-04351 48220-04352	48220-04481	Spring Assy, RR LH	1	
Aggess	Access 48210-04812 48210-04710 48210-04711 48210-04712 Access 48220-04340 48220-04341 48220-04342 48220-04450	48210-04832 Spring Assy, RR RH		1	
Access		48220-04472	Spring Assy, RR LH	1	
Λ.11	45713-	-35040	Damper, Steering Shake	1	
All	90080-	-15079	Screw, With Washer	2	



Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Digital Angle Gauge*	<u>01815-00102</u>	1

^{*}Essential SST.

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

Repair Procedure

- 1. Confirm the condition exists.
 - A. Does the vehicle exhibit a vibration under deceleration (coasting or braking) between 30 10 mph?
 - YES Continue to substep B.
 - NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
 - B. Use the following method to determine if this bulletin applies to the vehicle.

For 4WD vehicles:

- (1) Remove the rear driveshaft.
- (2) Shift into 4WD HI.
- (3) Test-drive the vehicle.

After using that method, does the vehicle exhibit a vibration?

- YES This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- NO Continue to step 2.

For 2WD vehicles:

- (1) Begin decelerating from 30 10 mph.
- (2) Shift the vehicle from Drive to Neutral.

Did the vehicle vibration sensation remain the same when decelerating in neutral?

- YES This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- NO Continue to step 2.



Repair Procedure (continued)

2. Remove the steering wheel pad.


CAUTION

Wait at LEAST 90 seconds AFTER disconnecting the cable from the negative (–) battery terminal to disable the SRS system.

Refer to TIS, applicable model and model year Repair Manual:

- 2016 / 2017 / 2018 / 2019 / 2020 / 2021 / 2022 / 2023 Tacoma:
 Vehicle Interior Supplemental Restraint Systems "Supplemental Restraint Systems:
 Steering Pad: Removal"
- Remove the steering wheel switch wire harness retainer bracket (ONLY for vehicles with steering wheel mounted switches).

Figure 1.

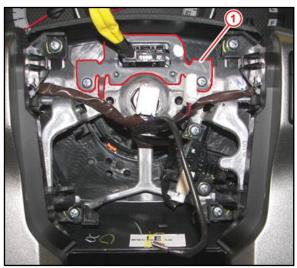

Steering Wheel Switch Wire Harness Retainer Bracket



Repair Procedure (continued)

4. Install the steering wheel damper using two NEW screws in the locations shown.

Torque: 2.35 N*m (24 kgf*cm, 20.8 in*lbf)


NOTICE

When disconnecting ANY airbag connector, take care not to damage the airbag wire harness.

NOTE

Secure the steering wheel switch wires to the steering wheel damper bracket hooks as shown.

Figure 2.

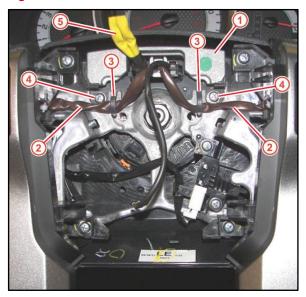

1	Damper
2	Steering Wheel Switch Wire Harness
3	Damper Bracket Wire Retainer Hook
4	Screw
5	Driver Side Airbag Wire Harness

5. Install the steering wheel pad.

Refer to TIS, applicable model and model year Repair Manual:

- 2016 / 2017 / 2018 / 2019 / 2020 / 2021 / 2022 / 2023 Tacoma:
 Vehicle Interior Supplemental Restraint Systems "Supplemental Restraint Systems:
 Steering Pad: Installation"
- 6. Raise the vehicle using a drive-on hoist or wheel alignment rack.

NOTE

Vehicle suspension MUST be at ride height.



Repair Procedure (continued)

- 7. Set up the digital angle gauge.
 - A. Clean the gauge mounting surfaces of ANY dust and debris.
 - B. Place the gauge with the screen facing the passenger side of the vehicle up/down.

NOTE

The digital angle gauge is directional and must be placed with the screen facing the passenger side of the vehicle for the up/down indicator to properly display the angle. The tool indicates a positive or negative angle based on the right side of the tools vertical location.

C. Power on the digital angle gauge and set it to "Absolute Mode." ABS will be displayed in the upper right corner of the display as shown.

Figure 3. Digital Angle Gauge



Indicates Absolute Mode



Repair Procedure (continued)


TOYOTA

- 8. Verify which flange type the vehicle is equipped with.
 - Large flange (Figure 4) Continue to step 9.
 - Small flange (Figure 5) Go to step 10.

NOTE

Make sure to wipe off the area BEFORE taking the pinion flange measurement.


Figure 4.

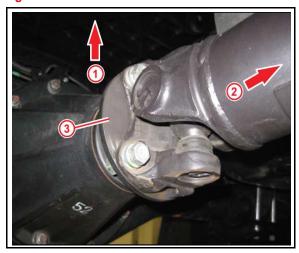

1	Up
2	Front
3	Large Flange

Figure 5.

December 15, 2020

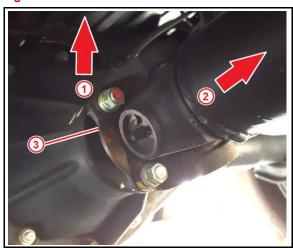

1	Up
2	Front
3	Small Flange


TOYOTA

Driveline Vibration Under Deceleration Between 30 - 10 mph

Repair Procedure (continued)

- 9. Measure the pinion flange angle (F/A) Large Flange Type.
 - A. Place the digital angle gauge against the flange surface.
 - (1) Ensure the digital angle gauge is firmly against the flange to obtain an accurate pinion flange angle as shown.

Figure 6. Gauge Placement in Relation to Vehicle

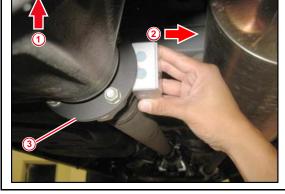

1	Up
2	Passenger Side of Vehicle
3	Pinion Flange

(2) Record the pinion flange angle (F/A).

Figure 7.






Repair Procedure (continued)

- 10. Measure the pinion flange angle (F/A) **Small Flange Type**.
 - A. Remove the propeller shaft.

Refer to TIS, applicable model and model year Repair Manual:

- 2016 2021 Tacoma:
 Engine/Hybrid System Propeller Shaft "Propeller Shaft: Propeller Shaft Assembly (for 4WD): Removal"
- <u>2022 2023</u> Tacoma:
 Engine/Hybrid System Propeller Shaft "Propeller Shaft: Propeller Shaft Assembly (for 4WD): Removal"
- <u>2016 2023</u> Tacoma:
 Engine/Hybrid System Propeller Shaft "Propeller Shaft: Propeller Shaft Assembly (for 2WD): Removal"
- B. Place the digital angle gauge against the flange surface.
 Ensure the digital angle gauge is firmly against the flange to obtain an accurate pinion flange angle as shown.

Figure 8.

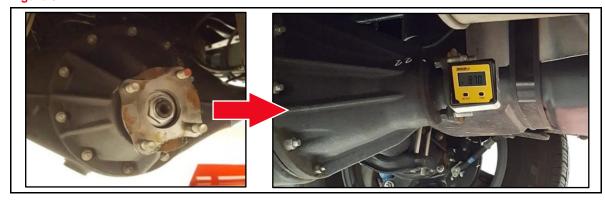

Repair Procedure (continued)

11. Measure the propeller shaft to pinion joint angle (J/A).


NOTE

ALL measurements MUST be taken from the passenger side of the vehicle facing the driver side. Refer to Figure 9 to ensure that the angles measured have the correct positive (+) or negative (–) values assigned.

- An arrow pointing up indicates a positive (+) angle. In the example on the left, the angle measured is a positive 1.15 (+1.15).
- An arrow pointing down indicates a negative (–) angle. In the example on the right, the angle measured is a negative 0.95 (–0.95).

Figure 9.



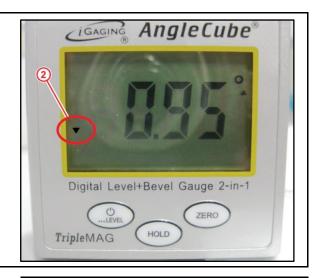

1 Up Arrow (Positive)

- 2 Down Arrow (Negative)
- 12. Measure the propeller shaft angle (P/A).
 - A. Position the flange to match the orientation shown.

Figure 10.



1	90°
2	Up



Repair Procedure (continued)

B. Use the digital angle gauge and measure the angle of the rear section of the two-piece propeller shaft.

Ensure the digital angle gauge is placed along the centerline of the propeller shaft as shown in Figure 11.

Figure 11. CORRECT Placement of Digital Angle Gauge




Figure 12. INCORRECT Placement of Digital Angle Gauge



NOTE

The gauge face needs to face the passenger side.

Figure 13.

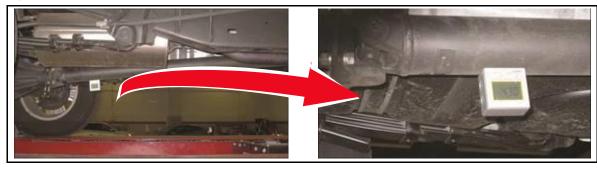



Repair Procedure (continued)

C. Record the propeller shaft angle (P/A).

Table 1. Joint Angle Worksheet (Pinion Flange Angle Minus Propeller Shaft Angle = Joint Angle)

PINION FLANGE ANGLE	-	PROPELLER SHAFT ANGLE		JOINT ANGLE
F/A	-	P/A	II	J/A

December 15, 2020

NOTE

Joint angle (J/A) can be a negative (-) value.

13. Verify if the vehicle is equipped with standard or firm ride suspension.


Look up the factory option codes (accessories) in vehicle history on TIS.

Does the vehicle have option codes CW, OF, OC, PT, or PY?

- YES The vehicle has firm ride suspension.
- NO The vehicle has standard suspension.
- 14. Record the model code for use in the next step.

The model code can be found on the Vehicle Identification Label in the driver doorjamb as shown.

Figure 14.

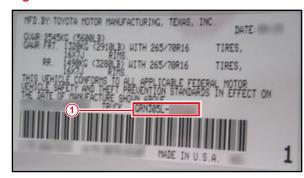

1 Model Code

December 15, 2020

Driveline Vibration Under Deceleration Between 30 - 10 mph

Repair Procedure (continued)

15. After the joint angle, spring type, and model code have been recorded, refer to the table below to determine if the joint angle is in specification.

Table 2.

DRIVETRAIN	MODEL CODE	CAB TYPE	GRADE	TYPE	JOINT ANGLE RANGE SPECIFICATION
	ODNIGOEL DOTLLIA	6	I the Maria	Firm	+1.41° to +3.41°
	GRN305L-PRTLHA		Limited	Standard	+1.38° to +3.38°
	GRN305L-PRTSHA	Double	Δην	Firm	+1.41° to +3.41°
4WD	GRN303L-FRT3HA		Any	Standard	+1.38° to +3.38°
	GRN305L-CRTSHA	Access	Any, Excluding Off-Road Package	Firm	+1.7° to +3.7°
			Off Road Package	Standard	-0.6° to +1.4°
			Any		+1.67° to +3.67°
	GRN325L-PRTLHA GRN325L-PRTSHA	- Double	Limited	Firm	+1.86° to +3.86°
				Standard	+1.22° to +3.22°
2WD			Any	Firm	+1.86° to +3.86°
2000				Standard	+1.22° to +3.22°
		Access	Any	Firm	+1.46° to +3.46°
	GRN325L-CRTSHA			Standard	+1.46° to +3.46°

Is the joint angle in specification?

- YES Continue to step 16.
- **NO** Go to step 17.
- 16. Test-drive the vehicle between 10 30 mph and confirm the level of vibration has improved under deceleration or acceleration.

Did the vibration condition improve?

- YES STOP! The applicable repair steps have been completed.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.



Repair Procedure (continued)

17. Replace the leaf spring using the part information in the following table:

Table 3.

DRIVETRAIN	MODEL CODE	CAB TYPE	GRADE	LH PART NUMBER	RH PART NUMBER
4WD	GRN305L-PRTLHA	Double	Limited	48220-04481	48210-04841
	GRN305L-PRTSHA		Any		
	GRN305L-CRTSHA	Access	Any	48220-04472	48210-04832
2WD	GRN325L-PRTLHA	Double	Limited	48220-04481	48210-04841
	GRN325L-PRTSHA		Any		
	GRN325L-CRTSHA	Access	Any	48220-04472	48210-04832

NOTICE


When tightening the U-bolt nuts, make sure to set to the following torque:

Torque: 60 N*m (610 kgf*cm, 44 ft*lbf)

Refer to TIS, applicable model and model year Repair Manual:

- 2016 2019 Tacoma: Suspension – Rear Suspension – "Suspension: Rear Leaf Spring: <u>Removal</u> / <u>Installation</u>"
- 2020 2021 Tacoma: Suspension – Rear Suspension – "Suspension: Rear Leaf Spring: <u>Removal</u> / <u>Installation</u>"
- 2022 2023 Tacoma:
 Suspension Rear Suspension –
 "Suspension: Rear Leaf Spring:
 Removal / Installation"

Figure 15.

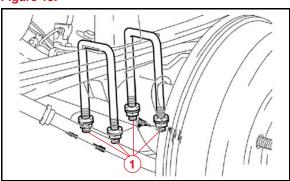

1 U-bolt Nuts

NOTE

Per the applicable Repair Manual, fasteners for shocks and leaf spring bushings should be pre-tightened while the vehicle is lifted. Final torque should be set while the vehicle is on the ground.

18. Test-drive the vehicle and confirm that the level of vibration has improved under deceleration between 30 – 10 mph.