

IDMA (Interactive Display Module A) Screen Rattle / Vibration

23MY New Range Rover Sport

Issue:

Interactive Display Module A (IDMA) screen rattling or vibrating

Cause:

IDMA bracket gap between the locator hole and peg is above specification, and in some cases the bracket fixings are not torqued correctly

Action

Please carry out the following.

1. Remove the IDMA screen and the center trim panel*
2. Remove and refit the IDMA bracket fixings (x8 bolts), torque to 5Nm, see attachment
3. Fit 2x Nitto foam** strips (4cm x 1.5cm)
4. Refit center trim panel and IDMA screen.

*Please refer to the Topix Removal and Installation section "415-01 INFORMATION AND ENTERTAINMENT SYSTEM FRONT INFOTAINMENT CONTROL MODULE".

Refer to SSM75878 for more details

**Available in the Land Rover Squeaks & Rattles Kit (LR037626)

