

## Technical product information

<b>Topic</b>	Continental GT Convertible – Front seat belt webbing twisted
<b>Market area</b>	Russische Föderation (5RU),Australia E04 Bentley rest Asia and Australia (6E04),China 796 VW Import Comp. Ltd (Vico), Beijing (6796),Germany E02 Bentley rest Europe (6E02),Japan E03 Bentley Japan (6E03),Korea, (South) E08 Bentley South Korea (6E08),United Arab Emirates E06 Bentley Middle East and Africa (6E06),United Kingdom E01 Bentley UK (6E01),United States E05 Bentley USA and rest America (6E05)
<b>Brand</b>	Bentley
<b>Transaction No.</b>	2068645/1
<b>Level</b>	EH
<b>Status</b>	Released for publishing
<b>Release date</b>	18-Nov-2022

### New customer code

Object of complaint	Complaint type	Position
occupant protection, pedestrian protection -> belts	visual appeal / surface	

## Vehicle data

### Continental GT Convertible

#### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
394*	2012	E		*	*	*
394*	2013	E		*	*	*
394*	2014	E		*	*	*
394*	2015	E		*	*	*
394*	2016	E		*	*	*
394*	2017	E		*	*	*
394*	2018	E		*	*	*

## Documents

Document name
<a href="#">master.xml</a>
<a href="#">master.doc</a>

## Customer statement / workshop findings

Front seat belt webbing twisted



Figure 1

The front seat belt webbing is twisted this is evident in both the stowed position and also when the seat belt is worn see Figure 1



Figure 2

The front seat belt in the stowed position should be as shown in figure 2

## Technical background

The plastic seat belt webbing guide, a plastic moulding incorporated in the seat belt upper 'D' loop assembly, may not have been fully clipped onto the metal 'D' loop. When this is the case a twist in the seat belt webbing is possible

## Production change

Assembly method revised

## Measure

In the event of a twist being identified in a front seat belt then carry out the following check on that specific seat belt

1. Remove the rear quarter waistrail reference workshop manual Rear quarter waistrail – To remove and fit Rep Gr.70



Figure 3



Figure 4

2. Referencing figure 3 and 4 inspect the seat belt webbing plastic guide (A). Ensure the three clipping points (C) are securely clipped to the 'D' ring (B).
3. If the guide is not securely clipped then remove and discard the guide and fit a new replacement guide.
4. On completion the guide must be correctly secured to the 'D' ring paying close attention to both outer clipping features (C)

## Warranty accounting instructions

Please Note: Normal warranty policies are applicable

Warranty Type 110  
Labour Operation Code 6926 1902  
Damage Service Number 6926  
Damage Code 00 18  
Location Code 001 left, 002 right  
Time 140 TU

### Parts information

Part number	Description	Quantity
3W7857827	Belt guide left hand	1
3W7857828	Belt guide right hand	1