## Camera cover of reversing camera does not fold in

LI54.65-N-075675
1
54.65 - Parking assist
12/11/22
Model 447.6/7 with code FR1 (Non-folding reversing camera) and with code FR8 (Reversing camera)
V-Class removed, will be published in a new GI
V-Class removed, will be published in a separate GI

## Complaint

Camera cover of reversing camera does not fold in (see Picture 01, shown on vehicle with code W65 (Tailgate)).



Attachments	
File	Description
01.jpg	Camera cover of reversing camera does not fold in (shown on vehicle with code W65 (Tailgate)).

## Cause

Discontinuation of reversing camera folding function.

## Model 447.6/7 (Metris)

<u>Info:</u> As of production month 02/2021, the additional equipment description Non-folding reversing camera (code FR1) will be added automatically at the factory to all vehicles of model 447.6/7 with the optional reversing camera (code FR8) (see Important Information no. 01-2021 of 29.01.2021 as well).

TEITHI III S							
Information:	The global shortage of semiconductor cor	mnone	ents is th	ne reason fo	r this technical adaptation		
<u>imormation.</u>	The global shortage of semiconductor cor	проп	511t3 13 ti	10 100001110	tino teorimoar adaptation.		
Remedy							
Note: Do not	replace any component parts or carry ou	t any	diagnos	tic work!			
Model 447.6	7 (Metris)						
no longer av ra remains o	oduction of code FR1 (Rearview camera, ailable (discontinuation of camera cover (lipen/folded out at all times. The represent in (N87/15) is not restricted and functions	KAB) ation (	control of the ca	unit (N144)). amera image	Consequently, the reversing came-		
<u>Information:</u> There are no plans for a retrospective adaptation of the folding function through Aftersales.							
Note: The replacement of component parts or invoicing of materials or wage costs under warranty or goodwill is not permitted if this is in connection with the limited function of the camera cover for the reversing camera on vehicles with code FR1 (Rearview camera, non-folding).  Symptoms							
Communication/information > Assistance and warning systems > Parking assist > Reversing camera > Malfunction							
0 1 1	**************************************						
	nit/fault code		- "				
Control unit	rol unit '360° camera' (360° camera)		Fault te	xt			
(SVS205)	roi unit 300 camera (300 camera)						
B84/5 - Bac	kup camera (RFK) (RVC222)						
B84/3 - Bac	kup camera (RFK) (RVC204)						
B84/20 - Ba	ckup camera (RFK) (RVC177_447)						
B84/3 - Bac	kup camera (RFK) (RVC177)						
Operation	numbers/damage codes						
Op. no.	Operation text	Time	)	Damage code	Note		