

Memory Function of Outside Mirror (Actuated Mirror-Inverted)

Topic number	LI88.79-P-075629
Version	1
Function group	88.79 - Exterior mirrors - electrical system
Date	12/5/22
Validity	Model series 167, 294 and 296 Vehicles from manufacturing date 05 August 2022 Vehicles up to manufacturing date 14 November 2022
Reason for change	

Complaint

The mirror glass of the outside mirror is actuated in the wrong direction when retrieving the memory position or retrieving the position of the curb detection automatic system.

Left outside mirror: Left/right actuation swapped around

Right outside mirror: Up/down actuation swapped around

Example: When retrieving from the curb detection automatic system (engaging drive mode R), the mirror moves upward instead of downward. When engaging drive mode D, the mirror moves downward instead of upward.

Note: The directions for glass adjustment are correctly actuated through use of the mirror glass adjustment switch.

Cause

Glass adjustment motor installed with incorrect setting.

Remedy

Exchange glass adjustment motor.

Symptoms
Body > Door/Flap > Outside mirror > Mirror/Mirror adjustment > Operation malfunction

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A1678201401			Glass adjustment motor for mirror glass adjustment	n.B.		X

Operation numbers/damage codes

XENTRY TIPS

Op. no.	Operation text	Time	Damage code	Note
---------	----------------	------	-------------	------