

STAR ONLINE PUBLICATION















Case Number: S2208000064

Release Date: March 2022


Symptom/Vehicle Issue: Check Engine Light Is On. P0480 Cooling Fan 1 Control

Circuit/Open

Discussion: The customer may bring in their vehicle because the check engine light (MIL) is on. Upon scanning the vehicle for DTC's you may find P0480 Cooling Fan 1 Control Circuit/Open. This may be caused by the ground wire not being fully welded/secured to the ground eyelet.

Diagnosis: Inspect the G908A ground located in the engine bay, below the PCM behind the passenger side headlight. Determine if the ground eyelet is properly

secured to the ground wire.

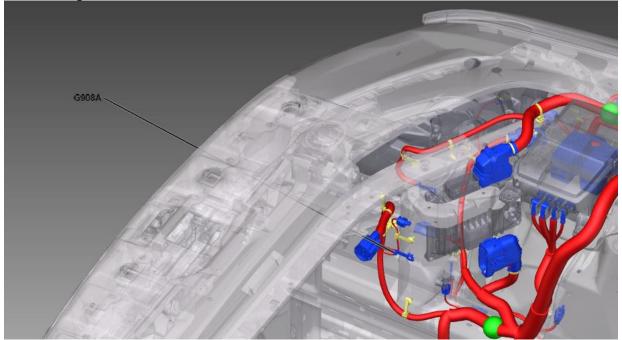

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

FCA US LLC Version 4.4 11/05/2021



STAR ONLINE PUBLICATION















Repair Procedure: It is recommended to spot solder the ground wire onto the eyelet terminal.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

FCA US LLC Version 4.4 11/05/2021